## State of New Mexico Fne

Minerals and Natural Resources Department

Form C-103 Revised 1-1-89

Submit 3 copie	١
to Appropriate	
District Office	
District Office	

DISTRICT!

OIL CONSERVATION DIVISION

P.O. Box 1980, Hobbs, NM 88240 DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410

Section 8

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

30-025-32495

7. Lease Name or Unit Agreement Name

5. Indicate Type of Lease STATE [ FEE 🔀

6. State Oil / Gas Lease No.

WELL API NO.

SUNDRY NOTICES AND REPORTS ON WELL
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIECEDENT DECEDITION LICE "ADDITION FOR DEDMIT

(FORM C-101) FOR SUCH PROPOSALS.) OIL

1. Type of Well: WELL  $\boxtimes$ WELL **OTHER** 

2. Name of Operator TEXACO EXPLORATION & PRODUCTION INC.

3. Address of Operator

P.O. Box 46510, Denver Colorado 80201-6510

5 9. Pool Name or Wildcat

Feet From The EAST

DAVIS, F B.

8. Well No.

**TEAGUE TUBB** 

4. Well Location

<u>H</u> : 1980 Unit Letter

Feet From The NORTH Line and 330 23-S Township\_

Range 37-E

NMPM \_

LEA COUNTY

Line

10. Elevation (Show whether DF, RKB, RT,GR, etc.)

GR-3319', KB-3331'

NOTICE OF INTENTION TO:				SUBSEQUENT REPORT OF:		
PERFORM REMEDIAL WORK		PLUG AND ABANDON		REMEDIAL WORK ALTERING CASING		
TEMPORARILY ABANDON	$\bar{\Box}$	CHANGE PLANS		COMMENCE DRILLING OPERATION PLUG AND ABANDONMENT		
PULL OR ALTER CASING	$\overline{\Box}$			CASING TEST AND CEMENT JOB		
OTHER:			🗆	OTHER: COMPLETION	X	

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

- UNION WL RE-PERFORATED 6090'-6241' W/ 4-JSPF 90 DEG PHASING. 01-18-95. SET GUIBERSON RBP ON WL @ 6180'.
- RU DOWELL AND ACIDIZED TUBB W/ 2000 GALS OF 15% NEFE. FRAC'D TUBB W/ 45000 GAL OF 40# BORATE CROSSED LINKED GEL AND 6000 LBS OF 100 MESH, AND 131500 LBS OF 20/40 OTTAWA SAND DOWN 7" CSG. 01-24-95.
- TIH W/ RETRIEVING TOOL AND TAG SAND @ 6087'. CLEAN OUT SAND TO TOP OF RBP @ 6180'. CIRCULATE CLEAN. RELEASE RBP & TOH. 01-26-95.
- TIH & TAG SAND @ 6212', COS TO 6290' AND TOH. PICK UP 7" PKR AND TIH TO 6017'. SET PKR AND TEST TO 100 PSI. 01-27-95.
- RELEASE PKR, NU BOP AND LD 23 JOINTS. PU 23 JOINTS AND RESET PKR AND START SWABBING. 01-29-95.
- PUT ON FLOW TEST 02-01-95. FL 25 BO, 118 BLW, 460 MCFD, FTP 350 20/64 CK IN 24 HOURS. 02-03-95.
- KILL TBG, INSTALL TIW VALVE, NU DUAL ADAPTER SPOOL TO TBG SPOOL, NU BOP AND TEST TO 1500 PSI. RELEASE PKR AND TOH. TIH W/ RETRIEVING TOOL TO 6000'. 02-07-95.
- TOH W/ RBP ON 2-3/8" TBG AND LD RBP. RU UNION WL AND SET PKR @ 6300'. TIH W/ 2 JTS OF 2-3/8" TAILPIPE. 02-09-95
- ND BOP, NU TREE AND TEST TRE TO 3000 PSI. REMOVED BPV FROM UT AND LT. 02-10-95.
- 10. SW LT 72 BLW IN 3 HOURS. 02-11-95. SW UT 180 BW IN 9 HOURS. 02-15-95.

	ation above is true and complete to the best of my knowledge a		DATE 11/15/94
TYPE OR PRINT NAI	0 D Dh		Telephone No. (303)621-4851
(This space for State Use)	ORIGINAL SIGNED BY JERRY SE	HOTX	MAR 14 1995
APPROVED BY		_TITLE	DATE
CONDITIONS OF AF	PROVAL, IF ANY:	DeSoto/Nichols 10-94 ver 2.0	

<sup>12.</sup> Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.