

- 8-3-96 Open frac valve, well on vac, ND frac valve, NU WH & BOP, TIH w/tbg, tag sand, wash sand to RBP, catch plug & POOH w/same. Run temp find frac f/5100'-5655'. PU Arrowset-1, RIH w/pkr, ND BOP, packoff WH, circ backside w/2% KCl w/pkr fluid, unpack WH, set pkr in 14K tension, repack WH, test to 500 psi. IFL 800'.
- 8-5-96 SITP 700 psi, open well to frac tank, well flowing 5 hrs, SI, install choke & NU WH to frac tank.
- 8-6-96 Date of first sales @ battery & gas pipeline.