

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-34974
5. Indicate Type of Lease	STATE FEE ☒
6. State Oil / Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMI (FORM C-101) FOR SUCH PROPOSALS.	
1. Type of Well:	OIL WELL ☒ GAS WELL ☐ OTHER ☐
2. Name of Operator	TEXACO EXPLORATION & PRODUCTION INC.
3. Address of Operator	205 E. Bender, HOBBS, NM 88240
4. Well Location	Unit Letter G : 1650 Feet From The NORTH Line and 1650 Feet From The EAST Line Section 8 Township 23-S Range 37-E NMPM LEA COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3324'	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	SUBSEQUENT REPORT OF:
NOTICE OF INTENTION TO:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐
PULL OR ALTER CASING ☐	OTHER: ☐
REMEDIAL WORK ☐	
COMMENCE DRILLING OPERATION ☐	
CASING TEST AND CEMENT JOB ☐	
OTHER: ☐	
SPUD & SURFACE CSG ☒	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

4-04-00/5-02-00: SPUD 12 1/4" HLE @ 3:00 AM 4-04-00DRLD 150-337,516,722,926,960,996,1197. RAN 28 JTS 1211' 8 5/8" 24# K-55 STC CSG SET @ 1197. CMT W/520 SX CL W/4% GEL FOLLOWED BY 140 SX CL C W/2% SALT. PLUG DOWN @ 11:09 AM. CIRC 80 SX CMT TO PIT. RAN 11 CENTRALIZERS.WOC 4 HRS. TAG CMT @ 987. DRLD 1197-1335,1739,1832,1863,2047,2216,2290,2245-2385,2404,2446,2509,2520,2551,2571,2612,2622,2673,2736. REAM 2457-2736. DRLD 2736-2757,2798,2829,2892,3077,3270,3292,3576,3820,3861,4101,4224,4348,4406,4477,4664,4849,4867,5045,5097,5280,5347,5377,5439,5840,6025,6181,6274,6428,6555,6575,6700.TIH W/OS. WSH DN TO FSH. WSH TO TOP OF FSH @ 6086. SPOT 100 BBL 40 VIS GEL PLG ON TOP OF FSH. TIH W/MILL, JARS, BS @ ACC. MIX & PUMP 100 BBLs 40 VIS GEL PLG ON TOP OF FSH.TIH W/OS. CUT DRLG LINE. WSH & REAM 90' TO BTM. DRLD 6700-6733, 6920,6948,7072,7234,7315,7319-7540, 7600,7650. PU 7 7/8" HOLE OPENER MILL. TIH W/5 JTS TO 3108'. SET DOWN. SPOT 50 BBL OIL. RAN FREE POINT. 100% STUCK @ 2523. BACKOFF @ 2456. TIH W/BIT, BS, DC'S, DP.WASH 2319-2452. WASH & REAM 2392-2588, & 3115. TIH W/BIT & DC'S & JARS. WASH & REAM 6670-6792. TAG SOLID. 7650 TDTOH W/BIT. SLM TO FSH 6786'.WASH 6739-7660. RU TO LOG. RAN PLATFORM EXPRESS - TD 7647'. RAN NGT/SONIC FMI/GR. NUFL.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE *J. Denise Leake* TITLE Engineering Assistant

DATE 5/3/00

TYPE OR PRINT NAME J. Denise Leake

Telephone No. 397-0405

(This space for State Use)

APPROVED

CONDITIONS OF APPROVAL, IF ANY. TITLE

DATE AUG 7 2000