

UNITED STATES N. H. DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
NEW MEXICO 88240

Budget Bureau No. 1004-0135
Expires August 31, 1985
5. LEASE DESIGNATION AND SERIAL NO.
LC-062300

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/> <i>Injection</i>	7. UNIT AGREEMENT NAME Cotton Draw Unit
2. NAME OF OPERATOR Texaco Inc.	8. FARM OR LEASE NAME Cotton Draw Unit
3. ADDRESS OF OPERATOR P.O. Box 730, Hobbs, NM 88240	9. WELL NO. 55
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 330' FNL & 330' FEL (Unit Letter A)	10. FIELD AND POOL, OR WILDCAT Paduca Delaware
14. PERMIT NO.	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 29, T-25-S, R-32-E
15. ELEVATIONS (Show whether DF, RT, OR, etc.) 3376' DF	12. COUNTY OR PARISH Lea
	13. STATE NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF	PULL OR ALTER CASING
FRACTURE TREAT	MULTIPLE COMPLETION
SHOOT OR ACIDIZE	ABANDON*
REPAIR WELL	CHANGE PLANS
(Other)	

SUBSEQUENT REPORT OF:

WATER SHUT-OFF	REPAIRING WELL
FRACTURE TREATMENT	ALTERING CASING
SHOOTING OR ACIDIZING	ABANDONMENT*
(Other)	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

- 1) MIRU DA&S plugging rig 11-11-89.
- 2) Ran free point. Cut off 4-1/2" csg @ 1140'. Pld 1140' 4-1/2". WIH w/tbg.
- 3) Cir hole w/10# brine gel mud. Spt 40 sx plug in 4-1/2" @ 1190' up to 1009' (181') Tag O.K.
- 4) Spot 2nd plug (50 sx) @ 1000' in 6-3/4" hole up to 858'. Tag O.K.
- 5) Spot 3rd plug (40 sx) @ 394' in 6-3/4" hole up to 289' 7-5/8" csg. Tag top @ 105'.
- 6) Spot 4th plug (12 sx) @ 50' to surface in 7-5/8".
- 7) Cut off WH. Instld marker. Cleaned locn.

No water basin in area.

18. I hereby certify that the foregoing is true and correct

SIGNED *Ja Head* TITLE Area Manager DATE 11/29/89

(This space for Federal or State office use)

APPROVED BY TITLE PERMIT REVIEWER DATE 12-13-89

CONDITIONS OF APPROVAL, IF ANY:

Approved for completion of the well bore.
Plugging and cementing is required until
surface restoration is completed. *See Instructions on Reverse Side

RECEIVED

DEC 1 10 34 AM '89