

F. Hanagan
CONTINUED FROM PAGE 1

- 1-15-80 Went in hole w5 ½" magnet. Stopped @ 142'. POH. Went in hole w/wireline spear to 202'. POH. Went in hole w/7" blade bit to 243'. Could not rotate. Pld up to 237'. Rotated and cleaned out to 243'. POH
- 1-16-80 Drld. & cleaned out to 156'.
- 1-17-80 Drld. & cleaned out from 156' to 173'. RD & move off location.
- 1-21-80 Picked up drill collar & washed out open hole.
- 1-22-80 Picked up 4" drill pipe & cleaned out to 2090'. Drld. - fill from 2090 to 2190' (top of 7").
- 1-23-80 Drld. on wood to 2580'. Cleaned out csg from 2190' to 2580'.
- 1-25-80 Circ. & mix mud. Washed & cleaned out down to 2300'. Now circ & mixing mud to condition mud and hole.
- 1-26-80 Cleaned out 7" csg. from 2300' to 2683'. Mixed mud and conditioned hole. Spot 40 sx plug from 2683 - 2596 - 87' plug. Spot 60 sx 2240'. Tagged @ 2190'. Top of 7" csg. Spot additional 40 sx @ 2190'. Tagged @ 2138'. (100 sx from 2240 to 2138)
- 1-27-80 Spotted 60 sx plug @ 1500'. - tag-no plug. Spot 30 sx plug @ 1500'tag no plug. Spot 75 sx plug @ 1500' - tag no plug. Spot 75 sx plug @ 1500' - tag @ 1342' (158'plug) Spot 50 sx plug @ 1150 to 1050.
- 1-28-80 Spot 150 sx plug @ 200'. POH -
- 2-1-80 Pumped 60 sx - brought cement ot surface.

All pits have been filled and location has been levelled and cleared of junk.