

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30 025 11159
5. Indicate Type of Lease	STATE ☐ FEE ☒
6. State Oil / Gas Lease No.	NM 032715
7. Lease Name or Unit Agreement Name	COOPER JAL UNIT
8. Well No.	150
9. Pool Name or Wildcat	LANGLIE MATTIX & JALMAT
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	

SUNDRY NOTICES AND REPORTS ON WELL
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:	OIL WELL ☒ GAS WELL ☐ OTHER ☐
2. Name of Operator	TEXACO EXPLORATION & PRODUCTION INC.
3. Address of Operator	205 E. Bender, HOBBS, NM 88240
4. Well Location	Unit Letter <u>L</u> <u>1650</u> Feet From The <u>SOUTH</u> Line and <u>990</u> Feet From The <u>WEST</u> Line Section <u>19</u> Township <u>24S</u> Range <u>37E</u> NMPM <u>Lea County</u> COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☒ PERF & ACIDIZE

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

6-09-99: MIRU. UNSEAT PUMP. NDWH. NUBOP. UNSET TAC. LOWER & TAG BTM @ 3100'. PERFS OPEN 3085-3100'. RBP 1 JT DEEPER.
6-10-99: TIH W/GR-CCL LOG FR 3100-2100'. TIH W/PERF GUN & PERF YATES FORMATION 2995-3028'. TIH W/BIT & CSG SCRAPER. TI W/SONIC HAMMER, SN ON TBG TO 2949'.
6-11-99: ACID WASH YATES PERFS 2995-3055' W/3000 GALS 15% NEFE HCL & 130 BBLS 2% KCL WTR. TIH W/WRP & SET @ 3037'. TIH W/PKR, SN ON TBG. PSA 3032' & TEST WRP TO 1000#-OK. PULL PKR TO 2949' & SET. LOAD & TEST BACKSIDE TO 500#-OK.
6-12-99: PRESS CSG TO 500#-OK. ACIDIZE YATES PERFS 2995-3028' W/3000 GALS 15% NEFE HCL & 1050# RK SLT. REL PKR. TIH W/RETR TOOL ON TBG & WASH OFF 5' SALT ON TOP OF WRP @ 3037'. LATCH & REL WRP. TIH W/OPSMA, SN, TBG, TAC. NDBOP. SET TAC. NUWH. MA @ 3069'. SN @ 3042'. TAC @ 2946'. RU SWAB. FL @ 2500'. END FL @ 2800'.
6-14-99: TIH W/GAS ANCHOR, PUMP, SNKR BARS, & RDS. HANG ON. LOAD & TEST. RIG DOWN. PUMPING @ 12:00 PM.
7-10-99: ON 24 HR OPT. PUMPED 11 BO, 141 BW, & 28 MCF.
FINAL REPORT

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Denise Leake TITLE Engineering Assistant DATE 7/22/99
TYPE OR PRINT NAME J. Denise Leake Telephone No. 397-0405

(This space for State Use) ORIGINAL SIGNED BY

APPROVED BY GARY WINK TITLE FIELD REP. II DATE JUL 27 1999