

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State ☐ Fee ☒
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER-	7. Unit Agreement Name
2. Name of Operator CITIES SERVICE OIL & GAS CORPORATION	8. Farm or Lease Name Thomas
3. Address of Operator Box 1919 - Midland, Texas 79702	9. Well No. 1
4. Location of Well UNIT LETTER 0 660 FEET FROM THE SOUTH LINE AND 1980 FEET FROM THE EAST LINE, SECTION 19 TOWNSHIP 24S RANGE 37E NMPM.	10. Field and Pool, or Wildcat Jalmat-Yates 7 Rvrs.
15. Elevation (Show whether DF, RT, GR, etc.) 3270' GL	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐ OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

OTD 3663', OPBTD 3440'. It is proposed to plug and abandon this well in the following manner:

1. MIRU PU. ND WH & NU BOP. POOH.
2. RIH with rock bit, casing scraper & tubing to PBD 3440'. Circulate hole with mud laden fluid. POOH.
3. RIH w/OE'd tubing to approximately 3400' & spot a 100' cement plug @ approx. 3400'-3300', 1/2 in & 1/2 out of the 5 1/2" shoe @ 3351'. POOH.
4. RU WL & set a CIBP @ approximately 2950' (top of the Yates) and dump 35' of cement on top of CIBP @ approximately 2950'-2915'.
5. Perforate 2 holes @ approximately 1212'. Close rams and est. IR.
6. RIH with cement retainer and set @ approx. 1100'. Est circ. and cement to surface with approx. 210 sacks. RO cement and POOH.
7. ND BOP & CO WH. Spot a 10 sack cmt. surface plug from approximately 50-0'.
8. Install a dry hole marker to designate a plugged and abandoned location.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Elmer Start

REGION OPERATIONS
TITLE MANAGER - PRODUCTION

DATE 9/20/83

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

SEP 29 1983

APPROVED BY _____

TITLE _____

DATE _____

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED
SEP 28 1983
O.C.D.
HOEDS OFFICE