

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
310 Old Santa Fe Trail, Room 206
Santa Fe, New Mexico 87503

WELL API NO. 30-025-11303
5. Indicate Type of Lease STATE ☐ FEE ☒
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Langlie Jal Unit
8. Well No. 12
9. Pool name or Wildcat Langlie Mattix
10. Elevation (Show whether DF, RKB, RT, GR, etc.)

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐	2. Name of Operator GP II Energy, Inc.	3. Address of Operator P. O. Box 50682 Midland, Tx. 79710	4. Well Location Unit Letter <u>G</u> : <u>1977</u> Feet From The <u>East</u> Line and <u>2310</u> Feet From The <u>North</u> Line Section <u>31</u> Township <u>24S</u> Range <u>37E</u> NMPM <u>Lea</u> County <u></u>
---	---	--	--

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☒
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☐
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

10-3-95 - 12-5-95

RU POH w/ rods & tbg. Run RP to 3465'. RIH w/pkr & set @ 3308'. RU wireline, set RBP @ 3342'. Perf 3131'-3336'.
Frac. Clean out to plug. TIH w/tbg. set anchor. RIH w/prod equip. PWOP.
Set RBP @ 3370'. Run temp survey log. POH w/rods, unseat pkr. POH w/tbg & RBP. RIH w/bailer. Tag btm. Test plug
@ 3350', 3300', 3050', 3245'. Circ. Spot sand on plug. Set pkr @ 3043'. Pmp cmt to 3450'. Load string w/15.2#, pmp
3 bbls/min. Load w/14.8#, pmp 23 bbls/min. Displace pipe. Press to 1524#.
Test pkr in csg @ 1243'. Test backside. Open pkr bypass. Holding. Pull pkr out of hole. RIH w/ 6 3 1/2" DCs & 4 3/4"
bit. Drill cmt down to plug @ 3460'. Acidize perms 3394'-3463'. Flush csg w/fresh water. RTP

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE George P. Mitchell, II TITLE President DATE 12-5-95
TYPE OR PRINT NAME George P. Mitchell, II TELEPHONE NO. 915-684-4748

(This space for State Use)

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY: