		Form C-103
TRIBUTION		Supersedes Old
T FE NEW MEXI	CO OIL CONSERVATION COMMISSION	C-102 and C-103 v Effective 1-1-55
FILE		
U.S.G.S.	• • •	Sa. Indicate Type of Lease
LAND OFFICE		State X Foo
OPERATOR		5. State Oil & Gas Lease No.
		B-1327
SUNDRY NOTICES AND R	EPORTS ON WELLS	
USE "APPLICATION FOR PERMIT" (FORM	EEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. C-101) FOR SUCH PROPOSALS.)	
		7. Unit Agreement Name
	INJECTION WELL	Langlie-Jal Unit
2. Name of Operator UNION TEXAS PETRO LEUM CORPORATION		8, Farm or Lease liame
3. Address of Operator		9. Well No.
1300 Wilco Building, Midland, Texa	s 79701	19
4. Location of Well		10. Field and Pool, or Wildcat
-	South 660	
UNIT LETTER L 1980 FEET FROM TH	E LINE AND FEET F	Langlie-Mattix (Queen
West 32	24-S 37-F	111111111111111
THE LINE, SECTION JZ YOWN	SHIP 24-S RANGE NM	PM. {
	(Show whether DF, RT, GR, etc.)	
		12. County
n de	' DF (Est.)	Lea AllIIII
Check Appropriate Box To	o Indicate Nature of Notice, Report or	Other Data
NOTICE OF INTENTION TO:	SUBSEQUE	NT REPORT OF:
n an		:
PERFORM REMEDIAL WORK	ABANDON REMEDIAL WORK	ALTERING CASING
TEMPORARILY ABANDON	COMMENCE DRILLING OPNS.	PLUG AND ABANDONMENT
PULL OR ALTER CASING CHANGE I	PLANS CASING TEST AND CEMENT JOB	
	OTHER Clean out & D	eepen •
07HER		
17. Describe Proposed or Completed Operations (Clearly state a	ll partieurs dataile and die a	
work) SEE RULE 1103.	i periment delatis, and give pertinent dates, includ	ing estimated cate of starting any propos
	· ·	
	11 and pulled tubing & packer (Installed BOP).
2. Cleaned well out to original	TD 3541.	
 Cleaned well out to original Deepened well to TD 3575' (6 	TD 3541. " hole). Shot hole section he	aved & stuck work string.
 Cleaned well out to original Deepened well to TD 3575' (6 July 19, 1976, pulled out of 	TD 3541. " hole). Shot hole section he hole and went back in hole wit	aved & stuck work string.
 Cleaned well out to original Deepened well to TD 3575' (6 July 19, 1976, pulled out of open hole section 3408-3506' 	TD 3541. " hole). Shot hole section he hole and went back in hole wit	aved & stuck work string. n new bit. Jet washed
 Cleaned well out to original Deepened well to TD 3575' (6 July 19, 1976, pulled out of open hole section 3408-3506' July 20, 1976, reversed out 	TD 3541. "hole). Shot hole section he hole and went back in hole wit fill from 3542-3557' & jet wash	aved & stuck work string. n new bit. Jet washed ed from 352 7-42', J et
 Cleaned well out to original Deepened well to TD 3575' (6 July 19, 1976, pulled out of open hole section 3408-3506' July 20, 1976, reversed out washed junk into hole from s 	TD 3541. " hole). Shot hole section he hole and went back in hole wit fill from 3542-3557' & jet wash hot hole section (Top of junk a	aved & stuck work string. n new bit. Jet washed ed from 3527-42', Jet t 3542').
 Cleaned well out to original Deepened well to TD 3575' (6 July 19, 1976, pulled out of open hole section 3408-3506' July 20, 1976, reversed out washed junk into hole from s July 21, 1976, went in hole 	TD 3541. " hole). Shot hole section he hole and went back in hole wit fill from 3542-3557' & jet wash hot hole section (Top of junk a with mill & tagged 2' of fill a	aved & stuck work string. n new bit. Jet washed ed from 3527-42', Jet t 3542').
 Cleaned well out to original Deepened well to TD 3575' (6 July 19, 1976, pulled out of open hole section 3408-3506' July 20, 1976, reversed out washed junk into hole from s July 21, 1976, went in hole and milled on junk 8 hrs. & 	TD 3541. " hole). Shot hole section he hole and went back in hole wit fill from 3542-3557' & jet wash hot hole section (Top of junk a with mill & tagged 2' of fill a made 8" of progress.	aved & stuck work string. n new bit. Jet washed ed from 3527-42', Jet t 3542').
 Cleaned well out to original Deepened well to TD 3575' (6 July 19, 1976, pulled out of open hole section 3408-3506' July 20, 1976, reversed out washed junk into hole from s July 21, 1976, went in hole and milled on junk 8 hrs. & July 22, 1976, milled on jung 	TD 3541. "hole). Shot hole section he hole and went back in hole wit fill from 3542-3557' & jet wash hot hole section (Top of junk a with mill & tagged 2' of fill a made 8" of progress. k 9 hrs. & made 6" of progress.	aved & stuck work string. n new bit. Jet washed ed from 3527-42', Jet t 3542'). bove junk. Washed fill
 Cleaned well out to original Deepened well to TD 3575' (6 July 19, 1976, pulled out of open hole section 3408-3506' July 20, 1976, reversed out washed junk into hole from s July 21, 1976, went in hole and milled on junk 8 hrs. & July 22, 1976, milled on jun July 23, 1976', laid down wor 	TD 3541. "hole). Shot hole section he hole and went back in hole wit fill from 3542-3557' & jet wash hot hole section (Top of junk a with mill & tagged 2' of fill a made 8" of progress. k 9 hrs. & made 6" of progress. k string. Ran 2 3/8" internall	aved & stuck work string. n new bit. Jet washed ed from 3527-42', Jet t 3542'). bove junk. Washed fill
 Cleaned well out to original Deepened well to TD 3575' (6 July 19, 1976, pulled out of open hole section 3408-3506' July 20, 1976, reversed out washed junk into hole from s July 21, 1976, went in hole and milled on junk 8 hrs. & July 22, 1976, milled on jun July 23, 1976', laid down wor Guiberson Uni+Pkr. VI to 331 	TD 3541. "hole). Shot hole section he hole and went back in hole wit fill from 3542-3557' & jet wash hot hole section (Top of junk a with mill & tagged 2' of fill a made 8" of progress. k 9 hrs. & made 6" of progress. k string. Ran 2 3/8" internall 0'.	aved & stuck work string. n new bit. Jet washed ed from 3527-42', Jet t 3542'). bove junk. Washed fill
 Cleaned well out to original Deepened well to TD 3575' (6 July 19, 1976, pulled out of open hole section 3408-3506' July 20, 1976, reversed out washed junk into hole from s July 21, 1976, went in hole and milled on junk 8 hrs. & July 22, 1976, milled on jun 8. July 23, 1976', laid down wor Guiberson Uni⁺Pkr. VI to 331 July 24, 1976, placed well b 	TD 3541. "hole). Shot hole section he hole and went back in hole wit fill from 3542-3557' & jet wash hot hole section (Top of junk a with mill & tagged 2' of fill a made 8" of progress. k 9 hrs. & made 6" of progress. k string. Ran 2 3/8" internall O'. ack on water injection.	aved & stuck work string. n new bit. Jet washed ed from 3527-42', Jet t 3542'). bove junk. Washed fill y coated tubing and
 Cleaned well out to original Deepened well to TD 3575' (6 July 19, 1976, pulled out of open hole section 3408-3506' July 20, 1976, reversed out washed junk into hole from s July 21, 1976, went in hole and milled on junk 8 hrs. & July 22, 1976, milled on jun 8. July 23, 1976', laid down wor Guiberson Uni⁺Pkr. VI to 331 July 24, 1976, placed well b 	TD 3541. "hole). Shot hole section he hole and went back in hole wit fill from 3542-3557' & jet wash hot hole section (Top of junk a with mill & tagged 2' of fill a made 8" of progress. k 9 hrs. & made 6" of progress. k string. Ran 2 3/8" internall 0'.	aved & stuck work string. n new bit. Jet washed ed from 3527-42', Jet t 3542'). bove junk. Washed fill y coated tubing and
 Cleaned well out to original Deepened well to TD 3575' (6 July 19, 1976, pulled out of open hole section 3408-3506' July 20, 1976, reversed out washed junk into hole from s July 21, 1976, went in hole and milled on junk 8 hrs. & July 22, 1976, milled on jun 8. July 23, 1976', laid down wor Guiberson Uni⁺Pkr. VI to 331 July 24, 1976, placed well b 	TD 3541. "hole). Shot hole section he hole and went back in hole wit fill from 3542-3557' & jet wash hot hole section (Top of junk a with mill & tagged 2' of fill a made 8" of progress. k 9 hrs. & made 6" of progress. k string. Ran 2 3/8" internall O'. ack on water injection.	aved & stuck work string. n new bit. Jet washed ed from 3527-42', Jet t 3542'). bove junk. Washed fill y coated tubing and
 Cleaned well out to original Deepened well to TD 3575' (6 July 19, 1976, pulled out of open hole section 3408-3506' July 20, 1976, reversed out washed junk into hole from s July 21, 1976, went in hole and milled on junk 8 hrs. & July 22, 1976, milled on jun 8. July 23, 1976', laid down wor Guiberson Uni⁺Pkr. VI to 331 July 24, 1976, placed well b 	TD 3541. "hole). Shot hole section he hole and went back in hole wit fill from 3542-3557' & jet wash hot hole section (Top of junk a with mill & tagged 2' of fill a made 8" of progress. k 9 hrs. & made 6" of progress. k string. Ran 2 3/8" internall O'. ack on water injection.	aved & stuck work string. n new bit. Jet washed ed from 3527-42', Jet t 3542'). bove junk. Washed fill y coated tubing and
 Cleaned well out to original Deepened well to TD 3575' (6 July 19, 1976, pulled out of open hole section 3408-3506' July 20, 1976, reversed out washed junk into hole from s July 21, 1976, went in hole and milled on junk 8 hrs. & July 22, 1976, milled on jun 8. July 23, 1976', laid down wor Guiberson Uni⁺Pkr. VI to 331 July 24, 1976, placed well b 	TD 3541. "hole). Shot hole section he hole and went back in hole wit fill from 3542-3557' & jet wash hot hole section (Top of junk a with mill & tagged 2' of fill a made 8" of progress. k 9 hrs. & made 6" of progress. k string. Ran 2 3/8" internall O'. ack on water injection.	aved & stuck work string. n new bit. Jet washed ed from 3527-42', Jet t 3542'). bove junk. Washed fill y coated tubing and
 Cleaned well out to original Deepened well to TD 3575' (6 July 19, 1976, pulled out of open hole section 3408-3506' July 20, 1976, reversed out washed junk into hole from s July 21, 1976, went in hole and milled on junk 8 hrs. & July 22, 1976, milled on jun 8. July 23, 1976', laid down wor Guiberson Uni⁺Pkr. VI to 331 July 24, 1976', placed well b 	TD 3541. "hole). Shot hole section he hole and went back in hole wit fill from 3542-3557' & jet wash hot hole section (Top of junk a with mill & tagged 2' of fill a made 8" of progress. k 9 hrs. & made 6" of progress. k string. Ran 2 3/8" internall O'. ack on water injection.	aved & stuck work string. n new bit. Jet washed ed from 3527-42', Jet t 3542'). bove junk. Washed fill y coated tubing and
 Cleaned well out to original Deepened well to TD 3575' (6 July 19, 1976, pulled out of open hole section 3408-3506' July 20, 1976, reversed out washed junk into hole from s July 21, 1976, went in hole and milled on junk 8 hrs. & July 22, 1976, milled on jun July 23, 1976, laid down wor Guiberson Uni+Pkr. VI to 331 July 24, 1976, placed well b Note: We will re-enter to cl 	TD 3541. "hole). Shot hole section he hole and went back in hole wit fill from 3542-3557' & jet wash hot hole section (Top of junk a with mill & tagged 2' of fill a made 8" of progress. k 9 hrs. & made 6" of progress. k string. Ran 2 3/8" internall 0'. ack on water injection. ean out & deepen at a later dat	aved & stuck work string. n new bit. Jet washed ed from 3527-42', Jet t 3542'). bove junk. Washed fill y coated tubing and
 Cleaned well out to original Deepened well to TD 3575' (6 July 19, 1976, pulled out of open hole section 3408-3506' July 20, 1976, reversed out washed junk into hole from s July 21, 1976, went in hole and milled on junk 8 hrs. & July 22, 1976, milled on jun July 23, 1976, laid down wor Guiberson Uni+Pkr. VI to 331 July 24, 1976, placed well b Note: We will re-enter to cl 	TD 3541. "hole). Shot hole section he hole and went back in hole wit fill from 3542-3557' & jet wash hot hole section (Top of junk a with mill & tagged 2' of fill a made 8" of progress. k 9 hrs. & made 6" of progress. k string. Ran 2 3/8" internall 0'. ack on water injection. ean out & deepen at a later dat	aved & stuck work string. n new bit. Jet washed ed from 3527-42', Jet t 3542'). bove junk. Washed fill y coated tubing and
 Cleaned well out to original Deepened well to TD 3575' (6 July 19, 1976, pulled out of open hole section 3408-3506' July 20, 1976, reversed out washed junk into hole from s July 21, 1976, went in hole and milled on junk 8 hrs. & July 22, 1976, milled on jun July 23, 1976, laid down wor Guiberson Uni+Pkr. VI to 331 July 24, 1976, placed well b Note: We will re-enter to cl 	TD 3541. "hole). Shot hole section he hole and went back in hole wit fill from 3542-3557' & jet wash hot hole section (Top of junk a with mill & tagged 2' of fill a made 8" of progress. k 9 hrs. & made 6" of progress. k 9 hrs. & made 6" of progress. k string. Ran 2 3/8" internall 0'. ack on water injection. ean out & deepen at a later dat te to the best of my knowledge and belief.	aved & stuck work string. n new bit. Jet washed ed from 3527-42', Jet t 3542'). bove junk. Washed fill y coated tubing and e.
 Cleaned well out to original Deepened well to TD 3575' (6 July 19, 1976, pulled out of open hole section 3408-3506' July 20, 1976, reversed out washed junk into hole from s July 21, 1976, went in hole and milled on junk 8 hrs. & July 22, 1976, milled on jun July 23, 1976, laid down wor Guiberson Uni'Pkr. VI to 331 July 24, 1976, placed well b Note: We will re-enter to cl 	TD 3541. "hole). Shot hole section he hole and went back in hole wit fill from 3542-3557' & jet wash hot hole section (Top of junk a with mill & tagged 2' of fill a made 8" of progress. k 9 hrs. & made 6" of progress. k string. Ran 2 3/8" internall 0'. ack on water injection. ean out & deepen at a later dat	aved & stuck work string. n new bit. Jet washed ed from 3527-42', Jet t 3542'). bove junk. Washed fill y coated tubing and
 2. Cleaned well out to original 3. Deepened well to TD 3575' (6 4. July 19, 1976, pulled out of open hole section 3408-3506' 5. July 20, 1976, reversed out washed junk into hole from s 6. July 21, 1976, went in hole and milled on junk 8 hrs. & 7. July 22, 1976, milled on jun 8. July 23, 1976', laid down wor Guiberson Uni+Pkr. VI to 331 9. July 24, 1976, placed well b Note: We will re-enter to cl 	TD 3541. "hole). Shot hole section he hole and went back in hole wit fill from 3542-3557' & jet wash hot hole section (Top of junk a with mill & tagged 2' of fill a made 8" of progress. k 9 hrs. & made 6" of progress. k 9 hrs. & made 6" of progress. k string. Ran 2 3/8" internall 0'. ack on water injection. ean out & deepen at a later dat te to the best of my knowledge and belief.	aved & stuck work string. n new bit. Jet washed ed from 3527-42', Jet t 3542'). bove junk. Washed fill y coated tubing and e. <u>PATE</u> 7-27-76
 2. Cleaned well out to original 3. Deepened well to TD 3575' (6 4. July 19, 1976, pulled out of open hole section 3408-3506' 5. July 20, 1976, reversed out washed junk into hole from s 6. July 21, 1976, went in hole and milled on junk 8 hrs. & 7. July 22, 1976, milled on jun 8. July 23, 1976', laid down wor Guiberson Uni+Pkr. VI to 331 9. July 24, 1976, placed well b Note: We will re-enter to cl 	TD 3541. "hole). Shot hole section he hole and went back in hole wit fill from 3542-3557' & jet wash hot hole section (Top of junk a with mill & tagged 2' of fill a made 8" of progress. k 9 hrs. & made 6" of progress. k 9 hrs. & made 6" of progress. k string. Ran 2 3/8" internall 0'. ack on water injection. ean out & deepen at a later dat te to the best of my knowledge and belief.	aved & stuck work string. n new bit. Jet washed ed from 3527-42', Jet t 3542'). bove junk. Washed fill y coated tubing and e.
 2. Cleaned well out to original 3. Deepened well to TD 3575' (6 4. July 19, 1976, pulled out of open hole section 3408-3506' 5. July 20, 1976, reversed out washed junk into hole from s 6. July 21, 1976, went in hole and milled on junk 8 hrs. & 7. July 22, 1976, milled on jun 8. July 23, 1976', laid down wor Guiberson Uni+Pkr. VI to 331 9. July 24, 1976, placed well b Note: We will re-enter to cl 	TD 3541. "hole). Shot hole section he hole and went back in hole wit fill from 3542-3557' & jet wash hot hole section (Top of junk a with mill & tagged 2' of fill a made 8" of progress. k 9 hrs. & made 6" of progress. k 9 hrs. & made 6" of progress. k string. Ran 2 3/8" internall 0'. ack on water injection. ean out & deepen at a later dat te to the best of my knowledge and belief.	aved & stuck work string. n new bit. Jet washed ed from 3527-42', Jet t 3542'). bove junk. Washed fill y coated tubing and e. <u>PATE</u> 7-27-76

•