

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State ☒ Fee ☐
5. State Oil & Gas Lease No.
8-11302

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT TO DRILL" FORM C-101 FOR SUCH PROPOSALS.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	7. Unit Agreement Name
2. Name of Operator EXXON CORPORATION	8. Farm or Lease Name NEW MEXICO BLM STATE
3. Address of Operator P.O. BOX 1600, MIDLAND, TEXAS 79701	9. Well No. 2
4. Location of Well UNIT LETTER I, 2160 FEET FROM THE SOUTH LINE AND 330 FEET FROM THE EAST LINE, SECTION 2, TOWNSHIP 25-S, RANGE 37-E, NMPM.	10. Field and Pool, or Wildcat JUSTIS FUSSELLMAN NORTH
11. Elevation (Show whether DF, RT, GR, etc.) 3134 DF	12. County LEA

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐
PULL OR ALTER CASING ☐	OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐	ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOBS ☐	OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

PULL RODS, PUMP AND TBC OUT OF 4 1/2 CSG. PUMP CEMENT PLUG DOWN 4 1/2 CSG ACROSS PERF. AND 100' ABOVE 6975-6828 W/15 SX. DISPLACE CEM. W/100 BCLS GELLED MUD. ESTABLISH FREE POINT AND CUT 4 1/2 CSG 3800. CIRCULATE HOLE W/GELLED MUD THRU 4 1/2 CSG. PULL 4 1/2 CSG. DRILL OUT 25' CEM. PLUG IN THE TOP OF 2 7/8 CSG. ESTABLISH FREE POINT AND CUT 2 7/8 CSG. 3800. SPOT 100' CEM. PLUG THRU 2 7/8 CSG ACROSS AN ABOVE 4 1/2 - 2 7/8 CSG. CUTS W/45 SX. ACROSS 9 5/8 INTERMEDIATE CSG. SHOE 3386-3486 W/45 SX. PULL 2 7/8 CSG. ESTABLISH FREE POINT, CUT AND PULL 9 5/8 CSG @ 1975'. RUN 2 7/8 WORKSTRING AND SPOT CEM. PLUGS. 100' PLUG ACROSS 9 5/8 CSG CUT 1925-2025 W/75 SX. 100' PLUG ACROSS TOP OF SALT SECTION 1040-1140 W/75 SX. 100' PLUG ACROSS 13 3/8 SURFACE CSG SHOE 1149-249 W/75 SX. 10' PLUG AT SURFACE W/10 SX. PUMP ALL CEMENT PLUGS DOWN W/GELLED MUD. TAG ALL PLUGS W/CSG OR TBC. STRING TO VERIFY PLACEMENT. INSTALL MARKER AND CLEAN UP WELL SITE.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE UNIT HEAD DATE 6-5-74

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY: