

MIDLAND E & P DIVISION

WELL WORK RECOMMENDATIONS

Proposals for Well Reconditioning and Subsurface Maintenance
Workovers, Expense DD's, PB's, and Conversions

Lease: Langlie Mattix Queen Unit Well No. 18
Field: Langlie Mattix Queen
County: Lea State: New Mexico

RECOMMENDED PROCEDURE:

1. M. I. R. U.
2. Pull rods & tubing
3. Perforate - Correlate w/ known Wells GR-N Log of 6-20-54,
3272-3286 (14') with one shot per foot,
3326-3340 (14') with one shot per foot
4. Set Retractable B.P. @ 3250'
5. Acidize perforations, under packer set @ 3250', with
2500 gal 15% N.E. acid at 3 to 5 BPM with
sufficient quantity of rubber covered Nylon Ball Sealers
to Ball out.
6. Pull Retractable B.P.
7. Run Rods & Tubing
8. Return to production.