

WELL WORK RECOMMENDATIONS
Proposals for 11 Reconditioning and Subsurface Maintenance
Workovers, Expense DD's, PB's, and Conversions

Lease: LANGLIE MATTIX QUEEN UNIT Well No. 11

Field: LANGLIE MATTIX (QUEEN)

County: LEA State: NEW MEXICO

RECOMMENDED PROCEDURE:

1. PULL INJECTION EQUIPMENT AND CLEANOUT TO TD (3424').
2. PLUG BACK THE OPEN HOLE SECTION FROM 3490'-3624'-134' OA WITH SAND (10-20).
3. PLUG BACK THE OPEN HOLE SECTION FROM 3485'-3490'-10' OA WITH HYDROMITE.
4. RUN THE 2" CEMENT LINED TUBING AND INJECTION PACKER.
5. LOAD THE TUBING-CASING ANNULUS WITH FRESH WATER TREATED WITH 10 GALS CORTRON 2207/1000 GALS WATER.
6. HOOK UP THE WELL FOR INJECTION.

DP 6-11-71