

Langlie Mattix Queen Unit #16  
Plug and Abandon

Procedure:

1. MIRU Workover Rig. Set CIBP at +/- 3050'. Spot 35' of cement on top. — TAG
2. RIH with tubing and tag cement plug. Circulate hole with 10 # Brine And gel.
3. Spot cement plug from ~~839' - 739'~~ T.D.S. *839' - 739' T.D.S.*
4. Perforate casing at +/- ~~403'~~ *403' 50' BELOW CSG. SHOE BRING CEMENT UP TO 300' TAG* and squeeze with 50 sacks cement. Spot 10 sacks surface plug.
5. Cut casing and cap well.
6. Set dry hole marker and clean location.

353