

WELL WORK RECOMMENDATIONS
Proposals for Well Reconditioning and Subsurface Maintenance
Workovers, Expense DD's, PB's, and Conversions

Lease: LANGLIE MATTIX QUEEN UNIT Well No. 16
Field: LANGLIE MATTIX (QUEEN)
County: LEA State: NEW MEXICO

RECOMMENDED PROCEDURE:

1. PULL PRODUCTION EQUIPMENT AND CLEANOUT TO PRTD (3569').
2. SET A RETRIEVABLE BRIDGE PLUG AT 3140' AND CAP WITH 10' OF SAND.
3. RUN A TREATING PACKER AND SET AT 2600'.
4. TRY TO PUMP INTO THE YATES PERFORATIONS (2665'-2935'-275'OA).
IF THE PERFORATIONS TAKE FLUID PROCEED TO STEP 5. IF
THE PERFORATIONS WILL NOT TAKE FLUID PROCEED TO STEP 7.
5. SQUEEZE THE YATES PERFORATIONS (2665'-2935'-275'OA) WITH
CLASS H CEMENT.
6. DRILL OUT THE CEMENT.
7. TEST THE CASING FOR LEAKS AND SQUEEZE WITH CLASS H
IF NECESSARY.
8. RETRIEVE THE RETRIEVABLE BRIDGE PLUG.
9. PLUG BACK THE OPEN HOLE SECTION FROM 3140' TO 3325' (184' OA)
WITH HYDROMITE.

WP 6-8-71