Form 3160-5 (June 1990)

P. O. BOX 1980 **UNITED STATES** DEPARTMENT OF THE INTERIOR BASS. MEW MEXICO 88240 BUREAU OF LAND MANAGEMENT

FORM APPROVED Budget Bureau No. 1004-0135

	Expires:	M	arch	31, 199	93
Lease	Designat	ion	and	Serial	No.

NM 0140978 6. If Indian, Allottee or Tribe Name

SUNDRY	NOTICES	AND	REPORTS	ON	WEL	LS
--------	---------	-----	----------------	----	-----	----

	OU DIVIT	IN TOIDLIGATE	7. If Unit or CA, Agreement Designation
	SUBMIT	IN TRIPLICATE	
ype of Well			8910115870 8. Well Name and No.
X Well Gas	Other		
lame of Operator			Langlie Jal #92
GP II Eners			
Address and Telephon	ie No.		30-025-1163600 10. Field and Pool, or Exploratory Area
P. O. Box '	50682, Midland, Tx.	79710, 915-684-4748 cription)	Langlie Mattix
		cription)	11. County or Parish, State
•	SL & 660' FEL		N.
S 17, T 259	S, R 3/E		Lea County, N. M.
0.1501	A PRECEDENTE POVI) TO INDICATE NATURE OF NOTICE,	
CHECK	K APPHOPRIATE BOX(S		
TYPE O	OF SUBMISSION	TYPE OF A	
Notic	ce of Intent	Abandonment	Change of Plans
		Recompletion	New Construction
X Subse	equent Report	Plugging Back	Non-Routine Fracturing
		Casing Repair	Water Shut-Off
Final	Abandonment Notice	Altering Casing	Conversion to Injection
		Other <u>Perforate & Stin</u>	mulate Dispose Water (Note: Report results of multiple completion on Wel Completion or Recompletion Report and Log form.
give subsurface		a depths for all markers and zones pertinent to this work.)* 2.7/8" work string. Dig WO pit. PU & RIH w	y/3 7/8" bit, 6 3 1/8" DCs, 90 jts tbg.
	MIRU. Unload & rack? RIH w/bit & tag. RU ro Pull PND log. Perf: 3262'-3264' 3268 3410'-3414', 3424'-34 3534'-3540', 3550'-35 RIH w/4 1/2" Watson t	2 7/8" work string. Dig WO pit. PU & RIH we everse unit & drill out CIBP @ 3268'. Push pl 3'-3272', 3278'-3282', 3297'-3303', 3310'-332 26', 3428'-3431', 3441'-3444', 3458'-3460', 3 53', 3559'-3561', 3564'-3566', (136' net - 408) reating pkr on 100 jts 2 7/8". Set pkr @ 3145	22', 3350'-3372', 3377'-3384', 3394'-3400 3464'-3466', 3477'-3481', 3486'-3526', 8 holes) '. Acidize w/8000 gals 7½% NeFe, 70%
05-10-96 05-11-96 05-12-96 05-13-96	MIRU. Unload & rack? RIH w/bit & tag. RU ro Pull PND log. Perf: 3262'-3264' 3268 3410'-3414', 3424'-34 3534'-3540', 3550'-35 RIH w/4 1/2" Watson t	2 7/8" work string. Dig WO pit. PU & RIH we everse unit & drill out CIBP @ 3268'. Push pl 3'-3272', 3278'-3282', 3297'-3303', 3310'-332 26', 3428'-3431', 3441'-3444', 3458'-3460', 3 53', 3559'-3561', 3564'-3566', (136' net - 408) reating pkr on 100 jts 2 7/8". Set pkr @ 3145	22', 3350'-3372', 3377'-3384', 3394'-3400 3464'-3466', 3477'-3481', 3486'-3526', 8 holes) '. Acidize w/8000 gals 7½% NeFe, 70%
05-10-96 05-11-96 05-12-96 05-13-96	MIRU. Unload & rack? RIH w/bit & tag. RU re Pull PND log. Perf: 3262'-3264' 3268 3410'-3414', 3424'-34: 3534'-3540', 3550'-35 RIH w/4 1/2" Watson t Quality CO2 & 5000# Release pkr. POOH.	2 7/8" work string. Dig WO pit. PU & RIH we everse unit & drill out CIBP @ 3268'. Push plus 2'-3272', 3278'-3282', 3297'-3303', 3310'-332', 3428'-3431', 3441'-3444', 3458'-3460', 353', 3559'-3561', 3564'-3566', (136' net - 408' reating pkr on 100 jts 2 7/8". Set pkr @ 3145' rock salt block. Fig btm @ 3580'. Pull up & land tbg w/SN @	22', 3350'-3372', 3377'-3384', 3394'-3400 3464'-3466', 3477'-3481', 3486'-3526', 8 holes) '. Acidize w/8000 gals 7½% NeFe, 70%
05-10-96 05-11-96 05-12-96 05-13-96 05-14-96	MIRU. Unload & rack? RIH w/bit & tag. RU re Pull PND log. Perf: 3262'-3264' 3268 3410'-3414', 3424'-34: 3534'-3540', 3550'-35 RIH w/4 1/2" Watson t Quality CO2 & 5000# Release pkr. POOH. 7 RIH w/pump & rods.	2 7/8" work string. Dig WO pit. PU & RIH we everse unit & drill out CIBP @ 3268'. Push plus 2'-3272', 3278'-3282', 3297'-3303', 3310'-332', 3428'-3431', 3441'-3444', 3458'-3460', 353', 3559'-3561', 3564'-3566', (136' net - 408' reating pkr on 100 jts 2 7/8". Set pkr @ 3145' rock salt block. Fig btm @ 3580'. Pull up & land tbg w/SN @	22', 3350'-3372', 3377'-3384', 3394'-3400 3464'-3466', 3477'-3481', 3486'-3526', 8 holes) '. Acidize w/8000 gals 7½% NeFe, 70%
05-10-96 05-11-96 05-12-96 05-13-96	MIRU. Unload & rack? RIH w/bit & tag. RU re Pull PND log. Perf: 3262'-3264' 3268 3410'-3414', 3424'-34: 3534'-3540', 3550'-35 RIH w/4 1/2" Watson t Quality CO2 & 5000# Release pkr. POOH.	2 7/8" work string. Dig WO pit. PU & RIH we everse unit & drill out CIBP @ 3268'. Push plus 2'-3272', 3278'-3282', 3297'-3303', 3310'-332', 3428'-3431', 3441'-3444', 3458'-3460', 353', 3559'-3561', 3564'-3566', (136' net - 408' reating pkr on 100 jts 2 7/8". Set pkr @ 3145' rock salt block. Tag btm @ 3580'. Pull up & land tbg w/SN @ ACCEPTED	22', 3350'-3372', 3377'-3384', 3394'-3400', 3464'-3466', 3477'-3481', 3486'-3526', 8 holes) '. Acidize w/8000 gals 7½% NeFe, 70% 3520'. 111 jts 2 3/8", 1 jt 2 7/8" on top.
05-10-96 05-11-96 05-12-96 05-13-96 05-14-96	MIRU. Unload & rack? RIH w/bit & tag. RU re Pull PND log. Perf: 3262'-3264' 3268 3410'-3414', 3424'-34: 3534'-3540', 3550'-35 RIH w/4 1/2" Watson t Quality CO2 & 5000# Release pkr. POOH. 7 RIH w/pump & rods.	2 7/8" work string. Dig WO pit. PU & RIH we everse unit & drill out CIBP @ 3268'. Push plus 2'-3272', 3278'-3282', 3297'-3303', 3310'-332', 3428'-3431', 3441'-3444', 3458'-3460', 353', 3559'-3561', 3564'-3566', (136' net - 408' reating pkr on 100 jts 2 7/8". Set pkr @ 3145' rock salt block. Tag btm @ 3580'. Pull up & land tbg w/SN @ ACCEPTED	22', 3350'-3372', 3377'-3384', 3394'-3400', 3464'-3466', 3477'-3481', 3486'-3526', 8 holes) '. Acidize w/8000 gals 7½% NeFe, 70% 3520'. 111 jts 2 3/8", 1 jt 2 7/8" on top.
05-10-96 05-11-96 05-12-96 05-13-96 05-14-96	MIRU. Unload & rack? RIH w/bit & tag. RU re Pull PND log. Perf: 3262'-3264' 3268 3410'-3414', 3424'-34: 3534'-3540', 3550'-35 RIH w/4 1/2" Watson t Quality CO2 & 5000# Release pkr. POOH. 7 RIH w/pump & rods.	2 7/8" work string. Dig WO pit. PU & RIH we everse unit & drill out CIBP @ 3268'. Push plus 2'-3272', 3278'-3282', 3297'-3303', 3310'-332', 3428'-3431', 3441'-3444', 3458'-3460', 353', 3559'-3561', 3564'-3566', (136' net - 408' reating pkr on 100 jts 2 7/8". Set pkr @ 3145' rock salt block. Tag btm @ 3580'. Pull up & land tbg w/SN @ ACCEPTED	22', 3350'-3372', 3377'-3384', 3394'-3400' 3464'-3466', 3477'-3481', 3486'-3526', 8 holes) 1'. Acidize w/8000 gals 7½% NeFe, 70% 3520'. 111 jts 2 3/8", 1 jt 2 7/8" on top. D FOR RECORD 1 0 1996
05-10-96 05-11-96 05-12-96 05-13-96 05-14-96	MIRU. Unload & rack? RIH w/bit & tag. RU re Pull PND log. Perf: 3262'-3264' 3268 3410'-3414', 3424'-34: 3534'-3540', 3550'-35 RIH w/4 1/2" Watson t Quality CO2 & 5000# Release pkr. POOH. 7 RIH w/pump & rods.	2 7/8" work string. Dig WO pit. PU & RIH we everse unit & drill out CIBP @ 3268'. Push plus 2'-3272', 3278'-3282', 3297'-3303', 3310'-332', 3428'-3431', 3441'-3444', 3458'-3460', 353', 3559'-3561', 3564'-3566', (136' net - 408' reating pkr on 100 jts 2 7/8". Set pkr @ 3145' rock salt block. Tag btm @ 3580'. Pull up & land tbg w/SN @ ACCEPTED	22', 3350'-3372', 3377'-3384', 3394'-3400 3464'-3466', 3477'-3481', 3486'-3526', 8 holes) b. Acidize w/8000 gals 71/2% NeFe, 70% D FOR RECORD 1 0 1996
05-10-96 05-11-96 05-12-96 05-13-96 05-14-96 05-15-96	MIRU. Unload & rack? RIH w/bit & tag. RU re Pull PND log. Perf: 3262'-3264' 3268 3410'-3414', 3424'-34: 3534'-3540', 3550'-35 RIH w/4 1/2" Watson t Quality CO2 & 5000# Release pkr. POOH. 7 RIH w/pump & rods.	2 7/8" work string. Dig WO pit. PU & RIH we everse unit & drill out CIBP @ 3268'. Push plus 2'-3272', 3278'-3282', 3297'-3303', 3310'-332', 3428'-3431', 3441'-3444', 3458'-3460', 353', 3559'-3561', 3564'-3566', (136' net - 408' reating pkr on 100 jts 2 7/8". Set pkr @ 3145' rock salt block. Tag btm @ 3580'. Pull up & land tbg w/SN @ ACCEPTED	22', 3350'-3372', 3377'-3384', 3394'-3400 3464'-3466', 3477'-3481', 3486'-3526', 8 holes) '. Acidize w/8000 gals 71/2% NeFe, 70% 0 3520'. 111 jts 2 3/8", 1 jt 2 7/8" on top. D FOR RECORD 1 0 1996
05-10-96 05-11-96 05-12-96 05-13-96 05-14-96 05-15-96 05-16-96	MIRU. Unload & rack? RIH w/bit & tag. RU re Pull PND log. Perf: 3262'-3264' 3268 3410'-3414', 3424'-34: 3534'-3540', 3550'-35 RIH w/4 1/2" Watson t Quality CO2 & 5000# Release pkr. POOH. 7 RIH w/pump & rods. RTP	2 7/8" work string. Dig WO pit. PU & RIH we everse unit & drill out CIBP @ 3268'. Push plus 2'-3272', 3278'-3282', 3297'-3303', 3310'-332', 3428'-3431', 3441'-3444', 3458'-3460', 353', 3559'-3561', 3564'-3566', (136' net - 408' reating pkr on 100 jts 2 7/8". Set pkr @ 3145' rock salt block. Tag btm @ 3580'. Pull up & land tbg w/SN @ ACCEPTED	22', 3350'-3372', 3377'-3384', 3394'-3400 3464'-3466', 3477'-3481', 3486'-3526', 8 holes) '. Acidize w/8000 gals 7½% NeFe, 70% D FOR RECORD 1 0 1996
05-10-96 05-11-96 05-12-96 05-13-96 05-14-96 05-15-96 05-16-96	MIRU. Unload & rack? RIH w/bit & tag. RU re Pull PND log. Perf: 3262'-3264' 3268 3410'-3414', 3424'-34 3534'-3540', 3550'-35 RIH w/4 1/2" Watson t Quality CO2 & 5000# Release pkr. POOH. RIH w/pump & rods. RTP	2 7/8" work string. Dig WO pit. PU & RIH we everse unit & drill out CIBP @ 3268'. Push plus 2'-3272', 3278'-3282', 3297'-3303', 3310'-332', 3428'-3431', 3441'-3444', 3458'-3460', 353', 3559'-3561', 3564'-3566', (136' net - 408' reating pkr on 100 jts 2 7/8". Set pkr @ 3145' rock salt block. Fag btm @ 3580'. Pull up & land tbg w/SN @ ACCEPTED OCT	22', 3350'-3372', 3377'-3384', 3394'-3400'3464'-3466', 3477'-3481', 3486'-3526', 8 holes) '. Acidize w/8000 gals 71/2% NeFe, 70% D FOR RECORD 1 0 1996
05-10-96 05-11-96 05-12-96 05-13-96 05-14-96 05-15-96 05-16-96	MIRU. Unload & rack? RIH w/bit & tag. RU re Pull PND log. Perf: 3262'-3264' 3268 3410'-3414', 3424'-34: 3534'-3540', 3550'-35 RIH w/4 1/2" Watson t Quality CO2 & 5000# Release pkr. POOH. RIH w/pump & rods. RTP	2 7/8" work string. Dig WO pit. PU & RIH we everse unit & drill out CIBP @ 3268'. Push plus 2'-3272', 3278'-3282', 3297'-3303', 3310'-332', 3428'-3431', 3441'-3444', 3458'-3460', 353', 3559'-3561', 3564'-3566', (136' net - 408' reating pkr on 100 jts 2 7/8". Set pkr @ 3145' rock salt block. Fag btm @ 3580'. Pull up & land tbg w/SN @ ACCEPTED OCT	22', 3350'-3372', 3377'-3384', 3394'-3400'3464'-3466', 3477'-3481', 3486'-3526', 8 holes) '. Acidize w/8000 gals 71/2% NeFe, 70% D FOR RECORD 1 0 1996
05-10-96 05-11-96 05-12-96 05-13-96 05-14-96 05-15-96 05-16-96	MIRU. Unload & rack? RIH w/bit & tag. RU re Pull PND log. Perf: 3262'-3264' 3268 3410'-3414', 3424'-34: 3534'-3540', 3550'-35 RIH w/4 1/2" Watson t Quality CO2 & 5000# Release pkr. POOH. RIH w/pump & rods. RTP	2 7/8" work string. Dig WO pit. PU & RIH we everse unit & drill out CIBP @ 3268'. Push plus 2'-3272', 3278'-3282', 3297'-3303', 3310'-332', 3428'-3431', 3441'-3444', 3458'-3460', 353', 3559'-3561', 3564'-3566', (136' net - 408' reating pkr on 100 jts 2 7/8". Set pkr @ 3145' rock salt block. Tag btm @ 3580'. Pull up & land tbg w/SN @ ACCEPTEL OCT	22', 3350'-3372', 3377'-3384', 3394'-3400' 3464'-3466', 3477'-3481', 3486'-3526', 8 holes) 1'. Acidize w/8000 gals 7½% NeFe, 70% 3520'. 111 jts 2 3/8", 1 jt 2 7/8" on top. D FOR RECORD 1 0 1996 Date 5-21-96

or representations as to any matter within its jurisdiction.