

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State ☐ Fee ☒

5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Sun Oil Company	8. Farm or Lease Name B. T. Lanehart
3. Address of Operator P. O. Box 2792, Odessa, Texas 79760	9. Well No. 1
4. Location of Well UNIT LETTER P 660 FEET FROM THE South LINE AND 660 FEET FROM East 20 LINE, SECTION 25 S RANGE 37 E NMPM.	10. Field and Pool, or Wildcat Langlie-Mattix
15. Elevation (Show whether DF, RT, GR, etc.) 3031' Gr.	12. County Lea

16.

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐

PLUG AND ABANDON ☒
CHANGE PLANS ☐
OTHER ☐

REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOBS ☐
OTHER ☐

ALTERING CASING ☐
PLUG AND ABANDONMENT ☐
OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Verbal permission granted by Mr. John Runyan, 4-22-69 to plug and abandon as follows:
Work will be started in appx. a week or 10 days.

1. MI-RU casing pullers.
2. Circulate hole w/mud.
3. Lower tubing, spot 25 sk cement plug at TD (3362')
4. Raise tubing spot 25 sk cement plug at 5 1/2" casing seat @ 2866'. Pull tubing.
5. Run free point, shoot 5 1/2" casing @ appx. 1100', pull casing.
6. Run free point, shoot 9 5/8" casing @ appx. 750', pull casing.
7. Run tubing, spot 25 sk cement plug in and out of 5 1/2" casing stub.
8. Raise tubing, spot 25 sk cement plug in and out of 9 5/8" casing stub.
9. Raise tubing, spot 25 sk cement plug @ 13" casing seat @ 288'.
10. Raise tubing, spot 10 sk cement plug at surface.
11. Install permanent well marker, clean location, RD-MO.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED John M. Sweeney TITLE Ass't District Superintendent DATE 10-24-69
APPROVED BY [Signature] TITLE [Signature] DATE [Signature]
CONDITIONS OF APPROVAL, IF ANY: