

NEW MEXICO OIL CONSERVATION COMMISSION

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Sun Oil Company	8. Name of Lease Name B. T. Lanehart
3. Address of Operator P. O. Box 2792, Odessa, Texas 79760	9. Well No. 2
4. Location of Well UNIT LETTER I , 660 FEET FROM THE East LINE AND 1980 FEET FROM THE South LINE, SECTION 20 TOWNSHIP 25 S RANGE 37 E N.M.P.M.	10. Field and Pool, or Wildcat Jalmat Yates Gas
15. Elevation (Show whether DF, RT, GR, etc.) 3050' Gr.	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐

PLUG AND ABANDON ☒
CHANGE PLANS ☐
OTHER ☐

REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOB ☐
OTHER ☐

ALTERING CASING ☐
PLUG AND ABANDONMENT ☐
OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Verbal permission granted by Mr. Joe Ramey 10-23-69 to plug and abandon as follows:
Work will be started in appx. one week or 10 days.

1. MI-RU casing pullers.
2. Pull 2 3/8" tubing and packer.
3. Run 2 3/8" tubing to 2650', circ. hole w/mud.
4. Spot 25 sk cement plug w/TS @ 2650', pull tubing.
5. Run free point, shoot 7" casing @ appx. 1300', pull casing.
6. Run free point, shoot 9 5/8" casing @ appx. 1150', pull casing.
7. Run 2 3/8" tubing, spot 60 sk cement plug 50' in and out of 9 5/8" casing stub.
8. Raise 2 3/8" tubing, spot 25 sk cement plug 50' in and out of 13" casing seat @ 300'.
9. Raise tubing, spot 10 sk cement plug at surface.
10. Install permanent well marker, clean location. RD-MD.

Note: It will probably be necessary to circulate hole w/mud before Step 2 rather than in Step 3.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED John M. Sweeney
John M. Sweeney

TITLE **Asst District Superintendent**

DATE **10-24-69**

APPROVED BY

TITLE **SUPER**

DATE

CONDITIONS OF APPROVAL, IF ANY: