

WELL WORK RECOMMENDATIONS
Proposals for Well Reconditioning and Subsurface Maintenance
Workovers, Expense DD's, PK's, and Conversions

Lease: LANGUE MATTIX OILFIELD UNIT Well No. 29
Field: LANGUE MATTIX
County: LEA State: NEW MEXICO

RECOMMENDED PROCEDURE:

1. MIDN PULLING UNIT - FULL PRODUCING EQUIPMENT.
CLEANOUT TO PAD 3390' WITH SAND PUMP.
2. PERFORATE 2 SPF 3379-86; 3292-98; 3286-88 AND 3272-78.
ALL SHOTS PER HALLIBURTON LOG DATED 11-20-56 RUN 10.1.
3. GIH WITH TUBING AND PACKER. SET PACKER AT 3260 AND
SWAB TEST LOWER ZONE. ACIDIZE IF NECESSARY WITH 500
GAL. 15% NE HCL. A SMALL FRAC JOB MAY BE IN ORDER
AFTER TESTING AND EXACT DESIGN WILL BE SUBMITTED WHEN
REQUESTED.
4. IF LOWER ZONE IS WET SET CIPR AT 3365 AND GRP
WITH 10 FT. CEMENT.
5. GIH WITH RETRIEVR BP AND PACKER. SET BP
AT 3308 AND PACKER AT 3250. SWAB TEST UPPER
PERFS. ACIDIZE IF NECESSARY WITH 500 GAL. 15% NE-
HCL AND 25 RCN BALLS.
6. RETRIEVE BP AND POKH - RETURN WELL TO PRODUCTION