

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IT
(Other ins
verse side)ATE
re-Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

LG 032579(e)

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

Federal Lease

8. FARM OR LEASE NAME

Carlson B 26

9. WELL NO.

6

10. FIELD AND POOL, OR WILDCAT

Justin Hline. & Tubb Drk.

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 26-252-37E

12. COUNTY OR PARISH 18. STATE

Lea

N. Mex.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)1. OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

Westates Petroleum Company

3. ADDRESS OF OPERATOR

Box 33, Jal, New Mexico

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

990' F.S.L. & 330' F.E.L. Sec. 26, 252-37E.

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any
proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones perti-
nent to this work.)*

7" casing set #5999'. Old Hlinebry Perfs. 5056'-5081'.

New perfs. with one 1/2" jet shot each #5251'-5272'-5282'-5310'-
5319'-5329'-5344'-5349'-5354'-5387'. Run tubing with retrievable
bridge plug and fullbore packer. Set bridge plug #5312'. Fullbore
set #5105'. Acidized with 500 gal. mud acid, 3000 gal. 28% flush
with 3000 gal. 3% acid. Pull tubing with bridge plug and fullbore packer.
Run both strings of tubing latch long string of tubing into Model "B"
packer #5780". Acidised Tubb Drinkard zone with 5000 gal. WD-50 water
flush 7000 gal. 28% acid over flush with 6500 gal. 3% acid. Swab both
zones. Put well back on pump.

18. I hereby certify that the foregoing is true and correct

SIGNED W. J. StillTITLE Production SuperintendentDATE March 7, 1968

(This space for Federal or State office use)

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____

APPROVED

MAR 8 1968

J L GORDON
ACTING DISTRICT ENGINEER

*See Instructions on Reverse Side

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4. If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 12. Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.