

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-73

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.O.S.	
LAND OFFICE	
OPERATOR	

0+5-NMOCD-Hobbs 1-JA
1-File 1-Laura Richardson
1-Engr. Jim 1-BW
1-Foreman CK

5a. Indicate Type of Lease
State ☒ Free ☐
5. State Oil & Gas Lease No.
B-9519

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO CELEPH OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name West Dollarhide Drinkard
2. Name of Operator Getty Oil Company	8. Farm or Lease Name Unit
3. Address of Operator P.O. Box 730, Hobbs, NM 88240	9. Well No. 23
4. Location of Well UNIT LETTER G 1980 FEET FROM THE North LINE AND 1980 FEET FROM East LINE, SECTION 29 TOWNSHIP 24S RANGE 38E NMPM.	10. Field and Pool, or Wildcat Dollarhide Tubb-Drinkard
15. Elevation (Show whether DF, RT, GR, etc.) 3223' DF	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input checked="" type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

3/23/83 Left 21' of mud anchor in hole.
3/24/83 Ran 4 5/8" overshot. Tag @ 6752' no catch pull overshot ran imp. block showed pieces of tbq looking up 1 1/2" wide.
3/25/83 Trip in w/ 4 3/4" basket, 1 jt washpipe, tag @ 6751'. Clean out to 6771'.
3/28/83 Pull tbq & washpipe and recovered pieces of tbq and csg. Ran 4 3/4" shoe and 1 jt W.P. C.O. 6771-6779'. Pull tools and recovered 10' piece of tbq.
3/29/83 Ran 4 3/4" shoe and 1 jt washpipe. Clean out 6779-6840'. Pull shoe and recovered 6' piece of tbq.
3/30/83 Ran GR/CCL 6500-6833'. Perf w/ 4" gun w/ 2 SPF at 6777, 78, 79, 82, 83, 84, 85, 89, 91, 92, 93, 94, 95, 6813, 14, 15, 16, 17, 18, 19, 28 and 6829 total of 44 holes. Spot 150 gals 15% NEFE HCL @ 6867-6712'. Treated perfs w/ 7000 gals 15% NEFE HCL and 245 gals pentefax, 1500# rock salt and 88 ball sealers.
3/31/83 TOH w/ tbq & pkr. Ran 2 3/8" production tbq to 6809'. Placed well back on production

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED D. E. Crockett TITLE Area Superintendent DATE April 6, 1983

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____ DATE _____

APR 11 1983

SECRET