(LEA COUNTY)

Form Approved. Budget Bureau No. 42-R1424

9-331
1973

UNITED STATES DEPARTMENT OF THE INTERIOR TO O. **GEOLOGICAL SURVEY**

C	<u></u>	- Marie 1997	
L.c.	1960	168 NA	オルハリメニ
		V 0 /3/	77070

Ų.	+c 067968 NM	0185
6.	IF INDIAN, ALLOTTEE OR TRIBE NAME	
	UNIT AGREEMENT NAME	

SUNDRY	NOTICES	AND	REPORTS	ON	WELLS	

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9–331–C for such proposals.)

- 1. oil well 🔯 \Box well other 2. NAME OF OPERATOR
- Getty Oil Company
- 3. ADDRESS OF OPERATOR P. O. Box 730, Hobbs, New Mexico 88240
- 4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 AT SURFACE: UL G, 2310' FNL, 1980' FEL AT TOP PROD. INTERVAL: AT TOTAL DEPTH:
- 16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

- West Dollarhide Drinkard Unit
- 8. FARM OR LEASE NAME West Dollarhide Drinkard Unit
- 9. WELL NO.
- 10. FIELD OR WILDCAT NAME Dollarhide Tubb-Drinkard
- 11. SEC., T., R., M., OR BLK. AND SURVEY OR
- 30-245-38E 12. COUNTY OR PARISH 13. STATE Rew Mexico 14. API NO.
- 15. ELEVATIONS (SHOW DF, KDB, AND WD) 313010GR 3 2333

15

SUBSEQUENT REPORT OF: REQUEST FOR APPROVAL TO: TEST WATER SHUT-OFF 1-R.J. STARRAK-TULSA FRACTURE TREAT 1-A.B. CARY-MIDLAND SHOOT OR ACIDIZE 1-E. Rettress, ENGINEER REPAIR WELL PULL OR ALTER CASING 1-C. King Sten, FOREMAN **MULTIPLE COMPLETE** 1-FILE **CHANGE ZONES** -0-, WIO'S -LIST ATTACHED **ABANDON*** 1-BH, FIELD CLERK Recement Casing (other)

- 17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*
 - Rig up pulling unit.
 - 2. Pull rods and pump.
 - 3. Install BOP and pull tubing.
 - Rum retrievable BP to approximately 6000'. Test BP and casing to 1000 psi.
 - 5. Spot 10' of sand on top of BP.
 - Run cement bond log 6000' to surface.
 - 7. Perforate and cement squeeze intervals not adequately cemented.
 - 8. WOC 24 hrs.
 - 9. Drill out cement and test casing to 1000 psi.
 - Wash sand off BP and retrieve. 10.
 - 11. Run tubing, rods, and pump and place back on production

Subsurface Safety Valve: Manu. and Type	Set @	. F
18. I hereby certify that the foregoing is true and correct SIGNED TITLE Area Supt. DATE.	8-17-78	
Dale R Crockett		
(This space for Federal or State office use)		

APPROVED BY DATE CONDITIONS OF APPROVAL, IF ANY:

JAMES F. SIMS DISTRICT ENGINEER