

OIL CONSERVATION DIVISION

2040 South Pacheco

Santa Fe, NM 87505

<p>SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)</p>		<p>WELL API NO. 30-025-12266</p>
<p>1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/> Injection <input type="checkbox"/></p>		<p>5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/></p>
<p>2. Name of Operator Texaco Exploration & Production, Inc.</p>		<p>6. State Oil & Gas Lease No.</p>
<p>3. Address of Operator P. O. Box 3109, Midland, TX 79702</p>		<p>7. Lease Name or Unit Agreement Name: West Dollarhide Drinkard Unit</p>
<p>4. Well Location Unit Letter <u>N</u> : <u>330</u> feet from the <u>South</u> line and <u>2310</u> feet from the <u>West</u> line Section <u>30</u> Township <u>24S</u> Range <u>38E</u> NMPM Lea County</p>		<p>8. Well No. 31</p>
<p>10. Elevation (Show whether DR, RKB, RT, GR, etc.)</p>		<p>9. Pool name or Wildcat Tubb Drinkard</p>

<p>11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data</p>	
<p>NOTICE OF INTENTION TO:</p> <p>PERFORM REMEDIAL WORK <input type="checkbox"/> PLUG AND ABANDON <input type="checkbox"/></p> <p>TEMPORARILY ABANDON <input type="checkbox"/> CHANGE PLANS <input type="checkbox"/></p> <p>PULL OR ALTER CASING <input type="checkbox"/> MULTIPLE COMPLETION <input type="checkbox"/></p> <p>OTHER: <input type="checkbox"/></p>	<p>SUBSEQUENT REPORT OF:</p> <p>REMEDIAL WORK <input type="checkbox"/> ALTERING CASING <input type="checkbox"/></p> <p>COMMENCE DRILLING OPNS. <input type="checkbox"/> PLUG AND ABANDONMENT <input checked="" type="checkbox"/></p> <p>CASING TEST AND CEMENT JOB <input type="checkbox"/></p> <p>OTHER: <input type="checkbox"/></p>

- 12. Describe proposed or completed operations.** (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.
- Set 5 1/2" CIBP @ 6300' (Drinkard-ABO) spot 25 Sx plug on top 6300'-6100'
 - Displace hole w/MLF 9.5# brine w/25# gel P/BBL
 - Spot 25 Sx plug 3600'-3500' (Queen)
 - Cut 5 1/2" Csg @ 3150' unable to pull & unable to Sqz spot 30 Sx plug 3200'-3050' (8 5/8" shoe) WOC Tag Cmt @ 2965'
 - Perf 6 holes @ 1600' unable to Sqz spot 30 sx plug 1647'-1400' (B-Salt) Tag 1371'
 - Perf 6 holes @ 1200' (T-Salt) Sqz 50 Sx cmt 1200'-1000' Tag @ 969'
 - Perf 6 holes @ 390', Sqz 50 Sx cmt 390'-190' (13 3/8" shoe) Tag @ 150'
 - Circ Cmt 60' to Surf w/15 Sx, Install dry hole marker. 4/17/01

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Jimmy Bagley TITLE MANAGER DATE 4/17/01

Type or print name Jimmy BAGLEY Telephone No. 915 683-4996
(This space for State use)

APPROVED BY [Signature] TITLE Ad Rep DATE 10-23-01
Conditions of approval, if any:

GW