

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE
(Other instructions on reverse side)

1. Well completed
Bureau of Land Management
Lamar, Colorado 81001
2. LEASE DESIGNATION AND NUMBER
LC-069052
3. IF INDIAN, ALLOTTEE OR TRIBE, NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT" for such proposals.)

1. ☒ OIL WELL ☒ GAS WELL ☐ OTHER Water Injection
2. NAME OF OPERATOR
Sirgo Operating, Inc.
3. ADDRESS OF OPERATOR
P.O. Box 3531, Midland, Texas 79702
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.)
At surface
Unit D, 330 FNL 990 FWL
14. PERMIT NO. 15. ELEVATIONS (Show whether DE, RT, GR, etc.)

7. UNIT AGREEMENT NAME
West Dollarhide Queen Sand
8. FARM OR LEASE NAME Unit
9. WELL NO.
22
10. FIELD AND POOL OR WILDCAT
Dollarhide Queen
11. SEC., T., R., M., OR BLM. AND SURVEY OR AREA
Sec. 31, T24S R38E
12. COUNTY OR PARISH 13. STATE
Lea NM

16 Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF	FULL OR ALTER CASING
FRACTURE TREAT	MULTIPLE COMPLETION
SHOOT OR ACIDIZE	ABANDON*
REPAIR WELL	CHANGE PLANS
(Other)	

SUBSEQUENT REPORT OF:

WATER SHUT-OFF	REPAIRING WELL
FRACTURE TREATMENT	ALTERING CASING
SHOOTING OR ACIDIZING	ABANDONMENT*
(Other)	

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17 DESCRIBE PROPOSED OR COMPLETED OPERATIONS. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

1-30-90 MI&RU plugging unit. RIH w/5-1/2" CR. Tagged fill. Can't circ. POH w/CR. RIH w/open-ended tbg & circ down to 3710'. POH. RIH w/CR to 3630'. Squeeze w/ 35 sx. Class C, spot 5 sx on top. Circ 10.2 brine mud to 2600'. Perf @ 2600'. Set CR @ 2500'. Attempt to squeeze w/30 sx Class C. Will not take cmt. Put 2000# on cmt (w/BLM approval). Spot 25 sx Class C on top. Circ 10.2 brine mud to 1200'. Perf @ 1200'. Set CR @ 1100', squeeze w/30 sx Class C, spot 5 sx on top. Circ 10.2 brine mud to 250'. Perf @ 250'. Bullhead 100 sx to surface. Install P&A marker.

18. I hereby certify that the foregoing is true and correct

SIGNED Bonnie Atwater

TITLE Production Technician

DATE 2-2-90

(This space for Federal or State office use)

APPROVED BY
CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE 2-12-90

*See Instructions on Reverse Side

RECEIVED

FEB 14 1990

OCD
HOBBS OFFICE