

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-12291
5. Indicate Type of Lease	STATE ☐ FEE ☒
6. State Oil & Gas Lease No.	010926
7. Lease Name or Unit Agreement Name	West Dollarhide Drinkard Unit
8. Well No.	65
9. Pool name or Wildcat	West Dollarhide
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	DF 8" 3117 GL

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL ☐ GAS WELL ☐ OTHER water injection

2. Name of Operator
Texaco E&P Inc. (Texaco)

3. Address of Operator
P.O. Box 730, Hobbs, NM 88240

4. Well Location
Unit Letter J : 2090 Feet From The FSL Line and 1650 Feet From The FEL Line

Section 31 Township T24S Range 38E NMPM LEA County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
DF 8" 3117 GL

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data.	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☒
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.
- 7-11-94 1. Notify NMCD Jerry Sexton @ 9:30 AM of intend to plug & abandon well.
 - 7-12-94 2. RU Pool plugging equip. & W.O. Unit, Nipple down wellhead & nipple up BOP.
 - 3. Pickup 2 3/8 tub, workstring & tally in hole to TOC @ 5915. Mix mud & load hole.
 - 4. POOH to 3850 mix & spot 25 sxs cmt. plug.
 - 5. POOH 20 strands SDON. W.O.C.
 - 7-13-94 6. TIH tag cmt. @ 3811. Called NMCD @ 9:00 AM talked to Jerry Sexton, he said to respot plug, mix & spot 25 sxs plug @ 3811. POOH to stands WOC 4 hrs. TIH tag cmt. @ 3559. Notify NMCD Jerry said to test 5 1/2 csg to 1000. Tested to 1000# held ok.
 - 7. TOH to 2900 spot 25 sxs cmt plug @ 2900 Pull 20 stds & reverse out of hole. SDON
 - 7-14-94 8. TIH tag TOC 2728. Notify NMCD of cmt. tag. TOH to 1350 spot 25 sxs plug w/2%. Pull 20 strands WOC 6 hrs. TIH tag cmt. 1082.
 - 9. TOH to 350 mix 50 sxs cmt. & circ. to surface. TOH laydown tub.
 - 10. Cap well & install dryhole maker post w/well name, company name, & legal discription
 - 11. Rig down clean location of trash & move off.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Jim Calder TITLE P&A Supervisor Agent (Pool Co.) DATE 8-25-94

TYPE OR PRINT NAME Jim Calder TELEPHONE NO. _____

(This space for State Use)

APPROVED BY Charles Perren TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY: _____