

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 3002512292
5. Indicate Type of Lease STATE ☐ FEE ☒
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name West Dollarhide Drinkard Unit
8. Well No. 67
9. Pool name or Wildcat Dollarhide Tubb Drinkard

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil ☒ GAS ☐ OTHER ☐	
2. Name of Operator Texaco E&P Inc.	
3. Address of Operator P.O. Box 730 Hobbs, NM 88240	
4. Well Location Unit Letter <u>P</u> : <u>660</u> Feet From The <u>South</u> Line and <u>660</u> Feet From The <u>East</u> Line Section <u>31</u> Township <u>24S</u> Range <u>38E</u> NMPM Lea County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data.	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☒
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.
- 6-24-94 Notify Jerry Sexton of NMOCD of intent to plug & abandon well.
MIRU Pool & install BOP.
- 6-24-94 to 7-19-94 Ran 4-3/4" bit & 6-3 1/2" dcs & tbq. tag fill 5580'. Wash & drill out to 6361'.
- 7-21-94 Ran tub in hole 6360'. Mix & spot 170 sxs class C cmt. POOH to 5300 W.O.C. 4 hrs. Tag cmt. @ 6267. Mr. Charlie Perrin of NMOCD witnessed plug.
- 7-22-94 csg press 450 PSI bled off no flow. Tag cmt. 6239' RU BJ spotted 100 sxs class H w/0.1 % LCM f/6239 to 5447. POOH to 4422 W.O.C. 4 hrs. Tag cmt. 5174.
- 7-25-94 Spot 40 sxs cmt. plug from 3800-3500. POOH spot 25 sxs cmt. plug from 2600-2450. POOH spot 25 sxs cmt. plug f/1350-1200. POOH spot 50 sxs cmt. plug from 350 to surface. Rigdown pulling unit.
- 7-26-94 Cut off head & weld on plate & install dry hole marker. Clean location, all pumping and tagging of plugs witnessed by Charlie Perrin of NMOCD.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Jim Calder TITLE P&A Supervisor (Agent-Pool Co.) DATE 7-24-94
TYPE OR PRINT NAME Jim Calder TELEPHONE NO.

(This space for State Use)

APPROVED BY Charlie Perrin OIL & GAS INSPECTOR DATE 7-25-1995
CONDITIONS OF APPROVAL, IF ANY: