

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.O.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

0+5-NMOCD-Hobbs 1-Laura Richardson-Midland
1-File 1-Southland Royalty Co.
1-Engr. Jim 1-Arco
1-Foreman CK, 1-CP, 1-CB, 1-JA, 1-BB, 1-BW

Form C-103
Revised 10-1-73

5a. Indicate Type of Lease
State ☒ Fee ☐

5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG WELLS TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT TO DRILL" (FORM C-101) FOR SUCH PROPOSALS.)

1. ☐ OIL WELL ☐ GAS WELL ☐ OTHER- Water Injection Well	7. Unit Agreement Name
2. Name of Operator Getty Oil Company	8. Farm or Lease Name W. Dollarhide Queen Sand Unit
3. Address of Operator P.O. Box 730, Hobbs, NM 88240	9. Well No. 44
4. Location of Well UNIT LETTER N 810 FEET FROM THE South LINE AND 1830 FEET FROM THE West LINE, SECTION 32 TOWNSHIP 24S RANGE 38E NMPM.	10. Field and Pool, or Wildcat Dollarhide Queen
15. Elevation (Show whether DF, RT, GR, etc.) 3150' DF	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOBS ☐	OTHER ☒

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1/18/83 8 5/8" set @ 1210'. Open hole 3650-3726'. 5 1/2" @ 3650'. Rig up X-pert.
1/19/83 Flowing back.
1/20/83 Flowing back to hard to work. Rig down unit.
1/24/83 Rig up unit. Attempt to unseat packer, unable.
1/25/83 Unseated packer and layed down 115 jts and AD tension packer. Ran 5 1/2" retainer to 3547'.
1/26/83 Set retainer at 3547' and squeezed with 75 sxs "C", left 25 sxs on top of retainer. Pull tbq to 2800' and spot 25 sxs 2800-2660'. Shot 2 holes @ 1300' and circulate out braden head. Cement with 100 sxs @ 1100-1300'. Pull tbq. Set 10 sxs surface plug & install dry hole marker.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED D.R. Crockett TITLE Area Superintendent DATE February 3, 1983

APPROVED BY David R. Catana TITLE OIL & GAS INSPECTOR DATE 3-23-83

CONDITIONS OF APPROVAL, IF ANY: