Submit 3 Copies to Appropriate District Office

APPROVED BY -

CONDITIONS OF APPROVAL, IF ANY:

State of New Mexico Energy, Minerals and Natural Resources Department

Form C-103 Revised 1-1-89

DISTRICT I P.O. Box 1980, Hobbs, NM 88240 DISTRICT II P.O. Daylor DD. Ageria NM 88240 CIL CONSERVATION DIVISION P.O. Box 2088 Santa Fe, New Mexico 87504-2088		WELL API NO. 30-025-12340 5. Indicate Type of Lease STATE FEE		
P.O. Drawer DD, Artesia, NM 88210 DISTRICT III 1000 Rio Brazos Rd., Aziec, NM 87410 SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"				
			6. State Oil & Gas Lease No. 1732	PEE
			7. Lease Name or Unit Agreement Na	//////////////////////////////////////
(FORM C-10	OIN. USE APPLICATION FOR PER OI) FOR SUCH PROPOSALS.)	RMIT	WEST DOLLARHIDE	
1. Type of Well: OIL CAS WELL WELL	OTHER INJECT	ror	DEVONIAN UNIT	
2. Name of Operator			8. Well No. 105	
CHEVRON U.S.A. INC. 3. Address of Operator				
P.O. BOX 1150 MIDLAND,	TX 79702 ATTN: P.R. M	MATTHEWS	9. Pool name or Wildcat DOLLARHIDE DEVONIAN	
4. Well Location Unit LetterL 1650	Feet From The SOUTH	Line and 330	Feet From The	Line
Section 33		3 O⊞	NMPM LEA	County
	10. Elevation (Show whether i	OF, RKB, RT, GR, etc.)	V///////	
11. Check An	3177 GL	International D		
NOTICE OF INTE	propriate Box to Indicate NNTION TO:		eport, or Other Data SEQUENT REPORT OF:	
PERFORM REMEDIAL WORK	PLUG AND ABANDON			
TEMPORARILY ABANDON		REMEDIAL WORK	ALTERING CASIN	
	CHANGE PLANS	COMMENCE DRILLING		DONMENT
PULL OR ALTER CASING		CASING TEST AND CE	MENT JOB XX	_
OTHER:		OTHER:		
12 Describe Proposed or Completed Operation work) SEE RULE 1103. MIRU, KILL WELL WITH 14 SET CICR AT 3521. TIH TIH AND SET CICR AT 355 DRILL OUT CICR AND CEME ISOLATE CASING LEAK FROUDRILL OUT CIBP AND CEME RETEST CASING, TEST FAITEST CASING FROM 3642-1 PUMP 100 SXS. OF CEMENT RBP AND ATTEMPT TO PULL PULLED OUT OF RBP AND 1 NO TEST, TOH. SUSPEND 12-06-91.	4.9 PPG MUD. ISOLATE WITH MILL AND CUT OVE 27. PUMP INTO CICR WI 27. PUMP INTO CICR WI 27. POMP 3528-3700. NO 28. SET CIBI ONT FROM 3500-3722. ILED. REISOLATE CASIN 3497, TESTED GOOD. TI I INTO CICR. DRILL OU L OUT OF HOLE. RBP HE TOH. TRIP IN HOLE WIT	CASING LEAK AT TR CICR AND PUSH TH 150 SXS. OF MOVE RBP TO 4130 P AT 3500. PUMB TG LEAK FROM 367 TH AND SET CICR JT TO 3714. TIP CCAME STUCK, WOU TH RBP AND SET A	3658-3719. H TO 3690. CEMENT. 100 SXS. CF CEMENT. 13-3690. AT 3497. H TO 4130 AND REL. JLD NOT MOVE UP OR DOWN. T 2850. TESTED RBP,	
I hereby certify that the information above is true and	complete to the heat of my branded and the	-1:-d		
SIGNATURE P.R. Matthe	· · · · · · · · · · · · · · · · · · ·	TECHNICAL ASSI	STANT 2-11-9	2
TYPE OR PRINT NAME P.R. MATTH	ws.		TELEPHONE NO(9)	15)687-7812
(This space for State Use) O 1/ D 10 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1			ត្ ^{រា} យ ១	3 1