

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form O-103
Revised 11-1-73

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

0+6-NMOCD-Hobbs 1-Mr. J.A.-Midland
1-File 1-Laura Richardson-Midland
1-Engr Jim 1-JA 1-CP
1-Foreman CK 1-BB 1-CB

3. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	
B-1732	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT TO DRILL" (FORM O-101) FOR SUCH PROPOSALS.)

1. <input type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- Injection Well		7. Unit Agreement Name West Dollarhide Drk. Unit
2. Name of Operator Getty Oil Company		8. Farm or Lease Name
3. Address of Operator P.O. Box 730, Hobbs, New Mexico 88240		9. Well No. 41
4. Location of Well UNIT LETTER <u>D</u> <u>990</u> FEET FROM THE <u>North</u> LINE AND <u>990</u> FEET FROM THE <u>West</u> LINE, SECTION <u>33</u> TOWNSHIP <u>24S</u> RANGE <u>38E</u> N.M.P.M.		10. Field and Pool, or Wildcat Dollarhide Tubb Drinkard
15. Elevation (Show whether DF, RT, GR, etc.) 3207' DF		12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	T&A <input checked="" type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

10/19/83 Ran 5 3/4" overshot, tag fish @ 3900', recovered 10' of junk 2 3/8" tbq.
10/20/83 Ran 6 1/4" cutrite shoe w/ T-dog, 2 joints 4 1/2" washpipe, tag 2606-2900', tag fill @ 3879', clean out to 3902', top fish @ 3902', wash 40' over fish to 3942'.
10/21/83 Wash 3942-45'. Pull shoe and washpipe, recovered 21' of 2 3/8" tbq. Ran shoe and washpipe, wash 3925-4005'.
10/22/83 Wash over 4005-4015', pull tools. Recovered 21' of 2 3/8" tbq. Ran tools, wash over 4015-4094'. Pull to 2600'.
10/24/83 Pull tools rec 15-20' junk pipe, ran 6 1/4" cut rite shoe 2 joints of 6" W.P. & tagged @ 4095'. Wash to 4261'.
10/25/83 Wash over 4261-4280. Pull shoe to 3590' well flowing oil & gas. Circ 140 bbls of 10# brine. Well still flowing.
10/26/83 Pull tools & rec est 75' of junk 2 3/8" tbq. Ran 2 joints 5" W.P. Tagged @ 4280' & washed to 4345'. Pulled tools. No recovery. Ran 4 joints of wash pipe to 3785'.
10/27/83 Tagged @ 4380'. Wash to 4440' pull tools rec 250' of 2 3/8" tbq. Ran 4 joints 6" W.P. & 1 joint 4 1/2" W.P. to 3785'.
10/28/83 Tagged @ 4455', cut over 70' 4455-4525' & recovered 10' of 2 3/8" tbq. TOH w/ 2 3/8" + 2 joints 4 1/2" W.P. + T-dogs + 4 joints 6" W.P. & 6 1/4" shoe. TIH w/ 6 1/4" shoe + 4 joints of 6" W.P. + T-dogs + 2 joints of 4 1/2" W.P. on 2 3/8" tbq. Left 6 1/4" shoe @ 750'.
10/29/83 Cut over fish. 4525-4624. Pull W.P. shoe worn out. Ran new shoe to 1680'.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED D.R. Crockett TITLE Area Superintendent DATE November 8, 1983

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

APPROVED BY
CONDITIONS OF APPROVAL, IF ANY:

NOV 10 1983

10/31/83 Sat. wash to 4624'. Ran tools, tag 4526'. Cutover to 4556'. Pull tools to 3926'
11/1/83 Trip out of hole w/ washpipe. Recovered 8-10', 2 3/8" tbq. Ran 2 joints 6"
washpipe, 2 joints 4 1/2" washpipe. Tag @ 4556'. Cut over 9'.
11/2/83 Tag @ 4565'. Mill to 4569'. Pull tools. Rec 20' junk 2 3/8" tbq. Reran 6 1/4"
shoe, 2 joints W.P. and 2 joints 4 1/2" W.P. to 4500'.
11/3/83 Cut over 4569-73'. Pull tools. Change over 2 3/8" to 4 1/2" W.P. broke. Ran
5 3/4" over-shot to 4270'.
11/4/83 Tag fish @ 4339'. Lay down W.P. and work string. Remove BOP. Install wellhead.
T&A.

RECEIVED
NOV 9 1983
RANCO
WASH PIPE