SUPPRINTED  SENTATE  FIRE  JAMOORE  SANDERS  SUNDER NOTICES AND REPORTS ON WHITE  SUNDER NOTICE OF PRENTION TO:  WEST 2 2.25-5 37-E  Check Appropriate Box to Indicate Now Account of the Public Blinebry and Justic Tubb Drinkard Zones. NoTICE OF PRENTION TO:  Well is a dwally completed oil well in the Justic Blinebry and Justic Tubb Drinkard Zones. Uning two strings of 2-77' Casing. Pucker Lonkage Test indicated communication.  After setting 1-3/" liner from 502' back to 31" in the Justic Tubb Drinkard String (c-103 Dated 3-3-70); a leak was still indicated. Attempted to reset top packer-leak still apparent. Pulled liner; reirressed pack off; and shortened liner (54.2'-5354') - Communication was successfully scaled off.  Literal Policy and String 1-3/" Leak still apparent. Pulled liner; reirressed pack off; and shortened liner (54.2'-5354') - Communication was successfully scaled off.  Literal Policy and String 1-3, 1870.  AREA GUPZETSTERMENT. April 13, 1870.									
SUNDAY NOTICES AND REPORTS ON ALL  SUNDAY NOTICE OF INTENTION TO.  REPAR CASTOR LEAK  A  REPAR CASTOR LEAK  X  REPAR CASTOR LEAK  X  REPAR CASTOR LEAK  X  SUNDAY NOTICE OF INTENTION TO.  SUNDAY SUNDAY NOTICES ON ALL SUNDAY A	NO. OF COPIES RECEIV	EC							
SUNDRY NOTICES AND SERVIS CHIEF.  SUNDRY NOTICES AND SERVIS CHIEF.  SUNDRY NOTICES AND SERVIS CHIEF.  STATE "BE"  F.O. Box 249, Hobbs, New Mexico CO240  CHIPY OIL COMPANY  F.O. Box 249, Hobbs, New Mexico CO240  SUNDRY D. 430  North  31/2 FF  LEA  Check Appropriate Bux to indicate Many tops, Servis at the flats Notice of Intention To.  REPAIR CASTNE LEAK  Y  Check Appropriate Bux to indicate Many tops, Servis at the flats Notice of Intention To.  REPAIR CASTNE LEAK  Y  Color of the Control of the	DISTRIBUTION	<del></del>		_			( •102 an	1 -102	
AND OFFICE  CPERATOR  SUNDRY NOTICES AND REPORTS ON THE STATE "BE"  SUNDRY NOTICES AND REPORTS ON THE STATE "BE"  F.O. BOX 249, Robbs, New Mexico 33240  STATE "BE"  ROBERTY OIL COMPANY  F.O. BOX 249, Robbs, New Mexico 33240  STATE "BE"  Check Appropriate But to Indicate Nature for the defent of the State Notice of International Control of International Contro			NEW MEXICO DIL	. CONSERVATION	F TO WMISSION		: Mestive	r ( n. <del>n. n.</del>	
SUNDRY NOTICES AND REPORTS ON HELIS  SUNDRY NOTICES AND REPORTS ON HELIS  SUNDRY NOTICES AND REPORTS ON HELIS  STATE "EE"  PAGE "EE"  PAGE "EE"  PAGE "EE"  Check Appropriate Have to fade at Nature at a state of the that NOTICE OF INTENTION TO:  REPAIR CASTON LOAK  WEST 2 25-9 37-E  Check Appropriate Have to fade at Nature at a state of the that NOTICE OF INTENTION TO:  REPAIR CASTON LOAK  Well is a durilly completed oil well in the Justice Blinsbry and Justice Tubb Drinkard Zones.  Using two strings of 2-7/-" Cusing. Packer Leakage Test indicated communication.  After setting 1-3/-" liner from 5302' back to 512" in the Justice Tubb Drinkard String (-010) back and 3-3-70') a leak was still indicated. Attempted to reset top packer—leak still apparent. Pulled liner and reran with new type pack-off cups. (Set from 5795'-5174') - leak still apparent. Pulled liner; restressed pack off; and shortened liner (54.2'-5354') - Communication was successfully scaled off.  Descriptions of Annother Land Loaks and Land Lupskintened.  April 13, 1970.  ALLE Land Land Land Land Lupskintened.			•			-	I Trainate	Type o Lea.	F
SUNDEY NOTICES AND SEPONIS OR WELLS  CHTY OIL COMPARY  F.O. BOX 249, Bobbs, New Moxico 38240  2  CHEST 12 22-5 37-E  Check Appropriate Box to Indirate Nature from a Strong and the risks notice of intention to  NOTICE OF INTENTION TO:  REPAIR CASING LSAK  X  CHEST 22 27-5 37-E  REPAIR CASING LSAK  X  CHEST 23 4 25-5 25-7 25-7 25-7 25-7 25-7 25-7 25-7			l <b>-F</b> ile				James 🔀	•	F #4
SUNDEY NOTICES AND REPORTS ON RELIANCE TO THE TERM OF						i			
Control of the contro							E-1566-	<u> </u>	TTTTT
STATE "BE"  STATE "BE"  Althoris and the state of the sta	COD NOT USE TH	SUNDRY NOT HIS FORM FOR PROPOSALS T USE "APPLICATION FOR P	ICES AND REPORTED TO DESPEND TO DESPENDENT TO DESPEND TO DESPENDENT TO DESPEND TO DESPENDENT TO DESPEND TO DESPENDENT TO DESPEND TO	TS ON WELLS See 1 et 2 et 2 et 2	로 및 및 및 이 1,5, 전환 (*) 1	÷ .			
SETTY OIL CMPANY  P.O. Box 249, Hobbs, New Mexico 38240  1. Located final  D. 430 North 990 Justic Blinebry Prince of North 990 Justic Blinebry Prince of North 990 North 990 Justic Blinebry Prince of North 990 North 990 Justic Blinebry Prince of North 990 Justic Blinebry and Justic Blinebry Edward Zones.  Well is a dually completed oil well in the Justic Blinebry and Justic Tubb Diriakard Zones.  Using two strings of 2-7/10 Chaing. Packer Leakage Test indicated communication.  After setting 1-3/10 liner from 380 host bline to 510 in the Justic Tubb Diriakard String (c-103 Dated 3-3-70); a leak was still idicated. Attempted to reset top packer-leak still apparent. Pulled liner and reran vit. now type pack-off cups. (Set from 5795'-5174') - leak still apparent. Pulled liner in the Justic Tubb Diriakard String (c-103 Dated 3-3-70); a leak was still indicated. Attempted to reset top packer-leak still apparent. Pulled liner: redressed pack off; and shortened liner (54 ½'-5354') - Communication was successfully scaled off.  **Prince of the Prince	l .		R-						
P.O. Box 249, Hobbs, New Mexico 28240  2 25-8 37-E    HEST	GETTY OIL COMP					: - ·	STATE "	BB''	
Check Appropriate Box To Indicate Nature of the Cast of the Landon Notice of Intention to Notice of Intention Intention Indicated Notice Indicated Communication.  After setting 1-3/3" liner from 5302' back to 513' in the Justis Tubb Drinkard String (c-103 Dated 3-3-70); a leak was still indicated. Attempted to reset to packer-leak still apparent. Fulled liner and reran with new type pack-off cups. (Set from 5595'-517') - leak still apparent. Fulled liner; redressed pack off; and shortened liner (34.2'-5354') - Communication was successfully scaled off.			co 38240				2		
Check Appropriate Box To Indicate Nature of the Reserve of the Indicate Nature of the Indicate Indicate Indicate Indicate Communication.  Repair Casing Leak x x x x x x x x x x x x x x x x x x x	4. Location of Well	HODDES HOW MORE	.00 00210						
Check Appropriate Bus To Indicate Notice Repetion 19th Plate NOTICE OF INTENTION TO:  ***CHANGE PLANS   PROPRIATE ASSESSED    ***CHANGE PLANS   PROPRIATE PLANS    ***CHANGE PLANS   PROPRIATE	UNIT LETTER	D 430	FEET FROM TO NOT	th	990	Pijam sa w	Justis	Blinebry	-Drinkar
Check Appropriate Bus To Indicate Notice Repetion 19th Plate NOTICE OF INTENTION TO:  ***CHANGE PLANS   PROPRIATE ASSESSED    ***CHANGE PLANS   PROPRIATE PLANS    ***CHANGE PLANS   PROPRIATE	44	,		0 E - 0	27-17				
Check Appropriate Bes To Indicate Natural Section of the Plans NOTICE OF INTENTION TO:  ***********************************	THE WEST	LINE, SECTION	**************************************	<u> 22<b>-</b>5</u>	<u> 3(−</u> E	= * /			
Check Appropriate Bex 1s Indicate Notice Septem of Decrease NOTICE OF INTENTION TO:  ***COMMUNICATION TO:  ***COMUNICATION TO:  ***COMMUNICATION TO:  ***COMMUNICATION TO:  ***COMMUNICATION TO:  ***COMMUNICATION TO:  ***COMMUNICATION TO:  ***C	THINNIN TO		15. Electric (1871)	5. 3 x - 2 x I x - 3 1.			. <b></b>		
REPAIR CASING LEAK  ***********************************			3	3139 DF			LEA		
REPAIR CASING LEAK  The continue of the contin	16.	Check Approp	oriate Box To Indi	cate Solution?					
REPAIR CASING LEAK  Y  OTHER  17. Describe imposent of Describes (French var)  work) see Bull 102.  Well is a dually completed oil well in the Justic Blinebry and Justic Tubb Drinkard Zones. Using two strings of 2-7/3" Casing. Packer Leakage Test indicated communication.  After setting 1-3/3" liner from 5302' back to 512' in the Justic Tubb Drinkard String (c-103 Dated 3-3-70); a leak was still indicated. Attempted to reset top packer-leak still apparent. Pulled liner and reran with new type pack-off cups. (Set from 5795'-5174') - leak still apparent. Pulled liner; redressed pack off; and shortened liner (54/2'-5354') - Communication was successfully scaled off.  15. Thereby certify that the information shows is true and sources to be set to be s	<b>N</b>	NOTICE OF INTENT	ION TO:		51 년	FECUENT	447077	DE	
REPAIR CASING LEAK  X  OTHER  17. Demonstrative possible of Completed oil well in the Justis Blinobry and Justis Tubb Drinkard Zonce. Using two strings of 2-7/" Cusing. Packer Leakage Test indicated communication.  After setting 1-3/3" liner from 5802' back to 5131' in the Justis Tubb Drinkard String (c-103 Dated 3-3-70); a leak was still indicated. Attempted to reset top packer-leak still apparent. Pulled liner and reran with new type pack-off cups. (Set from 5795'-5174') - leak still apparent. Pulled liner; redressed pack off; and shortened liner (5432'-5354') - Communication was successfully scaled off.  13. Thereby certify that the information observed true and content of the content			3 6 6 7 7 9 5 2				·	ing in a seek in the second	
Well is a dually completed oil well in the Justis Blinebry and Justis Tubb Drinkard Zones.  Well is a dually completed oil well in the Justis Blinebry and Justis Tubb Drinkard Zones.  Using two strings of 2-7/3" Casing. Packer Lankage Test indicated communication.  After setting 1-3/3" liner from 5802' back to 513' in the Justis Tubb Drinkard String (c-103 Dated 3-3-70); a leak was still indicated. Attempted to reset top packer-leak still apparent. Pulled liner and reran with new type pack-off cups. (Set from 5795'-5174') - leak still apparent. Pulled liner; redressed pack off; and shortened liner (5432'-5354') - Communication was successfully scaled off.  15.1 hereby certify that the information above is true and trainer (100 and 100 and 1		=	72.00 8.00 8.00		n a jaga en				-
Well is a dually completed oil well in the Justis Blinebry and Justis Tubo Drinkard Zones. Using two strings of 2-7/3" Cusing. Packer Leakage Test indicated communication.  After setting 1-3/3" liner from 5802' back to 513' in the Justis Tubo Drinkard String (c-103 Dated 3-3-70); a leak was still indicated. Attempted to reset top packer-leak still apparent. Pulled liner and reran with new type pack-off cups. (Set from 5795'-5174') - leak still apparent. Pulled liner; redressed pack off; and shortened liner (5432'-5354') - Communication was successfully scaled off.  Driginal Signed By  C. L. Wade AREA SUPERINTENDENT April 13, 1970			CHANGE HARE			3			
Well is a dually completed oil well in the Justis Blinebry and Justis Tubb Drinkard Zones. Using two strings of 2-7/3" Casing. Packer Leakage Test indicated communication.  After setting 1-3/3" liner from 5802' back to 5133' in the Justis Tubb Drinkard String (c-103 Dated 3-3-70); a leak was still indicated. Attempted to reset top packer-leak still apparent. Pulled liner and reran with new type pack-off cups. (Set from 5795'-5174') - leak still apparent. Pulled liner; redressed pack off; and shortened liner (5432'-5354') - Communication was successfully scaled off.  15.1 hereby centify hat the information above is true and successfully scaled off.  16.1 hereby centify hat the information above is true and successfully scaled off.  17.1 hereby centify hat the information above is true and successfully scaled off.  18.1 hereby centify hat the information above is true and successfully scaled off.  18.1 hereby centify hat the information above is true and successfully scaled off.  18.1 hereby centify hat the information above is true and successfully scaled off.  18.1 hereby centify hat the information above is true and successfully scaled off.  18.1 hereby centify hat the information above is true and successfully scaled off.  18.1 hereby centify hat the information above is true and successfully scaled off.					REPAIR	CASING	LEAK		X
Well is a dually completed oil well in the Justis Blinebry and Justis Tubb Drinkard Zones.  Using two strings of 2-7/3" Casing. Packer Leakage Test indicated communication.  After setting 1-3/3" liner from 5302' back to 513" in the Justis Tubb Drinkard String (c-103 Dated 3-3-70); a leak was still indicated. Attempted to reset top packer-leak still apparent. Pulled liner and reran with new type pack-off cups. (Set from 5795'-5174') - leak still apparent. Pulled liner; redressed pack off; and shortened liner (5432'-5354') - Communication was successfully scaled off.  13.1 bereby certify that the information above is true and society the set of the set o	OTHER								
Well is a dually completed oil well in the Justis Blinebry and Justis Tubb Drinkard Zones.  Using two strings of 2-7/3" Casing. Packer Leakage Test indicated communication.  After setting 1-3/3" liner from 5302' back to 513" in the Justis Tubb Drinkard String (c-103 Dated 3-3-70); a leak was still indicated. Attempted to reset top packer-leak still apparent. Pulled liner and reran with new type pack-off cups. (Set from 5795'-5174') - leak still apparent. Pulled liner; redressed pack off; and shortened liner (5432'-5354') - Communication was successfully scaled off.  13.1 bereby certify that the information above is true and society the set of the set o	17. Describe Fromoses	i or Complete: Sperations	e (Clearly state : '	<u></u>			7 - 1 - 1 - 1 - 1 - 1 - 1 - 1 - 1 - 1 -	p. J. it gerin	2 15 2 7 10 6 F
Original Signed By  C. L. Wade  AREA SUPERINTENDENT  April 13, 1970  CONDITIONS OF APPROVAL, IF ANCE	After setting (c-103 Dated leak still ap 5795'-5174')	ings of 2-7/3" 1-3/3" liner for 3-3-70); a lead parent. Pulled - leak still ap	Casing. Packer rom 5802' back k was still in liner and reseparent. Pulle	r Leakage Te to 5133 in dicated. At an with new d liner; re	the Justi tempted to type pack- edressed pa	s Tubb reset off cup	unication  Drinkard  top pack  s. (Set	String er- from	
CONDITIONS OF APPROVAL, IF ANY:	I.E. I hereby certify the	Original Signed	By			<u>r</u>		April 1	3 <b>, 19</b> 70
CONDITIONS OF APPROVAL, IF ANY:				<del></del>			=	4	
	$\sigma$	she I. Come	ents	5-6 <u></u>	<u></u>				
	CONDITIONS OF AP	PROVAL, IF ANY:							