

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-77

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease
State ☒ Fee ☐
5. State Oil & Gas Lease No.
B-1583

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG SALT TO A DIFFERENT RESERVOIR.
USE APPLICATION FOR PERMIT TO DRILL (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL ☐ GAS ☐ OTHER: SWD Well	7. Unit Agreement Name
2. Name of Operator Texaco Inc.	8. Farm or Lease Name NM "BZ" St. NOT-1
3. Address of Operator P. O. Box 728, Hobbs, NM 88240	9. Well No. 1
4. Location of Well UNIT LETTER <u>E</u> <u>1980</u> FEET FROM THE <u>1</u> LINE AND <u>2307</u> FEET FROM THE <u>26</u> LINE, SECTION <u>2</u> TOWNSHIP <u>25S</u> RANGE <u>37E</u> N.M.P.M.	10. Field and Pool, or Vicinity Justis Blinberry
15. Elevation (Show whether OF, RT, GR, etc.)	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
FULL OR ALTER CASING ☐	OTHER <u>Abandon Levee</u> ☒	CASING TEST AND CEMENT JOB ☐	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 103.

- 1) MIRR Pulling unit and install BOP's on the Z (Devonian) casing string.
- 2) Release the 1 1/2" x 2 7/8" packer at 6,838'. POH w/tubing and packer.
- 3) Set 2 7/8" CIBP at 6,975', in the Z casing string, on wireline. Dump 2 sx. class H cement on top of the CIBP.
- 4) Test the 2 7/8" Z casing string to 500 psi. If casing doesn't test, locate and squeeze the leak. Retest.
- 5) If casing tests, go in hole w/1 1/2" tubing. Tag TOC. Circulate the hole full w/10# gelled brine.
- 6) Pull up hole w/tubing and spot 37 sx. class H cement from 6,200' to 5,000'.
- 7) Pull up hole w/tubing and spot 28 sx. class H cement from 3,600' to 2,700'.
- 8) POH w/tubing and install a valve and pull plug on the 2 7/8" Z casing string.

* End top of salt and squeeze cement behind the 2 7/8"
3/14/86 not necessary for abandonment of Section 3 zone

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <u>J. W. [Signature]</u>	TITLE <u>District Administrative Supervisor</u>	DATE <u>03/05/86</u>
---------------------------------	---	----------------------

APPROVED BY <u>ORIGINAL SIGNED BY JERRY SEXTON</u>	TITLE <u>DISTRICT 1 SUPERVISOR</u>	DATE <u>MAR 7 - 1986</u>
--	------------------------------------	--------------------------

CONDITIONS OF APPROVAL, IF ANY: