Form 3160-5 (June 1990)

N.M. Oll Cons. Division UNITED STATES

OF THE INTERIOR 1625 N. French DEPARTME

FORM APPROVED Budget Bureau No. 1004-0135 Expires: March 31, 1993

BUREAU OF LAND MANAGEMENT Hobbs, NM 88240

SUNDRY NOTICES AND REPORTS ON WELLS		5. Lease Designation and Serial No.
Do not use this form for proposals to drill or to deepen or reentry to a different reservoir. Use "APPLICATION FOR PERMIT" for such proposals		6. If Indian, Alottee or Tribe Name
SUBMIT IN TRIPLICATE		7. If Unit or CA, Agreement Designation
1. Type of Well: OIL GAS WELL OTHER		8. Well Name and Number FRISTOE, C. CB- FED. NCT-2
2. Name of Operator TEXACO EXPLORATION & PRODUCTION INC.		8
3. Address and Telephone No. 15 SMITH ROAD, MIDLAND, TX 79705 915-687-737		9. API Well No.
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)		30 025 20928
Unit Letter G: 1980 Feet From The NORTH Line and 1979 Feet From The		10. Field and Pool, Exploaratory Area LANGLIE MATTIX 7 RVR QN GRAYBURG
EAST Line Section 35 Township 24S Range 37E		11. County or Parish, State LEA , NM
12. Check Appropriate Box(s) To Indicate Nature of Notice, Report, or Other Data		
TYPE OF SUBMISSION TYPE OF ACTION		
	Abandonment	Change of Plans
	✓ Recompletion	New Construction
☐ Notice of Intent	Plugging Back	Non-Routine Fracturing
✓ Subsequent Report	Casing Repair	Water Shut-Off
Final Abandonment Notice	Atlering Casing	Conversion to Injection
	OTHER: RECOMPLETE-GRAYBU	JRG Dispose Water
		(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log Form.)
 Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*. 5-06-02: MIRUPU. UNSEAT PUMP. 5-07-02: LD RDS. LD TBG. 		
5-08-02: PU CIB. RIH ON EAST STRING WWL CIBP. TAG @ 4415. MOVE BOP TO WEST SIDE. LOG W/GR FR 4655-3190. GET ON DEPTH & SET CIBP @ 5038'. DUMP 35' CMT ON TOP OF CIBP @ 5038. TIH W/WL CIBP. GET ON DEPTH & SET CIBP @ 4715'. DUMP 35' CMT ON TOP OF CIBP @ 4715'. RU SAND LINE W/SINKER BAR. TAG @ 4400'. WORK DOWN TO 4500'. 5-09-02: PU BIT, BS & WS. TAG FILL @ 4615'. C/O TO 4746'. 5-10-02: RIH W/WL/CIBP. SET CIBP @ 4715'. TIH W/CCL & 2" HSD-WL-DP GUNS. PERF EAST STRING FR 3937-3950. AIH W/BAILER & DUMP 35' CMT ON TOP OF CIBP. TIH W/PKR & SET @ 3902.		
5-13-02: ACIDIZE PERFS 4110-4120 W/750 GALS 15% NEFE. SPOT ACID ACR PERFS. CLOSE IN BACKSIDE. RU SWAB. 5-14-02: RD SWAB. SET PLUGS. 5-15-02: TIH WWL. SET CIBP ON EAST SIDE @ 3900. DUMP 35' CMT ON TOP OF PLUG @ 3900. SET CIBP. TIH TO 3900 ON WEST SIDE.		
DRILL, PUSH CIBP TO 4700, RD SWAB.		
5-16-02: <u>TIH W/CIBP & SET @ 3900.</u> PERF 3796-3816. DUMP 35' CMT ON CIBP. ACIDIZE W/1000 GALS 15% HCL. SPOT ACID TO PKR. SET PKR. RU SWAB. 5-20-02: RUN CIBP. TIE INTO GR/CCL RUN 5-8-02. SET CIBP @ 3740. COLLAR PERF @ 3507-3526, 3494-3502, 3472-3490. DUMP BAIL 35'		
CMT ON CIBP. PBTD @ 3705. TIH W/2 1/16" TBG. 5-21-02: SPOT ACID ACR PERFS. ACID ON FORM @ 1273#. RU SWAB TIH W/2 1/16" TBG. 5-22-02: PU HYDRILL TBG TO 3537 IN EAST STRING. HOT OIL TBG W/40 BBLS OIL. DISPL W/KCI WTR/RIG-DOWN.		
6-15-02: ON 24 HR OPT. PUMPED 34 BO, 96 BW, & 63 MCF.		
		JUL 9 200 2
14. I hereby certify that the foregoing is tolk and correct		
SIGNATURE Regulatory Specialist PETRO'S DATE 7/1/2002		
TYPE OR PRINT NAME J. Denise Leake		
(This space for Federal or State office use)		
APPROVED CONDITIONS OF APPROVAL, IF ANY:TITLEDATEDATE		
Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or		

2A Glopieta + Stinebry