

NEW MEXICO OIL CONSERVATION COMMISSION

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S		
LAND	FICE	
OPER	OR	

5a. Indicate Type of Lease  
State ☒ Free ☐

5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. Well <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER-	7. Unit Agreement Name
2. Name of Operator Sun Texas Company	8. Farm or Lease Name S.W. Eaton
3. Address of Operator P.O. Box 4067, Midland, Texas 79704	9. Well No. 11
4. Location of Well UNIT LETTER K 1650 FEET FROM THE South LINE AND 1750 FEET FROM THE West LINE, SECTION 12 TOWNSHIP 25-S RANGE 37-E N.M.P.M.	10. Field and Pool, as Well as Justis Blinebry & Justis Tubb-Drinkard
15. Elevation (Show whether DF, RT, GR, etc.) 3101' GR	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPER. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	
		OTHER DHC ADM, Order No. DHC-321 <input checked="" type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent data, including estimated date of completion) SEE RULE 1103.

Workover to remove dual equipment, stimulate & downhole commingle Justis Blinebry & Justis Tubb-Drinkard Zones.

- 12-2-80 MI & RU PU. Pulled 3/4" and 5/8" rods and pump Blinebry. Start fishing rods in Tubb-Drinkard zone. Unable to get thru paraffin. POH w/fishing tool.
- 12-3-80 Kill well. Install BOP. Unlatch anchor. POH and laid down 155 jts 2 1/16" tbg. Hot oil long string of tbg. Ran rods and overshot in long string.
- 12-4-80 Ran overshot on rods. Could not fish rods. POH w/rods and overshot. GIH w/rods and impression block. POH w/same. Shows tbg parted at approx 5175'. Start POH w/2 1/16" tbg long string.
- 12-5-80 Finish pulling tbg long string. Tbg parted 162 jts. from surface. Ran overshot. Caught fish. Ran rods and fishing tool to catch 5/8" body break. Failed to catch fish. POH w/rods.
- 12-6-80 GIH w/W.S. and overshot to fish 2 1/16" tbg. Ran impression block. Ran rods and fishing tool. Caught fish. POH w/33 5/8" rods and pump.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED R. J. O'Neal - 27

TITLE Reg. Opr. Supt

1-2-81

APPROVED BY [Signature]

TITLE [Signature]

CONDITIONS OF APPROVAL, IF ANY: