

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE
(Other, first and last, and
reverse side)

FOR APPROVAL
Budget Bureau No. 42 R1424
5. LEAD, DESIGNATION AND SERIAL NO.

LC 067968

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐		7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR HNG Oil Company		8. FARM OR LEASE NAME RAF "30"
3. ADDRESS OF OPERATOR P.O. Box 2267, Midland, Texas 79702		9. WELL NO. 1
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 405' FSL & 1650' FEL		10. FIELD AND POOL, OR WILDCAT Dollarhide (Devonian)
14. PERMIT NO.		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 30, T24S, R36E 38E.
15. ELEVATIONS (Show whether DF, BT, GR, etc.) 3129' GR		12. COUNTY OR PARISH Lea
		13. STATE New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF ☐	PULL OR ALTER CASING ☐	WATER SHUT-OFF ☐	REPAIRING WELL ☐
FRACTURE TREAT ☐	REPAIRING COMPLETE ☐	FRACTURE TREATMENT ☐	ALTERING CASING ☐
SHOOT OR ACIDIZE ☐	ABANDON* ☒	SHOOTING OR ACIDIZING ☐	ABANDONING* ☐
REPAIR WELL ☐	CHANGE PLANS ☐	Other ☐	
(Other) ☐		(No. 11 Report results of hydraulic completion. Well Completion or decompletion Report and Log form.)	

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *

See attached well bore schematic and the procedure for plugging.

SEE ATTACHED FOR
CONDITIONS OF APPROVAL

18. I hereby certify that the foregoing is true and correct


SIGNED M.C. Carile TITLE Completion Eng DATE 10-10-79

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

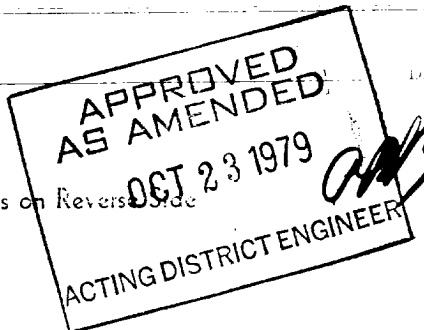

DATE: 10-10-79

RAF "30" #1
LEA COUNTY, NEW MEXICO
PLUGGING FOR ABANDONMENT

1. Move in WSU and handling tools
2. Rig up and pull 7550 of tubing and Guiberson uni VI packer set with 12,000 pound tension
3. Trip in hole with tubing and cement retainer to 7500 and set. Then squeeze Devonian perforation at 7622-23, 7698-7701 and 7766-69 with 100 sacks of Class "H" cement. Leave 1/2 to 1 barrel of slurry on top of retainer
4. Pull tubing to 4950, mix and spot 150 sacks of Class "H" cement in casing. This will be a 900 foot plug of which the top will be at 3600'
5. Pull tubing to 1200', mix and spot 50 sacks of Class "H" cement. Top of cement plug will be @ 750'
6. Pull tubing to 100 of surface mix and spot 15 sacks of Class "H" to surface
7. Cut starting head off and weld on plate and dry hole marker, clean location.

SUBMITTED BY: Mr. C. Paul