

PLUGGING PROCEDURE CONT.

3. Spot ^{220'}~~100'~~ cement plug from 12,040-12,140' across 7-3/4" liner top.
4. Spot ^{180'}~~100'~~ cement plug from 7950-8050' across DV tool.
5. Spot ^{150'}~~100'~~ cement plug from 4979-5079' across 13-3/8" casing shoe. WOC and tag plug.
6. Spot ^{140'}~~100'~~ cement plug from 3450-3550' across base of salt and another from 1100-1200' across top of salt.
7. Spot 100' cement plug from 365-465' across 20" casing shoe. WOC and tag plug.
8. Spot 10 sx plug at surface.
9. Install P&A marker and clear location.
10. Displace all cement plugs with mud.

RECEIVED

APR 27 1991

OFF
HOBBS