

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico, 87504-2088

RECEIVED

JUL 13 1989

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO CONSERVATION UNITS BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-30458
1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER <input type="checkbox"/>		5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
2. Name of Operator Meridian Oil Inc.		6. State Oil & Gas Lease No.
3. Address of Operator 21 Desta Drive Midland, Texas 79705		7. Lease Name or Unit Agreement Name Pitchfork "10"
4. Well Location Unit Letter <u>C</u> : <u>660</u> Feet From The <u>North</u> Line and <u>1980</u> Feet From The <u>West</u> Line Section <u>10</u> Township <u>25-S</u> Range <u>34-E</u> NMPM Lea County		8. Well No. 1
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3342' GR		9. Pool name or Wildcat Pitchfork Ranch (Morrow)

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: Run Coiled Tubing Unit ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

MIRU Cudd coiled tubing unit. Run 14700' of 1-1/4" QT (.087" wall) coiled tubing as follows:

1. Close wing valve and both master valves. ND tree to flow tee. Install bushing if necessary.
2. Install "hanger-tee" upon flow tee.
3. Install pump out plug in end of tubing.
4. Secure pack-off around tubing. (tubing is run through pack-off during entire job)
5. Nipple up injector and BOP's to Hanger-tee connection and run tubing to desired depth.
6. Utilize lockscrews to energize pack-off to seal annulus and O.D. tubing.
7. Knock loose 6" hammer union in window. Slide mandrel up and install slips.
8. Lower tubing while observing tubing weight and hang off tubing. Cut tbg in window.
9. Remove injector, pack-off, bop's and window; reinstall existing tree; expend pump out plug.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Connie Monahan TITLE Operations Tech III DATE 7/7/89

TYPE OR PRINT NAME Connie Monahan

TELEPHONE NO. 915/686-5600

(This space for State Use)

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

JUL 18 1989

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

JUL 17 1989

OCD
HOBBS OFFICE