

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☐ Oil Well ☐ Gas Well ☒ Other P&A WELL

2. Name of Operator

YATES PETROLEUM CORPORATION

3. Address and Telephone No.

105 South 4th St., Artesia, NM 88210 (505) 748-1471

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

Unit F, 2310' FNL, 1650' FWL, Sec. 14-T25S-R32E

5. Lease Designation and Serial No.

NM 15680

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Paduca AIU Federal #1

9. API Well No.

30-025-31177

10. Field and Pool, or Exploratory Area

Paduca Delaware

11. County or Parish, State

Lea County, NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other _____

- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Propose to plug and abandon well as follows:

1. POOH with tubing and packer; cut off 5½" casing at 3950' and pull.
2. TIH with tubing and spot 100' plug (35 sx "C" w/2% CaCl2) from 4697-4797'
3. WOC and tag plug.
4. TIH with tubing and spot casing stub plug (35 sx "C") from 3900-4000' (50' above & below casing cut-off point)
5. Set 15 sx surface plug at 50'. Set regulation abandonment marker and clean location.

Note: Use 9 p.p.g. mud-laden fluid between plugs.

NOTIFY BLM 24 HOURS IN ADVANCE OF PLUGGING.

14. I hereby certify that the foregoing is true and correct

Signed

[Signature]

Title Production Supervisor

Date 9-25-91

(This space for Federal or State office use)

Approved by

[Signature]

Title

[Signature]

Date 9/27/91

Conditions of approval, if any: