Submit 3 Copies

State of New Mexico

	Energy, Minerals and Natural Resources Department		Revised 1-1-89	
<u>DISTRICT I</u> P.O. Box 1980, Hobbs, NM 88240	OIL CONSERVATIO		WELL API NO.	
DISTRICT	P.O. Box 2088 UCLII Santa Fe, New Mexico 87504-2088		30-025-31758	
P.O. Drawer DD, Artesia, NM 88210 DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410 SUNDRY NOTICES AND REPORTS O		8/304-2088	5. Indicate Type of Lease	
			STATE FEE X 6. State Oil & Gas Lease No.	
		ON WELLS		
DIFFERENT RESE	OPOSALS TO DRILL OR TO DEEPEN RVOIR. USE "APPLICATION FOR PEI 1-101) FOR SUCH PROPOSALS.)	OR PLUG BACK TO A RMIT"	7. Lease Name or Unit Agreement Name	
Type of Well: OIL GAS WELL WELL	OTHER		Ida Wimberley	
Name of Operator			8. Well No.	
ARCO OIL AND GAS COMF Address of Operator	PANY	· · · · · · · · · · · · · · · · · · ·	18	
P. O. Box 1610, Midla	and, Texas 79702		9. Pool name or Wildcar Justis, tubb Drinkard	
Well Location Unit Letter : 1350	Feet From The South	Line and330	Feet From The West Line	
Section 25 74		nge 37E	NMPM Lea County	
	10. Elevation (Show whether a	DF, RKB, RT, GR, etc.)		
1. Check	Appropriate Box to Indicate I	Nature of Notice, R	eport, or Other Data	
NOTICE OF INT	TENTION TO:		SEQUENT REPORT OF:	
ERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WORK	ALTERING CASING	
MPORARILY ABANDON	CHANGE PLANS	COMMENCE DRILLING		
	CHANGE PLANS	COMMENCE DRILLING	G OPNS. PLUG AND ABANDONMENT	
ILL OR ALTER CASING	CHANGE PLANS		G OPNS. PLUG AND ABANDONMENT	
EMPORARILY ABANDON JLL OR ALTER CASING THER: 2. Describe Proposed or Completed Opera work) SEE RULE 1103.		CASING TEST AND CE	G OPNS. PLUG AND ABANDONMENT	
THER: 2 Describe Proposed or Completed Operawork) SEE RULE 1103. 1-25-92. Drilled 7 7/8 1-26-92. Spot LCM bills 1-27-92. Dry drill to 4 + 5# hi-seal.	hole f/3050-3985'. Lost w/no success. Dry dril 640'. Spot 70 bbls bora Unable to move DP after	CASING TEST AND CE OTHER: d give periment dates, include c circ at 3500'. led to 4600'. let X-L SBW gel.	EMENT JOB ding estimated date of starting any proposed	
THER: 2. Describe Proposed or Completed Operawork) SEE RULE 1103. -25-92. Drilled 7 7/8 -26-92. Spot LCM bills -27-92. Dry drill to 4 + 5# hi-seal. Cut off DP at -28-92. Attempt to loa -29-92. Screw into fis 50 sx "H" thix	hole f/3050-3985'. Lost w/no success. Dry dril 640'. Spot 70 bbls bora Unable to move DP after 2672' & POH. d hole w/no success. Teh at 2672'. Press to 18 otropic followed by 75	CASING TEST AND CE OTHER: d give periment dates. Incide c circ at 3500'. led to 4600'. led to 4600'. te X-L SBW gel. pumping. Free- emp surv indicat sx "C" w/2% CC	EMENT JOB PLUG AND ABANDONMENT X EMENT JOB ding estimated date of starting any proposed Spot 200 sx "C" cmt w/2% CC-pt indicates stuck pipe f/2770. te fluid loss f/900-930'. te 2672'. BO 4-1/2 DP at 2672. Sp. % 5# hi-seal WOC 4 hrs. Attemption	
HER: Describe Proposed or Completed Opera work) SEE RULE 1103. -25-92. Drilled 7 7/8 -26-92. Spot LCM pills -27-92. Dry drill to 4 + 5# hi-seal. Cut off DP at -28-92. Attempt to loa -29-92. Screw into fis 50 sx "H" thix to load hole w -30-92. Attempt to loa w/300 sx "H" t	hole f/3050-3985'. Lost w/no success. Dry dril 640'. Spot 70 bbls bora Unable to move DP after 2672' & POH. d hole w/no success. Teh at 2672'. Press to 18 otropic followed by 75 /no success. Spot 300 s d hole with no success. hixotropic w/3% CC + 10 r 15 min. Spot 100 sx C hole marker	casing TEST and CE OTHER: d give periment dates. Incide c circ at 3500'. led to 4600'. let X-L SBW gel. pumping. Free- emp surv indicat 800# tag fill at sx "C" w/2% CC x "H" thixotrop Verbal approva # gilsonite. No neat f/0-400'.	EMENT JOB Coppus. Plug and Abandonment X EMENT JOB Comparing any proposed Comparing any proposed	
THER: 2. Describe Proposed or Completed Operawork) SEE RULE 1103. -25-92. Drilled 7 7/8 -26-92. Spot LCM bills -27-92. Dry drill to 4 + 5# hi-seal. Cut off DP at -28-92. Attempt to loa -29-92. Screw into fis 50 sx "H" thix to load hole w -30-92. Attempt to loa w/300 sx "H" t sqz to 500# fo installed dry	hole f/3050-3985'. Lost w/no success. Dry dril 640'. Spot 70 bbls bora Unable to move DP after 2672' & POH. d hole w/no success. Teh at 2672'. Press to 18 otropic followed by 75/no success. Spot 300 s d hole with no success. hixotropic w/3% CC + 10 r 15 min. Spot 100 sx Chole marker. 12-1-91	casing TEST AND CE OTHER: d give periment dates. Included to 4600'. led to 4600'. te X-L SBW gel. pumping. Free- emp surv indicate S00# tag fill at sx "C" w/2% CC x "H" thixotrop Verbal approva # gilsonite. NO neat f/0-400'. RR. P&A'd 12-1	EMENT JOB Coppus. Plug and Abandonment X EMENT JOB Comparing any proposed Comparing any proposed	
THER: 2 Describe Proposed or Completed Operawork) SEE RULE 1103. 1-25-92. Drilled 7 7/8 1-26-92. Spot LCM oills 1-27-92. Dry drill to 4 + 5# hi-seal. Cut off DP at 1-28-92. Attempt to loa 1-28-92. Screw into fis 50 sx "H" thix to load hole w 1-30-92. Attempt to loa w/300 sx "H" t sqz to 500# fo installed dry	hole f/3050-3985'. Lost w/no success. Dry dril 640'. Spot 70 bbls bora Unable to move DP after 2672' & POH. d hole w/no success. Teh at 2672'. Press to 18 otropic followed by 75 /no success. Spot 300 s d hole with no success. hixotropic w/3% CC + 10 r 15 min. Spot 100 sx C hole marker. 12-1-9	casing TEST AND CE OTHER: d give periment dates. included to 4600'. Ited to 4600'. Ite X-L SBW gel. pumping. Free- emp surv indicate 800# tag fill at sx "C" w/2% CC x "H" thixotrop Verbal approva ## gilsonite. No ineat f/0-400'. RR. P&A'd 12-1	EMENT JOB Coppus. Plug and Abandonment X EMENT JOB Comparing any proposed Comparing any proposed	

CONDITIONS OF APPROVAL, IF ANY: