Form 3160-5 (June 1990)

UNITED STATES DEPARTMENT OF THE INTERIOR

| દુ 🖁 | 1 1450 |
|---------|-----------------------------|
| C pit H | FYORM APPROVED 88240 |
| | Budget Bureau No. 1004-0135 |
| | Expires: March 31, 1993 |

N.M. CI. CONS. COMMISSION

\$ 080 € \$ £080

5. Lease Designation and Serial No.

| DOILLIO OI | LAND MANAGEMENT | 5. Lease Designation and Serial No. |
|--|---|--|
| SUNDRY NOTICES AN | NM-0140977 | |
| Do not use this form for proposals to drill | 6. If Indian, Allottee or Tribe Name | |
| • • • | PERMIT - " for such proposals | |
| | 7. If Unit or CA, Agreement Designation | |
| SUBMIT | IN TRIPLICATE | |
| . Type of Well | | |
| X Oil Gas Well Other | | 8. Well Name and No. |
| 2. Name of Operator | SOUTH JUSTIS UNIT"C" #131 | |
| ARCO Permian | 9. API Well No. | |
| 3. Address and Telephone No. | 30-025-32322 10. Field and Pool, or exploratory Area | |
| P.O.BOX 1610, MIDLAND, TX 797 Location of Well (Footage, Sec., T., R., M., or Survey D | JUSTIS BLBRY-TUBB-DKRI | |
| 1655 FSL & 2200 FEL (UNIT LI | 11. County or Parish, State | |
| 11-25S-37E | criek oj | , |
| 11 230 372 | | LEA NM |
| CHECK APPROPRIATE BOY | s) TO INDICATE NATURE OF NOTICE, RE | |
| 2. CHECK APPROPRIATE BOX(S | | |
| TYPE OF SUBMISSION TYPE OF A | | CTION |
| Notice of Intent | Abandonment | Change of Plans |
| | Recompletion | New Construction |
| Subsequent Report | Plugging Back | Non-Routine Fracturing |
| | Casing Repair | Water Shut-Off |
| Final Abandonment Notice | Altering Casing | Conversion to Injection |
| | Other | Dispose Water |
| | | (Note: Report results of multiple completion on Well |
| give subsurface locations and measured and true ve | all pertinent details, and give pertinent dates, including estimated dertical depths for all markers and zones pertinent to this work.)* 3-95. RAN OH LOGS. RAN 5 1/2 15.5 | Completion or Recompletion Report and Log form.) ate of starting any proposed work. If well is directionally drill 5# CSG TO 6100. CMT'D W/900 SX |
| TD'D 7 7/8 HOLE @ 6100 ON 03-1. "C" + 3% T-LITE + 1% CC + 1/4# (YLD 2.22) FOLLOWED BY 300 SX (YLD 1.83). DID NOT CIRC CMT. 03-15-95. RAN TEMP SURV. TOC 1. 03-16-95. PERF B-T-D F/5595-60 PFRF B-T-D F/5114-550 | 3-95. RAN OH LOGS. RAN 5 1/2 15.5 CS(YLD 2.70) FOLLOWED BY 500 SX "C" +12# CSE + 1# WL-1P + .3% CF-RR 03-14-95. 575. 14. A W/1000 GALS. FRAC W/ 38,000 PBD. RIH W/ PROD CA: 2 3/8 TBG,RO | Completion or Recompletion Report and Log form.) ate of starting any proposed work. If well is directionally drill 5# CSG TO 6100. CMT'D W/900 SX SUPER C + .5% T-LITE + 1/4# CS -2 + 1/4# CS + 3# HI-SEAL O GALS & 126,000# SD. GALS & 126,000# SD. ODS & PUMP TO 5870. RDPU |
| give subsurface locations and measured and true volume in the second of | 3-95. RAN OH LOGS. RAN 5 1/2 15.5 CS(YLD 2.70) FOLLOWED BY 500 SX "C" +12# CSE + 1# WL-1P + .3% CF-RR 03-14-95. 575. 14. A W/1000 GALS. FRAC W/ 38,000 PBD. RIH W/ PROD CA: 2 3/8 TBG,RO | Completion or Recompletion Report and Log form.) ate of starting any proposed work. If well is directionally drill 5# CSG TO 6100. CMT'D W/900 SX SUPER C + .5% T-LITE + 1/4# CS -2 + 1/4# CS + 3# HI-SEAL O GALS & 126,000# SD. GALS & 126,000# SD. ODS & PUMP TO 5870. RDPU |
| TO'D 7 7/8 HOLE @ 6100 ON 03-1 C" + 3% T-LITE + 1% CC + 1/4# (YLD 2.22) FOLLOWED BY 300 SX (YLD 1.83). DID NOT CIRC CMT. 13-15-95. RAN TEMP SURV. TOC 1 13-16-95. PERF B-T-D F/5595-60 PERF B-T-D F/5114-550 03-20-95. RUPU. CO SD TO 6029 03-24-95. | 3-95. RAN OH LOGS. RAN 5 1/2 15.5 CS(YLD 2.70) FOLLOWED BY 500 SX "C" +12# CSE + 1# WL-1P + .3% CF-RR 03-14-95. 575. 14. A W/1000 GALS. FRAC W/ 38,000 PBD. RIH W/ PROD CA: 2 3/8 TBG,RO | Completion or Recompletion Report and Log form.) ate of starting any proposed work. If well is directionally drill 5# CSG TO 6100. CMT'D W/900 SX SUPER C + .5% T-LITE + 1/4# CS -2 + 1/4# CS + 3# HI-SEAL O GALS & 126,000# SD. GALS & 126,000# SD. ODS & PUMP TO 5870. RDPU |
| give subsurface locations and measured and true volume in the second of | 3-95. RAN OH LOGS. RAN 5 1/2 15.5 CS(YLD 2.70) FOLLOWED BY 500 SX "C" +12# CSE + 1# WL-1P + .3% CF-RR 03-14-95. 575. 14. A W/1000 GALS. FRAC W/ 38,000 PBD. RIH W/ PROD CA: 2 3/8 TBG,RO | Completion or Recompletion Report and Log form.) ate of starting any proposed work. If well is directionally drill 5# CSG TO 6100. CMT'D W/900 SX SUPER C + .5% T-LITE + 1/4# CS -2 + 1/4# CS + 3# HI-SEAL O GALS & 126,000# SD. GALS & 126,000# SD. ODS & PUMP TO 5870. RDPU |
| give subsurface locations and measured and true versus to the second of | 3-95. RAN OH LOGS. RAN 5 1/2 15.5 CS(YLD 2.70) FOLLOWED BY 500 SX "C" +12# CSE + 1# WL-1P + .3% CF-RR 03-14-95. 575. 14. A W/1000 GALS. FRAC W/ 38,000 PBD. RIH W/ PROD CA: 2 3/8 TBG,RO | Completion or Recompletion Report and Log form.) ate of starting any proposed work. If well is directionally drill S# CSG TO 6100. CMT'D W/900 SX SUPER C + .5% T-LITE + 1/4# CS -2 + 1/4# CS + 3# HI-SEAL O GALS & 126,000# SD. GALS & 126,000# SD. ODS & PUMP TO 5870. RDPU |
| TO'D 7 7/8 HOLE @ 6100 ON 03-1 C" + 3% T-LITE + 1% CC + 1/4# (YLD 2.22) FOLLOWED BY 300 SX (YLD 1.83). DID NOT CIRC CMT. 13-15-95. RAN TEMP SURV. TOC 1 13-16-95. PERF B-T-D F/5595-60 PERF B-T-D F/5114-550 03-20-95. RUPU. CO SD TO 6029 03-24-95. | 3-95. RAN OH LOGS. RAN 5 1/2 15.5 CS(YLD 2.70) FOLLOWED BY 500 SX "C" +12# CSE + 1# WL-1P + .3% CF-RR 03-14-95. 575. 14. A W/1000 GALS. FRAC W/ 38,000 PBD. RIH W/ PROD CA: 2 3/8 TBG,RO | Completion or Recompletion Report and Log form.) ate of starting any proposed work. If well is directionally drill 5# CSG TO 6100. CMT'D W/900 SX SUPER C + .5% T-LITE + 1/4# CS -2 + 1/4# CS + 3# HI-SEAL O GALS & 126,000# SD. GALS & 126,000# SD. ODS & PUMP TO 5870. RDPU |
| TO'D 7 7/8 HOLE @ 6100 ON 03-1 C" + 3% T-LITE + 1% CC + 1/4# YLD 2.22) FOLLOWED BY 300 SX YLD 1.83). DID NOT CIRC CMT. 13-15-95. RAN TEMP SURV. TOC 1 13-16-95. PERF B-T-D F/5595-60 PERF B-T-D F/5114-550 13-20-95. RUPU. CO SD TO 6029 03-24-95. 14-04-95. IN 24 HRS PUMPED 100 | 3-95. RAN OH LOGS. RAN 5 1/2 15.5 CS(YLD 2.70) FOLLOWED BY 500 SX "C" +12# CSE + 1# WL-1P + .3% CF-RR 03-14-95. 575. 14. A W/1000 GALS. FRAC W/ 38,000 PBD. RIH W/ PROD CA: 2 3/8 TBG,RO | Completion or Recompletion Report and Log form.) ate of starting any proposed work. If well is directionally drill 5# CSG TO 6100. CMT'D W/900 SX SUPER C + .5% T-LITE + 1/4# CS -2 + 1/4# CS + 3# HI-SEAL O GALS & 126,000# SD. GALS & 126,000# SD. ODS & PUMP TO 5870. RDPU |
| give subsurface locations and measured and true volume of the control of the cont | 3-95. RAN OH LOGS. RAN 5 1/2 15.5 CS(YLD 2.70) FOLLOWED BY 500 SX "C" +12# CSE + 1# WL-1P + .3% CF-RR 03-14-95. 575. 14. A W/1000 GALS. FRAC W/ 38,000 PBD. RIH W/ PROD CA: 2 3/8 TBG,RO | Completion or Recompletion Report and Log form.) ate of starting any proposed work. If well is directionally drill 5# CSG TO 6100. CMT'D W/900 SX SUPER C + .5% T-LITE + 1/4# CS -2 + 1/4# CS + 3# HI-SEAL O GALS & 126,000# SD. GALS & 126,000# SD. ODS & PUMP TO 5870. RDPU |
| give subsurface locations and measured and true verifice. TO'D 7 7/8 HOLE @ 6100 ON 03-1. TC" + 3% T-LITE + 1% CC + 1/4# (YLD 2.22) FOLLOWED BY 300 SX (YLD 1.83). DID NOT CIRC CMT. D3-15-95. RAN TEMP SURV. TOC 1. D3-16-95. PERF B-T-D F/5595-60 PERF B-T-D F/5114-550 D3-20-95. RUPU. CO SD TO 6029 03-24-95. D4-04-95. IN 24 HRS PUMPED 100 | 3-95. RAN OH LOGS. RAN 5 1/2 15.5 CS(YLD 2.70) FOLLOWED BY 500 SX "C" +12# CSE + 1# WL-1P + .3% CF- RR 03-14-95. 575. 14. A W/1000 GALS. FRAC W/ 38,000 7. A W/1000 GALS. FRAC W/ 38,000 PBD. RIH W/ PROD CA: 2 3/8 TBG,RO BO, 100 BW, 140 MCF. | Completion or Recompletion Report and Log form.) ate of starting any proposed work. If well is directionally drill S# CSG TO 6100. CMT'D W/900 SX SUPER C + .5% T-LITE + 1/4# CS -2 + 1/4# CS + 3# HI-SEAL O GALS & 126,000# SD. GALS & 126,000# SD. ODS & PUMP TO 5870. RDPU |
| give subsurface locations and measured and true verifice. TD'D 7 7/8 HOLE @ 6100 ON 03-1. TC" + 3% T-LITE + 1% CC + 1/4# (YLD 2.22) FOLLOWED BY 300 SX (YLD 1.83). DID NOT CIRC CMT. D3-15-95. RAN TEMP SURV. TOC 1. D3-16-95. PERF B-T-D F/5595-60 PERF B-T-D F/55114-550 D3-20-95. RUPU. CO SD TO 6029 03-24-95. D4-04-95. IN 24 HRS PUMPED 100 | 3-95. RAN OH LOGS. RAN 5 1/2 15.5 CS(YLD 2.70) FOLLOWED BY 500 SX "C" +12# CSE + 1# WL-1P + .3% CF- RR 03-14-95. 575. 14. A W/1000 GALS. FRAC W/ 38,000 7. A W/1000 GALS. FRAC W/ 38,000 PBD. RIH W/ PROD CA: 2 3/8 TBG,RO BO, 100 BW, 140 MCF. | Completion or Recompletion Report and Log form.) ate of starting any proposed work. If well is directionally drill 5# CSG TO 6100. CMT'D W/900 SX SUPER C + .5% T-LITE + 1/4# CS -2 + 1/4# CS + 3# HI-SEAL O GALS & 126,000# SD. GALS & 126,000# SD. ODS & PUMP TO 5870. RDPU Date O4=10+95 |
| give subsurface locations and measured and true verify to 7 7/8 HOLE @ 6100 ON 03-1. "C" + 3% T-LITE + 1% CC + 1/4# (YLD 2.22) FOLLOWED BY 300 SX (YLD 1.83). DID NOT CIRC CMT. 03-15-95. RAN TEMP SURV. TOC 1. 03-16-95. PERF B-T-D F/5595-60 PERF B-T-D F/55114-550. 03-20-95. RUPU. CO SD TO 6029 03-24-95. 04-04-95. IN 24 HRS PUMPED 100. 14. I hereby certify that the foregoing is true and correct Signed (This space for Federal or State office use) | 3-95. RAN OH LOGS. RAN 5 1/2 15.5 CS(YLD 2.70) FOLLOWED BY 500 SX "C" +12# CSE + 1# WL-1P + .3% CF- RR 03-14-95. 575. 14. A W/1000 GALS. FRAC W/ 38,000 7. A W/1000 GALS. FRAC W/ 38,000 PBD. RIH W/ PROD CA: 2 3/8 TBG,RO BO, 100 BW, 140 MCF. | Completion or Recompletion Report and Log form.) ate of starting any proposed work. If well is directionally drille 5# CSG TO 6100. CMT'D W/900 SX SUPER C + .5% T-LITE + 1/4# CS -2 + 1/4# CS + 3# HI-SEAL O GALS & 126,000# SD. GALS & 126,000# SD. ODS & PUMP TO 5870. RDPU |

