

Submit 3 copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30 025 32770
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil / Gas Lease No.	
7. Lease Name or Unit Agreement Name	WEST DOLLARHIDE DRINKARD UNIT
8. Well No.	149
9. Pool Name or Wildcat	DOLLARHIDE TUBB DRINKARD
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3126'-GL, 3141'-KB

SUNDRY NOTICES AND REPORTS ON WELL
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER

2. Name of Operator
TEXACO EXPLORATION & PRODUCTION INC.

3. Address of Operator
205 E. Bender, HOBBS, NM 88240

4. Well Location
Unit Letter M : 165 Feet From The SOUTH Line and 165 Feet From The WEST Line
Section 32 Township 24-S Range 38-E NMPM LEA COUNTY

10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3126'-GL, 3141'-KB

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: Acidize & Scale Squeeze ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting
any proposed work) SEE RULE 1103.

4-20-99: MIRU. BLED OFF WELL & UNSET PMP. UNSEAT TAC & NUBOP. TAG BTM @ 6500'. TIH W/SONIC HAMMER TOOP & 2 7/8" TBG.
4-21-99: WASH PERFS W/KCL WTR & ACIDIZE W/6000 GALS 15% NEFE HCL. RU SWAB. TIH W/TBG, TAC, SN, & MUD JT. TAC @ 5937'. SN @
6439'. TBG @ 6467'. SET TAC W/15 PTS TENSION. NDBOP & FLANGE UP WH.
4-22-99: TIH W/PMP, SNKR BARS & RDS. HANG ON & SPACE OUT. LOAD & TEST W/500 PSI. PLACE ON PP.
4-23-99: RIG DOWN.
4-26-99: MIRU. LONGSTROKE & COULD NOT GET TO PMP. DROP STANDING VALVE & HELD 500 PSI. TIH W/PMP.
4-27-99: NUBOP. TEST TBG IN HLE W/5000 PSI ABOVE SLIPS. NDBOP. & TIH W/TBG.
4-28-99: TIH W/PMP & RDS & PLACE ON PMP.
5-06-99: MIRU. HAD TROUBLE UNSEATING PMP. TIH W/PMP W/GAS ANCHOR, GAS SOLUTION TOOL & SHOCK TOOL. PLACE ON PMP.
5-07-99: WELL PMPNG. TEAR DOWN OF PUMP FOUND FILTER FULL OF SAND. RIG DOWN.
5-011-99: MIRU. UNSEAT PUMP. PUMP 20 BBLS DN CSG & INSTL BOP. PU 1 JT & TAG @ 6475'. PULL TBG & RAN BAILER. C/O TO 6500'.
5-12-99: TIH W/MUD JT, SN, TBG, TAC. SET TAC W/12 PTS & FLANGE UP WH. TIH W/PMP & RDS. SPACE OUT & HUNG ON. LOAD & TEST.
5-13-99: RIG DOWN.
5-18-99: WELL STILL NOT PMPNG. RU & CHECK PMP SPACING. RIG DOWN.
5-21-99: MIRU. BLED DN WELL & NUBOP. UNSET TAC.
5-22-99: NDBOP. SET TAC @ 5903'. SN @ 6373'. FLANGE UP WH & TIH W/BTM HOLDDOWN PMP W/GAS ANCHOR, SNKR BARS & RDS. LAND
PMP & SPACE OUT. LOAD & TEST & PLACE ON PMP. RIG DOWN.
5-30-99: ON 24 HR OPT. PMPD 66 BO, 188 BW, & 49 MCF.
FINAL REPORT

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Denise Leake TITLE Engineering Assistant DATE 6/8/99
TYPE OR PRINT NAME J. Denise Leake Telephone No. 397-0405

(This space for State Use) ORIGINAL SIGNED BY CHRIS WILLIAM

APPROVED BY DISTRICT I SUPERVISOR TITLE DATE JUL 03 1999

CONDITIONS OF APPROVAL, IF ANY: