

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.

30 025 32774

5. Indicate Type of Lease

STATE ☒

FEE ☐

6. State Oil / Gas Lease No.

7. Lease Name or Unit Agreement Name

WEST DOLLARHIDE DRINKARD UNIT

8. Well No.

148

9. Pool Name or Wildcat

DOLLARHIDE TUBB DRINKARD

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMI
(FORM C-101) FOR SUCH PROPOSALS.

1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. Name of Operator

TEXACO EXPLORATION & PRODUCTION INC.

3. Address of Operator

205 E. Bender, HOBBS, NM 88240

4. Well Location

Unit Letter I : 2530 Feet From The SOUTH Line and 1150 Feet From The EAST Line

Section 31 Township 24-S Range 38-E NMPM LEA COUNTY

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

3124'-GR, 3137'-KB

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☐

REMEDIAL WORK ☒

ALTERING CASING ☐

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

COMMENCE DRILLING OPERATION ☐

PLUG AND ABANDONMENT ☐

PULL OR ALTER CASING ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

OTHER: ☐

Acidize ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

10-06-00: MIRU. UNSEAT PUMP. NDWH. NUBOP.

10-09-00: TIH W/BIT, CSG SCRAPER & TBG & TAG @ 6495'. TIH W/PKR, & SN ON TBG. SET PKR @ 6286'. TEST BACKSIDE TO 500# W/67 BBLs 2% KCL WATER. ACIDIZE CSG PERFS IN TUBB/DRINKARD FORMATION W/6000 GALS 15% NEFE HCL.

10-10-00: RU SWAB. FL @ 3600'. END FL @ 4600'. PUMP 110 GALS TH-756 IN 20 BBLs 2% KCL WTR. PUMP 10 BBLs 2% KCL WATER W/5 GALS ALPHA 133. FLSH W/160 BBLs 2% KCL WTR.

10-11-00: TBG ON VAC. REL PKR. TIH W/RET TOOL ON TBG. TAG FILL @ 6480'. WASH SALT FILL 6480-98. C/O SCALE TO 6504'.

10-12-00: RU REV UNIT. TIH W/SHOE, WP ON TBG. BREAK CIRC W/100 BBLs 2% KCL WTR. C/O SCALE & JUNK IRON FR 6504-06.

10-13-00: TIH W/SHOE, WP, TBG. TAG @ 6506'. TIH W/OVERSHOT W/GRAPPLE. LATCH & REL RBP @ 6506'.

10-16-00: TIH W/BIT, DC'S ON TBG. TAG @ 6630'. C/O SAND & SCALE TO PBTD.

10-17-00: TIH W/SMA W/PURGE VALVE, SN, TBG, TAC. TBG @ 6748'. SN @ 6706'. TAC @ 6302'. NDBOP. NUWH. TIH W/GAS ANCHOR, PUMP & RDS.

10-18-00: LOAD & TEST TBG TO 500#-OK. PUMPING @ 2:30 PM. RIG DOWN.

10-25-00: ON 24 HR OPT. PUMPING 32 BO, 119 BW, & 32 MCF.

FINAL REPORT

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

J. Denise Leake

TITLE

Engineering Assistant

DATE 11/2/00

TYPE OR PRINT NAME

J. Denise Leake

Telephone No. 397-0405

(This space for State Use)

APPROVED

CONDITIONS OF APPROVAL, IF ANY

TITLE

DATE