

RECEIVED
JUL 27 10 40 AM '92

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

5. Lease Designation and Serial No.

NML CO 32618 A

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

I.B. 099 A #1

9. API Well No.

30025097000051

10. Field and Pool, or Exploratory Area

JALMAT T-Y-SR

11. County or Parish, State

Lee County
NEW MEXICO

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

CONVEST ENERGY CORP.

3. Address and Telephone No.

2401 Fountain View Suite 700, Houston, TX 77057

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1980' FNL E. 1980' FEL, Sec. 35, T24S-R36E
Unit G

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other

☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

- 1) Notify BLM @ (505) 393-3612
- 2) MI E RU. Log. Pool. w/ production eqmt. LD ALL except tubing
- 3) Gilt + set CIBP @ 3370. Spot 50' cement plug on top BP.
- 4) Displace hole w/ 9.0 ppg mud.
- 5) Perf 7" csg @ 2931. Spot 100' plug inside + outside csg. TAG PLUG.
- 6) Perf 9 5/8" csg @ 964'. Spot 100' plug inside + outside all csgs. TAG PLUG.
- 7) Set 100' plug in all csgs @ Surface.
- 8) Cut off csgs. 4' below ground. Weld on plate + ID. MARKER.
- 9) Level & RESTORE location.

CEMENT SLURRY USED IN THIS PROCEDURE SHALL BE CLASS "C" WITH
2 % C.C12 MIXED AT 14.8 PPG.

14. I hereby certify that the foregoing is true and correct

Signed E. J. Steinhilber

Title Agent

Date 7/20/92

(This space for Federal or State office use)

Approved by Adam S. Canale

Title

Date 8/10/92

Conditions of approval, if any: