

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

RECEIVED

FEB 6 3 34 PM '92

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.

5. Lease Designation and Serial No.

NMLCO 32618A

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

I. B. Ogg A #4

9. API Well No.

30025097000051

10. Field and Pool, or Exploratory Area

JALMAT T-Y-SR

11. County or Parish, State

LEA COUNTY
NEW MEXICO

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

CONVEST ENERGY CORPORATION

3. Address and Telephone No.

2401 FOUNTAIN VIEW DR., Suite 700, HOUSTON, TX 77057

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

Unit G
1980' FNL & 1980' FEL, Sec. 35, T24S-R36E

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other _____
☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

- 1) Notify BLM, PRIOR TO ANY WORK, @ (505) 393-3612
- 2) MI & RU Rig. POOH w/ production Eq. + LD ALL EXCEPT tubing.
- 3) GIH & Set CIBP @ 3370'. Spot 35' cement on BP w/baler.
- 4) Circ Rule w/ 9.0 ppg mud.
- 5) Cut 7" Csg @ 2931 + Pull same.
- 6) Set cement plug from 2931-2831 in 9 5/8" csg. TAG PLUG.
- 7) Cut and pull 9 5/8" csg @ 964'.
- 8) Set cement plug from 964'-864' in 12 1/2" csg. TAG PLUG.
- 9) Set cement plug from 100' to surface.
- 10) Cut off casing's 4' below ground level, weld on well marker and IO sign.
- 11) Level + Restore location.

14. I hereby certify that the foregoing is true and correct

Signed E. L. Hendrick

Title Agent

Date 2-4-92

(This space for Federal or State office use)


Approved by _____

Title _____

Date 2/23/92

Conditions of approval, if any:

Well: I.B. Ogg A #1
TD.: 3523'
Elevation: 3278'

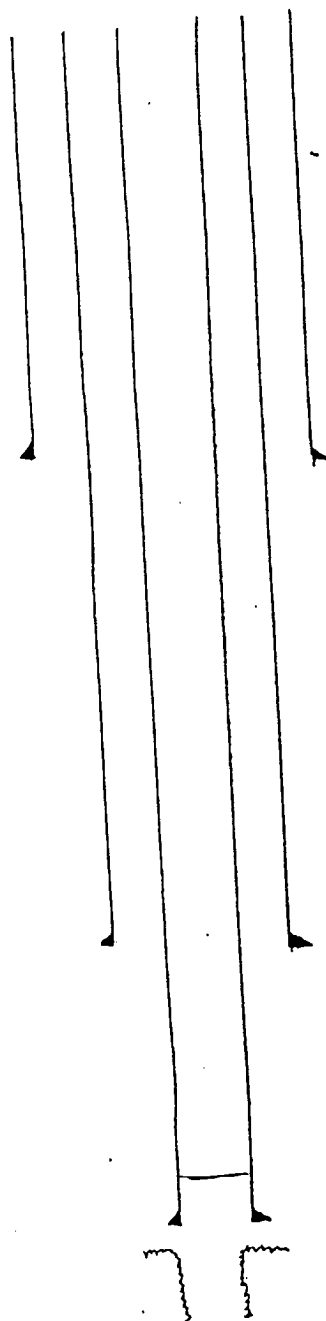

12 1/2", 50# set at 914'
set with 250 sx

9 OD ", 34# set at 2881'
set w/500 sx

7 OD ", 34# set at 3399'
set w/ 150 sx

Open Hole Completion

TD. 3523'