

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION
P. O. BOX 2080
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 79-1

5a. Indicate Type of Lease
State ☐ Fee ☒
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR TO GO BACK TO A DIFFERENT RESERVOIR.
USE APPLICATION FOR PERMIT TO DRILL (FORM C-101) FOR SUCH PROPOSALS.

1. OIL WELL ☐ GAS WELL ☐ OTHER: <u>water injection</u>	7. Unit Agreement Name <u>Myers Langlie McHix Unit</u>
2. Name of Operator <u>Texaco Producing Inc.</u>	8. Form or Lease Name
3. Address of Operator <u>PO Box 728 Hobbs, New Mexico 88240</u>	9. Well No. <u>228</u>
4. Location of Well UNIT LETTER <u>K</u> <u>1980</u> FEET FROM THE <u>South</u> LINE AND <u>1980</u> FEET FROM THE <u>West</u> LINE, SECTION <u>10</u> TOWNSHIP <u>24S</u> RANGE <u>37E</u> N.M.P.M.	10. Field and Pool, or Whichever <u>Langlie McHix Str</u>
11. Elevation (Show whether D.F., R.T., C.R., etc.) <u>3259 D.F.</u>	12. County <u>Lea</u>

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐

PLUG AND ABANDON ☒
CHANGE PLANS ☐
OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐
COMMENCE DRILLING OPER. ☐
CASING TEST AND CEMENT JOB ☐
OTHER ☐

ALTERING CASING
PLUG AND ABANDONMENT

13. Describe Briefly or Completely Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work; SEE RULE 1103.)

1. Rig up pulling unit and install BOP.
2. TTH with workstring and cement retainer to 3275' and set retainer.
3. Squeeze open hole 3350'-3599' and 5 1/2" casing 3275'-3350' with 100 sacks of class C cement (15.6 ppg, 1.2 cuft/gal)
4. String out of retainer and dump 30' of cement on top of retainer.
5. Circulate wellbore with 9.5 ppg mud.
6. Pull tubing to 1200' and set a 100' cement plug from 1100'-1200' (class H, 15.6 ppg, 1.2 cuft/gal)
7. Pull up and spot a 100' cement plug from 239'-339' (across 9 5/8" casing shoe)
8. Pull up and spot a 10' cement plug at the surface.
9. Install a dry hole marker. Plug and Abandon.

14. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED JL Johnson

TITLE Area Supt.

DATE 2-12-87

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

APPROVED BY

TITLE

DATE

FEB 16 1987