

South Mattix Unit Federal #6
Unit L, 1980' FSL & 660' FWL, Section 15, T-24-S, R-37-E
Lea County, New Mexico

December 2, 1996

Upper Yeso Formation
Proposed Temporary Abandonment Procedure

1. Notify the BLM 24 hours before moving onto lease
2. Hold a pre-job safety meeting with all personnel on lease. Ensure that all personnel on lease are aware of job procedures and egress routes.
3. Note and record tubing and casing pressures.
4. MIRU Service Rig.
5. Ensure well is dead, **if necessary** kill well with clean filtered 2 % KCL water.
6. POOH and lay down rods and bottomhole pump.
7. POOH with tubing.
8. RIH with a CIBP and set at 5130', dump 35' of cement on top of CIBP.
9. Circulate well over to corrosion inhibited (add 0.5 % corrosion inhibitor to the water) water.
10. Pressure test casing to 500 psi for 30 minutes w/chart recorder.