

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	
B-3421	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. <input type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER-		7. Unit Agreement Name
2. Name of Operator Gulf Oil Corporation		8. Farm or Lease Name J. R. Holt (NCT-A)
3. Address of Operator P. O. Box 670, Hobbs, NM 88240		9. Well No. 2
4. Location of Well UNIT LETTER <u>N</u> , <u>660</u> FEET FROM THE <u>South</u> LINE AND <u>1980</u> FEET FROM THE <u>West</u> LINE, SECTION <u>16</u> TOWNSHIP <u>24S</u> RANGE <u>37E</u> NMPM.		10. Field and Pool, or Wildcat Jalmat Langlie Mattix
15. Elevation (Show whether DF, RT, GR, etc.) 2245' GL		12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

POH with tubing. Set CIBP at 2945', cap with 35' cement. Set CIBP at 2625', cap with 35' cement. Circulate hole with abandonment mud. Test casing 500#. Perf 1190' with (4) 1/2" 90° phase. Establish circulation. Set cement retainer at 1145', pressure to 500#; test tubing 2000#. Pump 200 sacks Class "C" neat. Spot 35' cement on top of cement retainer and reverse out with abandonment mud. Temperature survey top of cement 430'. Spot 100' plug at 300'. Spot 60' plug at surface. Install dry hole marker. Inspected by Otto Wink. Cut PU anchors. Clear and clean location. P&A 10-7-82.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED R.D.P. Itz TITLE Area Engineer DATE 10-15-82
APPROVED BY L.F. Turracliff TITLE OIL & GAS INSPECTOR DATE NOV 08 1991
CONDITIONS OF APPROVAL, IF ANY:

RECEIVED
OCT 18 1982
O.C.D.
HOSBS OFFICE