Submit 3 Copies To Appropriate District	State of New Mexico	Form C-103
Office District I	Energy, Minerals and Natural Resources	June 19, 2008
1625 N. French Dr., Hobbs, NM 88240		WELL API NO.
<u>District II</u> 1301 W. Grand Ave., Artesia, NM 88210	OIL CONSERVATION DIVISION	30-045-08442 5. Indicate Type of Lease
District III	1220 South St. Francis Dr.	STATE FEE
1000 Rio Brazos Rd., Aztec, NM 87410 District IV	Santa Fe, NM 87505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505		
	TICES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		Claude Smith
1. Type of Well: Oil Well Gas Well Other		8. Well Number #1
2. Name of Operator Edwin Smith, LLC		9. OGRID Number
3. Address of Operator		10. Pool name or Wildcat
40758 Jasper Drive Kingsburg, CA, 93631 Phone: 559-250-5443		Fulcher Kutz Pictured Cliffs
4. Well Location		
	feet from the South line and 790 feet from the	West_line
Section 8 Township 29N Range 11W NMPM San Juan County		
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 5320' GL		
The strains of the second substitution of the second secon		OKAT
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data		
NOTICE	E OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK	PLUG AND ABANDON X	REMEDIAL WORK
TEMPORARILY ABANDON		COMMENCE DRILLING OPNS.
PULL OR ALTER CASING DOWNHOLE COMMINGLE	MULTIPLE COMPL U	CASING/CEMENT JOB
DOWN TOLL COMMINGEL		
OTHER:		OTHER:
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.		
Propose to plug and abai	ndoned the well as per the attached procedure.	
OIL CONS. DIV DIST. 3		
A closed loop system will be used for waste fluid handling.		
# If the charted 200ps; test passes, pressure test the casing MAY 122017 to 500psi.		
Spud Date: April 24, 1965		NMOCD 24 hrs
, , , , , , , , , , , , , , , , , , ,	prior prior	to beginning perations
I hereby certify that the information	above is true and complete to the best of my knowled	ge and belief.
/)/	1 -1 1	
SIGNATURE MANS	TITLE Agent	DATE May 12, 2017
Type or print nameCharles NeeleyE-mail address: neelece@msn.comPHONE:505-486-0211 For State Use Only		
APPROVED BY: Conditions of Approval (if any):	MITTE T & & Supervisor	DATE 5/15/17

R

PLUG & ABANDONMENT PROCEDURE

Claude Smith #1

3/27/17

Pictured Cliffs
790' FSL and 790' FWL, Section 8, T-29-N, R-11-W
San Juan County, New Mexico, API 30-045-08442
Lat: 36 / Long: 108_

Note: All cement volumes use 100% excess outside pipe and 50' excess inside. The stabilizing wellbore fluid will be 8.3 ppg, sufficient to balance all exposed formation pressures. All cement will be Class B, mixed at 15.6 ppg with a 1.18 cf/sx yield.


- Notify and comply with all NMOCD and operator safety regulations. MOL and RU daylight pulling unit. Conduct safety meeting for all personnel on location. Record casing, tubing and bradenhead pressures. NU relief line and blow down well. Kill well with water as necessary. ND wellhead and NU BOP. Function test BOP.
- 2. LD 1-¼" tubing on float. Prepare a 2.375" tubing workstring and round trip string mill to 1827' or as deep as possible. TIH and set a 4.5" CR at 1827'; release from CR. Circulate the 4.5" casing with water. Shut in casing valve, slowly work pressure up to 200 PSI; chart if holds.
- 3. TOH with 2.375" tubing. Run CBL from 1827' to surface; note TOC; send log to NMOCD office.
- 4. Plug #1 (Pictured Cliffs perforations, 1827' to 1727'): TIH to 4.5" CR at 1827'. Mix and pump 12 sxs Class B cement above CR to isolate the Pictured Cliffs perforations. TOH and WOC. TIH and tag TOC; re-set plug if necessary. TOH with tubing.
- 5. Plug #2 (Fruitland top, 1626' to 1526'): This plug may be modified by the CBL results. Perforate 3 HSC holes at 1626'. Establish a rate into the squeeze holes. Set 4.5" CR at 1575'. Mix and pump 36 sxs class B cement, squeeze 24 sxs outside the casing and leave 12 sxs inside casing. TOH with tubing. If casing tested OK above CR, then no WOC and tag.
- 6. Plug #3 (Kirtland and Ojo Alamo tops, 751' to 481'): Perforate 3 HSC holes at 751'. Establish a rate into the squeeze holes. Set a 4.5" CR at 701'. Mix and pump 87 sxs Class B cement, squeeze 63 sxs outside the casing and leave 24 sxs inside casing. TOH with tubing. If casing tested OK above CR, then no WOC and tag.
- 7. Plug #4 (Surface plug, 125' to Surface): Perforate 3 HSC holes at 125'. Pump down casing to establish circulation out Bradenhead. Mix and pump approximately 32 sxs class B cement, squeeze 22 sxs outside and 10 sxs inside with good cement to surface. SI well and WOC.
- 8. ND BOP and cut off wellhead below surface casing flange. Install P&A marker with cement to comply with regulations. Record GPS coordinate for P&A marker on tower report. Photograph P&A marker in place. Cut off anchors and clean up location. Restore location per NMOCD stipulations.

Claude Smith # 1

Current

Pictured Cliffs

790' FSL & 790' FWL, Section 8, T-29-N, R-11-W, San Juan County, NM Lat: 36°73519 / Long: 108°02122 / API #30-045-08442

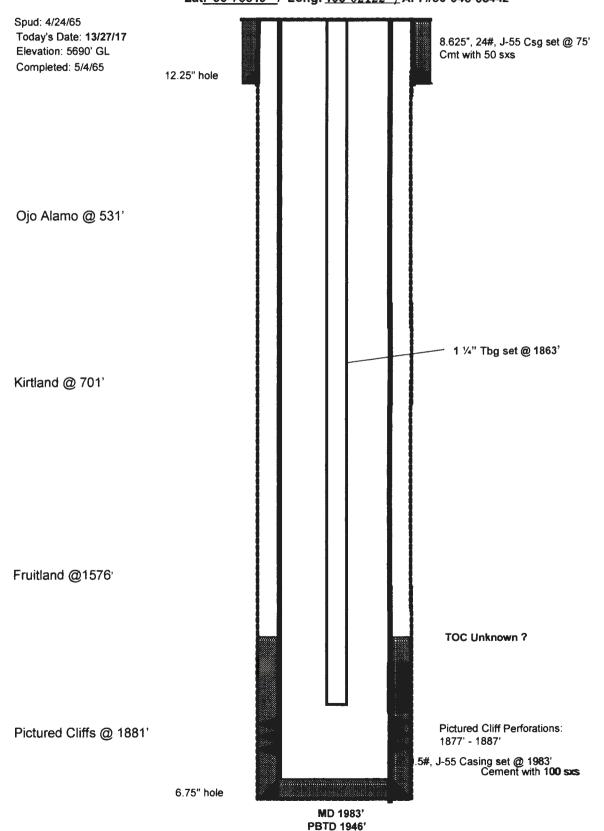

Claude Smith # 1 Proposed P&A

Basin Fruitland Coal

790' FSL & 790' FWL, Section 8, T-29-N, R-11-W, San Juan County, NM Lat: 36°73519 / Long: 108°02122 / API #30-045-08442

