

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

RECEIVED

SEP 17 2015

FORM APPROVED
OMB No. 1004-0137
Expires: March 31, 2007

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

SUBMIT IN TRIPLICATE - Other instructions on page 2.

1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other

OIL CONS. DIV DIST. 3

2. Name of Operator
WPX ENERGY, LLC

3a. Address
PO Box 640 Aztec, NM 87410

3b. Phone No. (include area code)
505-634-4206

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)
Sur: 1838' FSL & 1431' FEL, BHL: 1139' FNL & 315' FEL, sec 30, T31N, R4W

5. Lease Serial No.

6. If Indian, Allottee or Tribe Name

7. If Unit of CA/Agreement, Name and/or No.

Rosa Unit

8. Well Name and No.

Rosa Unit #63A

9. API Well No.
30-039-29776

10. Field and Pool or Exploratory Area
Basin Fruitland Coal

11. Country or Parish, State
Rio Arriba

12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input type="checkbox"/> Other
	<input type="checkbox"/> Change Plans	<input checked="" type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.)

This well is on USFS Surface

Notify NMOCD 24 hrs
prior to beginning
operations

WPX Energy would like to plug and abandon the Rosa Unit #63A per the attached procedure. In addition to the P&A procedure please find a schematic representing the current and proposed well bore.

BLM'S APPROVAL OR ACCEPTANCE OF THIS ACTION DOES NOT RELIEVE THE LESSEE AND OPERATOR FROM OBTAINING ANY OTHER AUTHORIZATION REQUIRED FOR OPERATIONS ON FEDERAL AND INDIAN LANDS

**SEE ATTACHED FOR
CONDITIONS OF APPROVAL**

14. I hereby certify that the foregoing is true and correct.

Name (Printed/Typed)

Lacey Granillo

Title Permit Tech III

Signature

Date 9/17/15

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

Title PE

Date 10/1/15

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office FFO

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

NMOCD

PLUG AND ABANDONMENT PROCEDURE

August 28, 2015

Rosa Unit #063A

Fruitland Coal

1838' FSL & 1431' FEL, Section 30, T31N, R4W
Rio Arriba County, New Mexico / API 30-039-29776

Lat: N _____ / Lat: W _____

Note: All cement volumes use 100% excess outside pipe and 50' excess inside. The stabilizing wellbore fluid will be 8.3 ppg, sufficient to balance all exposed formation pressures. All cement will be Class B, mixed at 15.6 ppg with a 1.18 cf/sx yield.

1. Install and test location rig anchors. Comply with all NMOCD, BLM, and Operator safety regulations. MOL and RU daylight pulling unit. Conduct safety meeting for all personnel on location. Record casing, tubing and bradenhead pressures. NU relief line and blow down well. Kill well with water as necessary and at least pump tubing capacity of water down the tubing. ND wellhead and NU BOP. Function test BOP.
2. Rods: Yes X , No , Unknown .
Tubing: Yes X , No , Unknown , Size 2-7/8 , Length 3498' .
Packer: Yes , No , Unknown , Type .
If this well has rods or a packer, then modify the work sequence in step #2 as appropriate.

TOH and LD 2-7/8" tubing. PU workstring.

Round trip 7" gauge ring or mill to 3248' or as deep as possible.

3. **Plug #1 (Fruitland Coal Interval and Fruitland top and liner top, 3248' – 3148'): NOTE: this is an underbalanced plug.**
RIH and set 7" CR at 3248'. Circulate well clean. Mix 40 sxs Class B cement (excess cement due to underbalanced plug) inside casing from 3248' to isolate the Fruitland Coal interval and Fruitland top. PUH and WOC due to window cut for directional kickoff. TIH and tag 50' above top of Fruitland. If necessary spot additional cement. TOH.
4. **Plug #2 (Window cut and Kirtland, Ojo Alamo interval, 2866' - 2766'):** RIH and set 7" CR at 2866'. ***Attempt to pressure casing. If casing does not test, then spot or tag subsequent plugs as appropriate.*** Mix and pump 29 sxs Class B cement and spot a balanced plug inside casing to cover the window cut and isolate the Kirtland and Ojo Alamo tops. PUH.
5. **Plug #3 (Nacimiento top, 1567'- 1467'):** Mix and pump 29 sxs Class B cement and spot a balanced plug inside casing to cover the Nacimiento top. PUH.

6. **Plug #4 (9-5/8" casing shoe and surface, 387' - Surface):** Attempt to pressure test the bradenhead annulus to 300 PSI; note the volume to load. If the BH annulus holds pressure, then establish circulation out casing valve with water. Mix approximately 80 sxs cement and spot a balanced plug from 387' to surface, circulate good cement out casing valve. TOH and LD tubing. Shut well in and WOC. If the BH annulus does not test, then perforate at the appropriate depth and attempt to circulate cement to surface filling the casings to surface. Shut in well and WOC.
7. ND BOP and cut off wellhead below surface casing flange. Install P&A marker with cement to comply with regulations. Record GPS coordinate for P&A marker on tower report. Photograph P&A marker in place. Cut off anchors and clean up location. Restore location per BLM stipulations.

Location:
SHL: 1838' FSL
& 1431' FEL
NW/4 SE/4 Sec
30(J), T31N,
R04W

BHL: 1139'
FNL & 315' FEL
NE/4 NE/4 Sec
30 (A), T31N, R-
04W
Rio Arriba, New
Mexico


Elevation: 6543'
GR
API # 30-039-
29776

ROSA UNIT #063A Horizontal ReEntry BASIN FRUITLAND COAL

Spud: 06/19/06
Completed: 08/18/06
1st Delivered: 08/24/06
Cavitated: 10/30/06
ReCavitate: 05/22/07
Reentry Complete: 10/23/11

Pumping Unit
Lufkin C-80DB-48RO-14

Top	MD Depth	TVD Depth
Ojo Alamo	2830'	2790'
Kirtland	2941'	2900'
Fruitland	3197'	3155'
Base of Coal	3437'	3390'

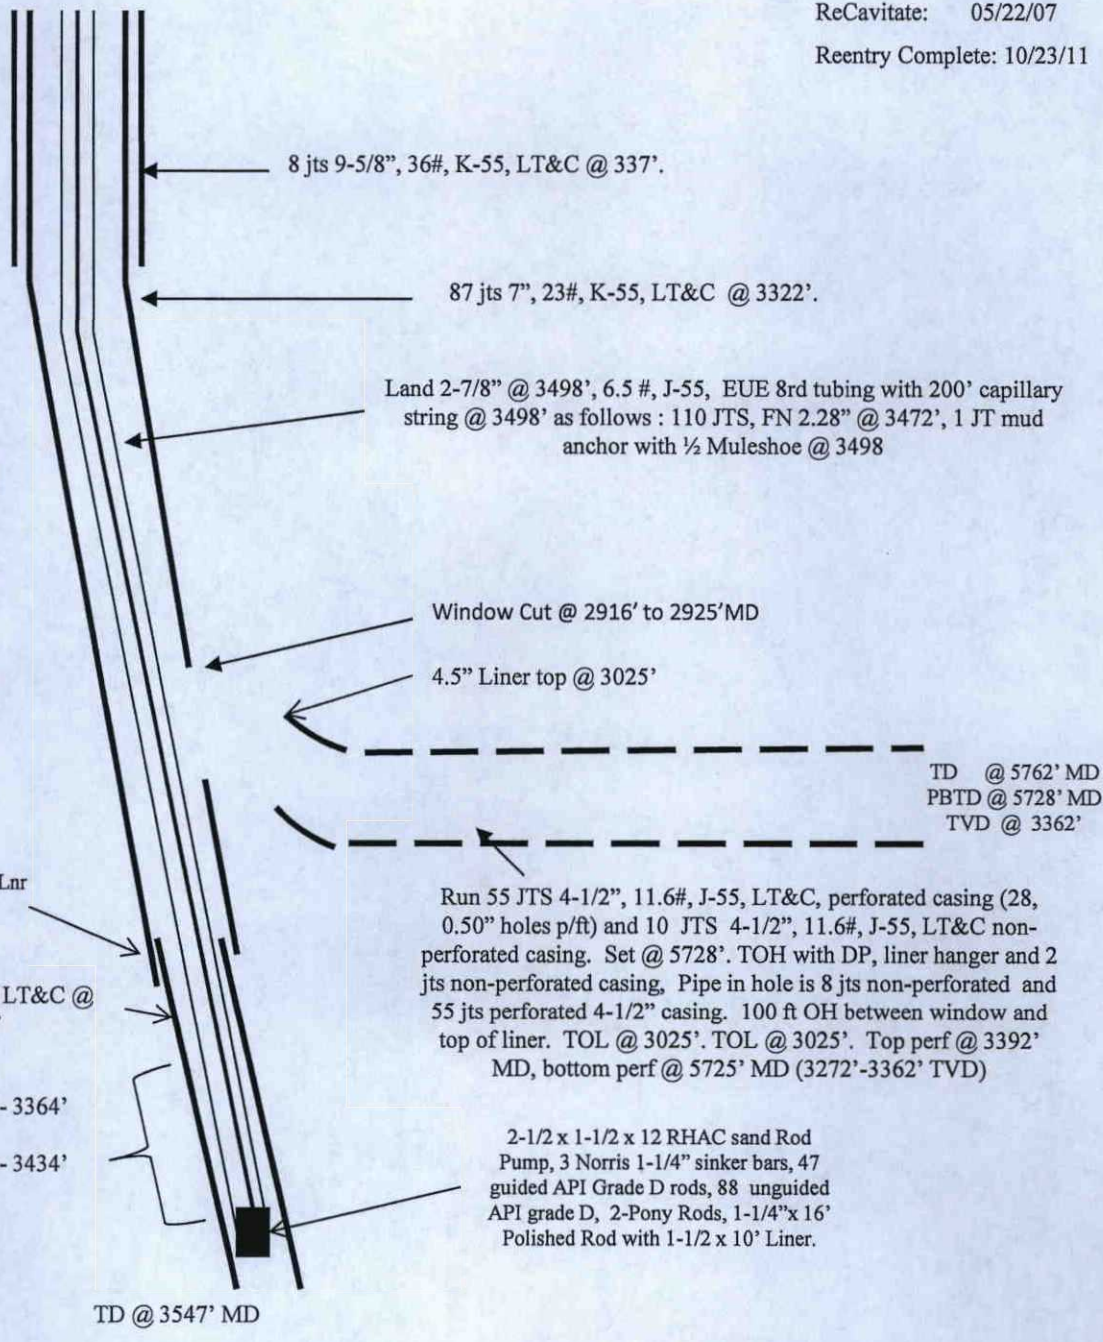

Hole Size	Casing	Cement	Volume	Top of Cmt
12-1/4"	9-5/8", 36#	190 sxs	224 cu. Ft.	Surface
8-3/4"	7", 23#	506 sxs	1125 cu. Ft.	Surface
6-1/4"	5-1/2", 17#	DID NOT CMT		
6-1/4"	4-1/2", 11.6#	DID NOT CMT		

LH 10/28/11

Location:
 SHL: 1838' FSL
 & 1431' FEL
 NW/4 SE/4 Sec
 30(J), T31N,
 R04W

BHL: 1139'
 FNL & 315' FEL
 NE/4 NE/4 Sec
 30 (A), T31N, R-
 04W
 Rio Arriba, New
 Mexico


Elevation: 6543'
 GR
 API # 30-039-
 29776

ROSA UNIT #063A – Proposed P&A Horizontal ReEntry BASIN FRUITLAND COAL

Spud: 06/19/06
 Completed: 08/18/06
 1st Delivered: 08/24/06
 Cavitated: 10/30/06
 ReCavitate: 05/22/07
 Reentry Complete: 10/23/11

Pumping Unit
 Lufkin C-80DB-48RO-14

Top	MD Depth	TVD Depth
Nacimiento	1517' *est	
Ojo Alamo	2830'	2790'
Kirtland	2941'	2900'
Fruitland	3197'	3155'
Base of Coal	3437'	3390'

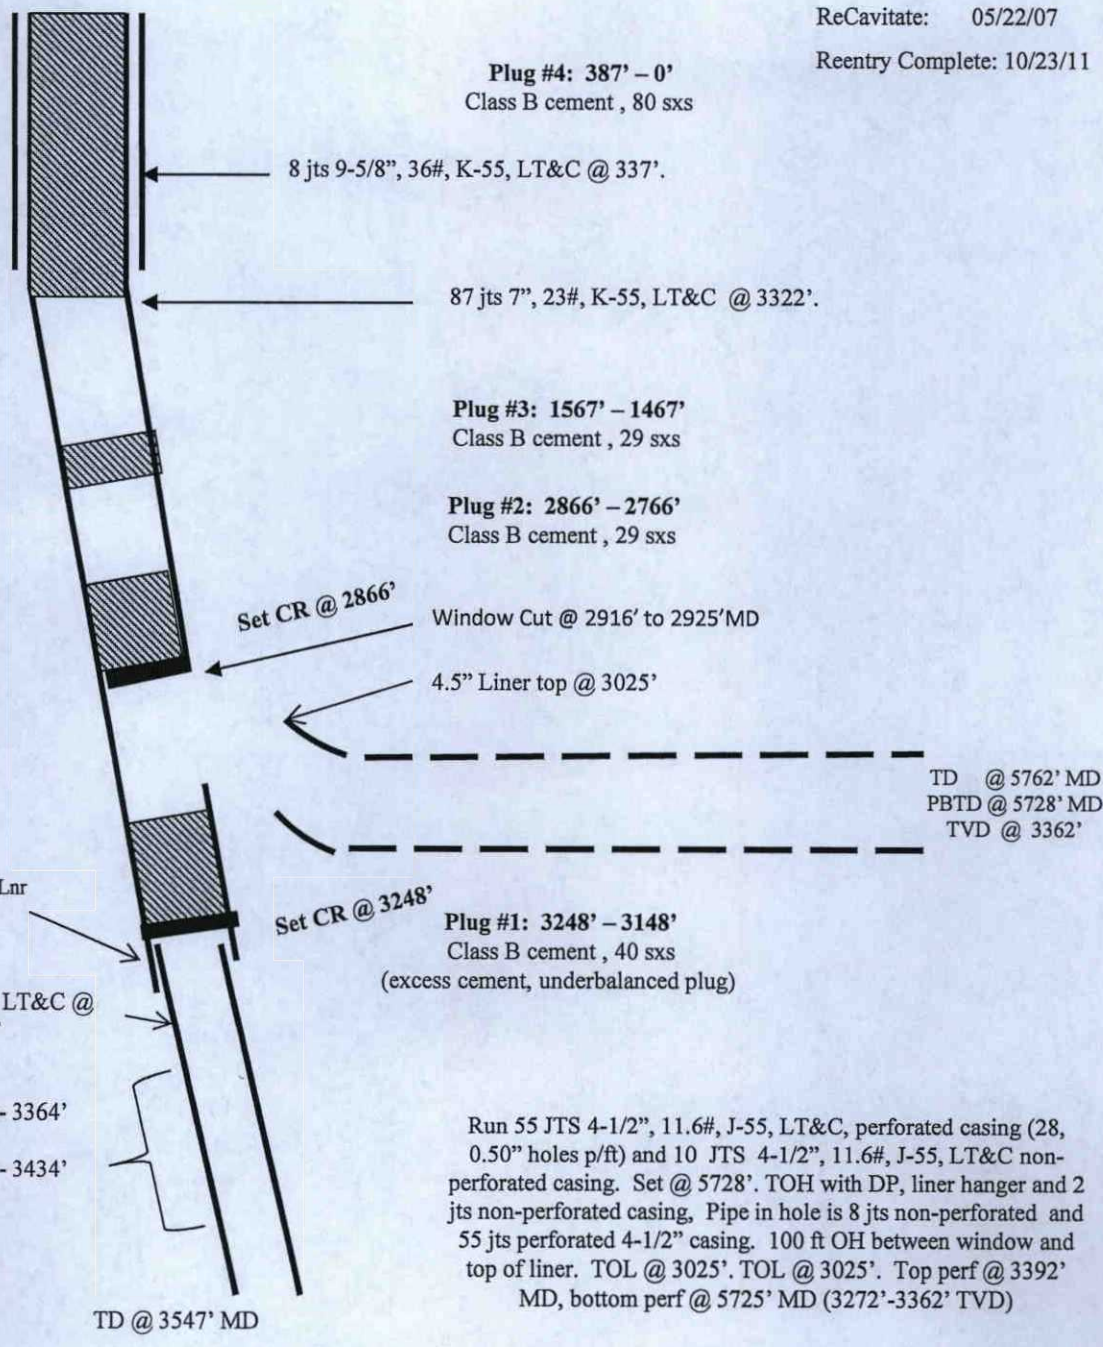

Hole Size	Casing	Cement	Volume	Top of Cmt
12-1/4"	9-5/8", 36#	190 sxs	224 cu. Ft.	Surface
8-3/4"	7", 23#	506 sxs	1125 cu. Ft.	Surface
6-1/4"	5-1/2", 17#	DID NOT CMT		
6-1/4"	4-1/2", 11.6#	DID NOT CMT		

LH 10/28/11

UNITED STATES DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
FARMINGTON DISTRICT OFFICE
6251 COLLEGE BLVD.
FARMINGTON, NEW MEXICO 87402

Attachment to notice of
Intention to Abandon:

Re: Permanent Abandonment
Well: Rosa Unit #63A

CONDITIONS OF APPROVAL

1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."

2. Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 564-7750.

3. The following modifications to your plugging program are to be made:

- a) Set plug #1 (3272-3172) ft. to cover the Fruitland top. BLM picks top of Fruitland at 3222 ft.
- b) Set plug #3 (1577-1477) ft. to cover the Nacimiento top. BLM picks top of Nacimiento at 1527 ft.

H2S has not been reported at this location, however, operator reports very high concentrations of H2S (approx. 8,000 ppm GSV) at the RU #383 well in the SESE/4 Sec. 29, 31N, 4W. It is imperative that H2S monitoring and safety equipment be on location during P&A operations at this well site.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.