Form 3160-5 (August 2007) UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals. SUBMIT IN TRIPLICATE - Other instructions on reverse side.					FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010 5. Lease Serial No. NMSF077386 6. If Indian, Allottee or Tribe Name 7. If Unit or CA/Agreement, Name and/or No. 14080016737		
				1 0 1			
				Station .			
1. Type of Well ☐ Oil Well ⊠ Gas Well ☐ Oth	8. '		8. Well Name and No. JOHNSON GAS COM B 1				
2. Name of Operator XTO ENERGY INC Contact: KRISTEN D LYNCH E-Mail: Kristen_Lynch@xtoenergy.com				S. 6. 1.	9. API Well No. 30-045-13043-00-S1		
3a. Address ENGLEWOOD, CO 80155	Ph: 505-33				(include area code) 10. Field and Pool, or Exploratory BASIN DAKOTA		
4. Location of Well (Footage, Sec., T.	, R., M., or Survey Description,	)	11. County or Parish, and State			-	
Sec 21 T27N R10W SENE 16 36.563431 N Lat, 107.894302	50FNL 0870FEL		1		SAN JUAN CO	UNTY, NM	
12. CHECK APPF	COPRIATE BOX(ES) TO	) INDICATE	NATURE OF	NOTICE, RE	EPORT, OR OTHE	R DATA	
TYPE OF SUBMISSION			TYPE O	F ACTION		A Part	
Notice of Intent	□ Acidize	Deep	ben	Producti	on (Start/Resume)	U Water Shut	-Off
	Alter Casing	G Frac	ture Treat	Reclamation		□ Well Integr	ity
□ Subsequent Report	Casing Repair	□ New	□ New Construction		lete	□ Other	
Final Abandonment Notice			and Abandon Teinporarily Abandon				
	Gr Convert to Injection		Plug Back 🔲 Water neluding estimated starting date of any p			Lans.	Ser
following completion of the involved testing has been completed. Final Ab determined that the site is ready for fi XTO Energy Inc. proposes to Loop System. Please see atta Per Onshore Order 1 Sec. III.I that was approved with this wa	andonment Notices shall be file nal inspection.) plug this well per the attac ached Current and Propos 0.4.j & Sec. XII. XTO Ene	ed only after all r ched procedu sed Wellbore rgy is amendi	equirements, inclu re. XTO will be Diagrams. ing the original	using a Clos reclamation p	, have been completed, ed <b>OIL CC</b> plan DE	NS. DIV DIS C 1 4 2015	S
plan/s on record.		B	LM'S APPROVA	L OR ACCEPT	TANCE OF THIS THE LESSEE AND		
SEE ATT/	ACHED FOR		PERATOR FROM				
CONDITIONS	OF APPROVAL		UTHORIZATION N FEDERAL AN		prior	NMOCD 24 hrs to beginning perations	
<ol> <li>I hereby certify that the foregoing is</li> <li>Control</li> </ol>	true and correct. Electronic Submission # For XTO E nmitted to AFMSS for proc	325543 verifie NERGY INC,	d by the BLM We sent to the Farm	Il Information	System		
Name (Printed/Typed) KRISTEN D LYNCH			Title REGULATORY ANALYST				
Signature (Electronic S	ubmission)		Date 12/04/2	2015			x
SEAN OF STREET	THIS SPACE FO	R FEDERA	L OR STATE	OFFICE US	SE	12 2019	24 8
Approved By JACK SAVAGE						Date 12/1	0/201
<u>Approved By JACK SAVAGE</u> Conditions of approval, if any, are attached. Approval of this notice does not warrar ertify that the applicant holds legal or equitable title to those rights in the subject leaving which would entitle the applicant to conduct operations thereon.			or land				
itle 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent s	U.S.C. Section 1212, make it a	crime for any pe	rson knowingly an	d willfully to ma	ke to any department o	r agency of the Unit	ed

8.	能用	2	0	m
N	W	U	L	U

LWA \_\_\_\_\_ MTG \_\_\_\_\_ Approved \_\_\_\_\_

## PLUG AND ABANDONMENT PROCEDURE

October 13, 2015

Johnson Gas Com "B" #1 Basin Dakota 1650' FNL and 870' FEL, Section 21, T27N, R10W San Juan County, New Mexico / API 30-045-13043 Lat: N / Lat: W


- Note: All cement volumes use 100% excess outside pipe and 50' excess inside. The stabilizing wellbore fluid will be 8.3 ppg, sufficient to balance all exposed formation pressures. All cement will be Class B, mixed at 15.6 ppg with a 1.18 cf/sx yield.
  - Install and test location rig anchors. Comply with all NMOCD, BLM, and Operator safety regulations. MOL and RU daylight pulling unit. Conduct safety meeting for all personnel on location. Record casing, tubing and bradenhead pressures. NU relief line and blow down well. Kill well with water as necessary and at least pump tubing capacity of water down the tubing. ND wellhead and NU BOP. Function test BOP.

If this well has rods or a packer, then modify the work sequence in step #2 as appropriate. Round trip mill to 3420'.

NOTE: additional cement calculated for plugs below Mesaverde interval due to casing leak.

- See COA
   Plug #1 (Dakota perforations and top, 6334' 6234'): RIH and tag existing CIBP at 6334'. . Circulate well clean. <u>If casing does not test then spot or tag subsequent plugs as</u> <u>appropriate</u>. Mix 12 sxs Class B cement inside casing from 6265' to 6165' to cover the Dakota top. PUH and WOC. TIH and tag cement 50' above Dakota top. If necessary top off cement. PUH.
- Plug #2 (Gallup top, 5425' 5325'): Spot 15 sxs Class B cement inside casing from 5425' to 5325' to cover the Gallup top. PUH and WOC. TIH and tag cement 50' above Gallup top. If necessary top off cement. PUH.
- See COA
   Plug #3 (Mancos top, 4560' 4460'): Spot 15 sxs Class B cement inside casing from 4560' to 4460' to cover the Mancos top. PUH and WOC. TIH and tag cement 50' above Mancos top. If necessary top off cement. PUH.
- Plug #4 (Mesaverde top, 3470' 3370'): Perforate squeeze holes 3470'. TIH and set CR at 3420'. Mix and pump 57 sxs Class B cement, squeeze 42 sxs outside 4.5" casing and leave 15 sxs inside casing to cover the Mesaverde top. TOH.

- See CoA
   Plug #5 (Chacra, Pictured Cliffs and Fruitland tops, 1980' 1590'): Mix and pump 34 sxs
   Class B cement and spot a balanced plug inside casing to cover through the Fruitland top. TOH.
- See CoA Plug #6 (Kirtland and Ojo Alamo tops, 1050' – 935'): Perforate squeeze holes 1050'. TIH and set CR at 1000'. Mix and pump 58 sxs Class B cement, squeeze 45 sxs outside 4.5" casing and leave 13 sxs inside casing to cover through the Ojo Alamo top. TOH and LD tubing.
- Plug #7 (9.625" casing shoe, 402' 0'): Perforate 3 squeeze holes at 402'. Attempt to
  establish a rate. If able to establish circulation then mix and pump 155 sxs Class B cement to
  surface. If unable to establish circulation perforate a second squeeze hole at 402'. Mix and
  pump above 155 sxs cement down 4.5" casing and out annulus. Circulate good cement.
- ND cementing valves and cut off wellhead. Fill annuli with cement as necessary. Install P&A
  marker to comply with regulations. Record GPS coordinate for P&A marker on tower report.
  Photograph P&A marker in place. RD, MOL and cut off anchors. Restore location per BLM
  stipulations

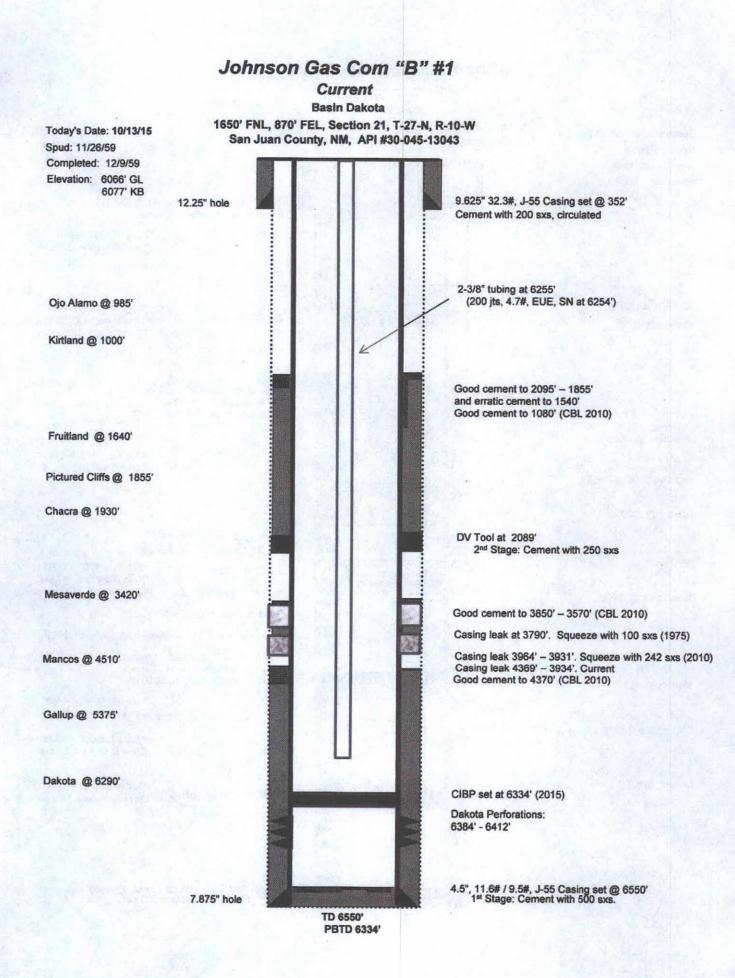

	Joh		Gas Co Proposed Basin Dake	P&A	¥1		
Today's Date: <b>10/13/15</b> Spud: 11/26/59	1650' FNL, 870' FEL, Section 21, T-27-N, R-10-W San Juan County, NM, API #30-045-13043						
Completed: 12/9/59 Elevation: 6066' GL 6077' KB	12.25" hole				9.625" 32.3#, J-55 Casing Cement with 200 sxs. circu		
				P	Perforate @ 402'	Plug #7: 402' - 0' Class B cement,155 sxs	
Ojo Alamo @ 985' Kirtland @ 1000'					Set CR @ 1000'	Plug #6: 1050' – 935' Class B cement, 58 sxs: 13 inside and 45 outside	
				P	Perforate @ 1050'		
					Good cement to 2095' – 18 and erratic cement to 1540 Good cement to 1080' (CB	CONTRACTOR AND	
Fruitland @ 1640'						Plug #5: 1980' – 1590'	
Pictured Cliffs @ 1855'						Class B cement,34 sxs	
Chacra @ 1930'					DV Tool at 2089'		
					2 <sup>nd</sup> Stage: Cement wit Set CR @ 3420'	h 250 sxs Plug #4: 3470' – 3370' Class B cement, 57 sxs:	
Mesaverde @ 3420'					Perforate @ 3470'	15 inside and 42 outside	
			N.E.		Good cement to 3850' - 35 Casing leak at 3790'. Squ	and the second se	
Mancos @ 4510'				F	Casing leak 3964' – 3931' Casing leak 4369' – 3934' Good cement to 4370' (CB		
Malicos (2 4510						Plug #3: 4560' - 4460' Class B cement, 15 sxs	
Gallup @ 5375'						Plug #2: 5425' – 5325' Class B cement, 15 sxs	
Dakota @ 6290'		WY -			CIBP set at 6334' (2015) Dakota Perforations: 6384' - 6412'	Plug #1: 6334' - 6234' Class B cement, 15 sxs	
	7.875" hole		TD 6550' PBTD 63	34'	4.5", 11.6# / 9.5#, J-55 Ca 1 <sup>st</sup> Stage: Cement with	sing set @ 6550′ 500 sxs.	

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE 6251 COLLEGE BLVD.

FARMINGTON, NEW MEXICO 87402

Attachment to notice of Intention to Abandon:

Re: Permanent Abandonment Well: Johnson GC B #1

## CONDITIONS OF APPROVAL

1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."

2. Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 564-7750.

3. The following modifications to your plugging program are to be made:

- a) Bring the top of Plug #1 to 6213 ft. to cover the top of the Graneros. BLM picks top of Graneros at 6263 ft. Adjust cement volume accordingly.
- b) Set Plug #3 (4603-4503) ft. to cover the top of the Mancos. BLM picks top of Mancos at 4553 ft.
- c) Bring the top of Plug #4 to 3352 ft. inside/outside to cover the top of the Mesaverde. BLM picks top of Cliff House at 3402 ft.
- d) Bring the top of Plug #5 to 1467 ft. to cover the top of the Fruitland. BLM picks top of Fruitland at 1517 ft. Adjust cement volume accordingly.
- e) Bring the top of Plug #6 to 817 ft. inside/outside to cover the top of the Ojo Alamo. BLM picks top of Ojo Alamo at 867 ft. Adjust cement volume accordingly.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.