

District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
811 S. First St., Artesia, NM 88210  
District III  
1000 Rio Brazos Road, Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy Minerals and Natural Resources

Oil Conservation Division  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

Form C-141  
Revised April 3, 2017

Submit 1 Copy to appropriate District Office in  
conformance with 19.15.29 NMAC.

OIL CONS. DIV. DIST. 3

DEC 29 2017

Release Notification and Corrective Action

OPERATOR

☒ Initial Report ☐ Final Report

Name of Company Hilcorp Energy Company	Contact Clara Cardoza
Address 9a CR 5793	Telephone No. 505-564-0733
Facility Name Hubbell Federal #1M	Facility Type Well

Surface Owner Federal (SF-078716-A)	Mineral Owner Federal	API No. 30-045-32809
-------------------------------------	-----------------------	----------------------

LOCATION OF RELEASE

Unit Letter P	Section 07	Township 29N	Range 10W	Feet from the 1090	North/South Line South	Feet from the 900	East/West Line East	County San Juan
------------------	---------------	-----------------	--------------	-----------------------	---------------------------	----------------------	------------------------	--------------------

Latitude 36.7363281 Longitude -107.9198074 NAD83

NATURE OF RELEASE

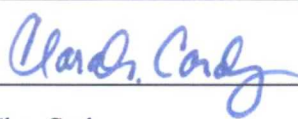
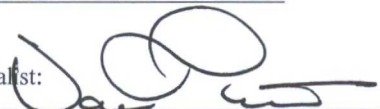
Type of Release Hydrocarbon	Volume of Release 15 bbl	Volume Recovered 9 bbls
Source of Release Tank	Date and Hour of Occurrence Unknown	Date and Hour of Discovery 12/20/2017 04:00 pm
Was Immediate Notice Given? <input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> Not Required	If YES, To Whom?	
By Whom?	Date and Hour	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.\*

Describe Cause of Problem and Remedial Action Taken.\*  
During field operator's routine visit to site found the oil dump leaking and immediately shut in the location. A spec truck was called out to transfer remaining contents of the tank to prevent further loss. Also, was able to recover 9 bbls of product that was at the surface. Leak on the dump line was caused by corrosion.

Describe Area Affected and Cleanup Action Taken.\*  
Hydrocarbon was contained in the bermed area and a truck was called to remove free standing liquid and impacted soil. Confirmation sampling will be scheduled early 2018.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: 	OIL CONSERVATION DIVISION	
Printed Name: Clara Cardoza	Approved by Environmental Specialist: 	
Title: Environmental Specialist	Approval Date: 1/2/2018	Expiration Date:
E-mail Address: ccardoza@hilcorp.com	Conditions of Approval: Sample Area	Attached <input type="checkbox"/>
Date: 12/27/2017	Phone: 505-564-0733	8015/8021/Clarides

\* Attach Additional Sheets If Necessary

Provide OGD 24 hour notification  
prior to sampling NVE1800248261