Form	3160-5
Lune	2015)

# UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED
OMB NO. 1004-0137
Expires: January 31, 20

5. Lease Serial No.

SUNDRY NOTICES AND REPORTS ON WELLS  Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.					NMSF078926			
					6. If Indian, Allottee or Tribe Name EASTERN NAVAJO			
SUBMIT IN TRIPLICATE - Other instructions on page 2					7. If Unit or CA/Agreement, Name and/or No. 892000844L			
1. Type of Well					8. Well Name and No. GALLEGOS CANYON UNIT 393			
Oil Well Gas Well Other: COAL BED METHANE  2. Name of Operator Contact: TOYA COLVIN					9. API Well No.			
BP AMERICA PRODUCTION CO E-Mail: Toya.Colvin@bp.com					30-045-28265-00-S1			
3a. Address 200 ENERGY COURT FARMINGTON, NM 87401	. (include area code) 6.7148		Field and Pool or Exploratory Area     BASIN FRUITLAND COAL					
4. Location of Well (Footage, Sec., T		11. County or Parish, State						
Sec 25 T29N R13W SESW 0975FSL 1480FWL 36.692730 N Lat, 108.161000 W Lon					SAN JUAN COUNTY, NM			
12. CHECK THE A	PPROPRIATE BOX(ES)	TO INDICA	TE NATURE O	F NOTICE,	REPORT, OR OTH	ER DATA		
TYPE OF SUBMISSION								
Notice of Intent	☐ Acidize	□ Deepen □ Pro		☐ Product	ion (Start/Resume)	☐ Water Shut-Off		
	☐ Alter Casing	☐ Hyd	raulic Fracturing	☐ Reclama	ation	■ Well Integrity		
☐ Subsequent Report	□ Casing Repair	□ New	Construction	□ Recomp	lete	☐ Other		
☐ Final Abandonment Notice	☐ Change Plans	Plug	and Abandon	☐ Tempore	arily Abandon			
<i>BK</i>	☐ Convert to Injection	Plug Back		☐ Water D	Water Disposal			
If the proposal is to deepen directions Attach the Bond under which the wor following completion of the involved testing has been completed. Final Ab determined that the site is ready for fi  BP requests to P&A the subject	rk will be performed or provide operations. If the operation resonandonment Notices must be file inal inspection.  ct well. Please see the att	the Bond No. or sults in a multipled only after all eached P&A p	a file with BLM/BIA e completion or reco requirements, includer rocedure and we	Required sub impletion in a r ing reclamation ellbore docu	sequent reports must be new interval, a Form 3160 n, have been completed a	filed within 30 days 0-4 must be filed once		
In accordance with NMOCD P operations.	•			stem during				
*Please note this well is privat	CD							
Notify NMOCD 24 hrs prior to beginning operations								
			* #	DISTRI	CT III			
14. I hereby certify that the foregoing is	true and correct.  Electronic Submission #4  For BP AMERICA  mmitted to AFMSS for proc	N PRODUCTIQ	by the BLM Wel	i information	System			
Namc (Printed/Typed) TOYA COLVIN			Title REGULATORY ANALYST					
Signature (Electronic S	Submission)		Date 05/04/2018					
THIS SPACE FOR FEDERAL OR STATE OFFICE USE								
_Approved By_JACK SAVAGE			TitlePETROLE	TitlePETROLEUM ENGINEER Date 06/04/2018				
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.			Office Farmington					

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)
\*\*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\*

### **BP** America

# Plug And Abandonment Procedure GCU 393

975' FSL & 1480' FWL, Section 25, T29N, R13W San Juan County, NM / API 30-045-28265

- 1. Hold pre-job safety meeting. Comply with all NMOCD, BLM safety and environmental regulations. Test rig anchors prior to moving in rig if not rigged to base beam.
- 2. Check casing, tubing, and bradenhead pressures.
- 3. Remove existing piping on casing valve. RU blow lines from casing valves and begin blowing down casing pressure. Kill well as necessary. Ensure well is dead or on a vacuum.
- 4. ND wellhead and NU BOP. Function test BOP.
- 5. P/U 4-1/2" bit or casing scraper on 2-3/8" workstring and round trip as deep as possible above top perforation at 1474'.
- 6. P/U 4-1/2" CR, RIH and set CR at +/- 1424'. Pressure test tubing to 1000 psi. Sting out of CR. Load hole, and pressure test casing to 800 psi. If casing does not test, then spot or tag subsequent plugs as appropriate. POOH w/ tubing.
- 7. Rig up to pump cement down tubing. Pump water to establish rate down tubing.

NOTE: All Plugs Include 100% excess outside casing and 50% Excess inside casing

9. Plug 1 (Pictured Cliffs Interval, Fruitland Formation Top 1424'-1093', 30 Sacks Class B Cement)

Mix 30 sx Class B cement and spot a balanced plug inside casing to cover Pictured Cliffs interval and Fruitland formation top.

10. Plug 2 (Kirtland, Ojo Alamo Formation Tops and Surface Shoe 298's surface, 60 Sacks Class B Cement)

Attempt to pressure test the bradenhead annulus to 300 psi; note the volume to load. If BH annulus holds pressure, then establish circulation out casing valve with water. Mix approximately 60 sx Class B cement and spot a balanced plug from 298' to surface, circulate good cement out of casing valve. TOH and LD tubing. Shut well in and WOC. If BH annulus does not test, then perforate at the appropriate depth and attempt to circulate cement to surface filling the casing from 298' and the annulus from the squeeze holes to surface. Shut in well and WOC.

11. ND cementing valves and cut off wellhead. Fill annuli with cement as necessary. Install P&A marker to comply with regulations. Record GPS coordinate for P&A marker on tower report. Photograph P&A marker in place. RD, MOL and restore location per BLM stipulations.

## **Wellbore Diagram**

**Gallegos Canyon Unit 393** API #: 3004528265 San Juan, New Mexico

#### Plug 2

298 feet - Surface 298 feet plug 60 sacks of Class B Cement

### Plug 1

1424 feet - 1093 feet 371 feet plug 331 sacks of Class B Cement

# **Surface Casing**

7" 23#@134ft

### **Formation**


Ojo Alamo - 63 feet Kirtland - 248 feet Fruitland Coal - 1193 feet

Retainer @ 1424 feet

**Production Casing** 4.5" 10.5# @ 1633 ft

**Perforations** 

1474 feet - 1481 feet 1485 feet - 1507 feet

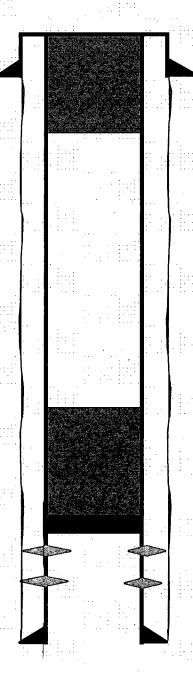

# UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE

6251 COLLEGE BLVD. FARMINGTON, NEW MEXICO 87402

Attachment to notice of Intention to Abandon:

Re: Permanent Abandonment Well: Gallegos Canyon Unit 393

### CONDITIONS OF APPROVAL

- 1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
- 2. Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 564-7750.

Low concentrations of H₂S (<100 ppm GSV) have been reported in the SWSW/4 Sec. 26, 29N, 13W.

Operator must run a CBL to verify cement top. Submit the electronic copy of the log for verification to the following addresses: <a href="mailto:jwsavage@blm.gov">jwsavage@blm.gov</a> Brandon.Powell@state.nm.us

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.